
TARGETED BROWNFIELDS ASSESSMENT PHASE I ENVIRONMENTAL SITE ASSESSMENT

**101 NORTH BEATON STREET
CORSICANA, TEXAS 75110**



May 5, 2011



May 5, 2011

TARGETED BROWNFIELDS ASSESSMENT

PHASE I

ENVIRONMENTAL SITE ASSESSMENT

**101 North Beaton Street
Corsicana, Texas 75110**

Contract No. W912P8-09-D-0004
GEC Project No. 9827.3160109.000

Prepared for:



U.S. Army Corps of Engineers
New Orleans District
New Orleans, Louisiana

Prepared by:



9357 Interline Avenue
Baton Rouge, Louisiana 70809
225.612-3000

TABLE OF CONTENTS

TABLE OF CONTENTS

Section	Page
1.0 SUMMARY	1
2.0 INTRODUCTION.....	1
2.1 Purpose	1
2.2 Scope of Services	2
2.3 Significant Assumptions	2
2.4 Limitations and Exceptions.....	2
2.5 Special Terms and Conditions.....	3
2.6 User Reliance	3
3.0 SITE DESCRIPTION	3
3.1 Location and Legal Description	3
3.2 Site Vicinity and General Characteristics.....	5
3.2.1 Geologic, Hydrogeologic, Topographic, and Soil Conditions	5
3.3 Current Use of Property	7
3.4 Description of Structures, Roads, and Other Improvements on Site	7
3.5 Current Uses of Adjoining Properties	7
4.0 USER PROVIDED INFORMATION.....	7
4.1 Title Records.....	8
4.2 Environmental Liens or Activity and Use Limitations.....	8
4.3 Specialized Knowledge.....	8
4.4 Commonly Known or Reasonably Ascertainable Information.....	8
4.5 Valuation Reduction for Environmental Issues	8
4.6 Owner, Property Manager, and Occupant Information	8
5.0 RECORDS REVIEW	8
5.1 Standard Environmental Record Sources.....	9
5.2 Additional Environmental Record Sources	16
5.3 Physical Setting Sources	17
5.4 Historical Use Information on Property and Adjoining Properties	17
5.4.1 Historical City Directories	17
5.4.2 Sanborn® Fire Insurance Maps	18
5.4.3 Historical Topographic Maps.....	20
5.4.4 Historical Aerial Photographs.....	20

TABLE OF CONTENTS (cont'd)

Section	Page
6.0 SITE RECONNAISSANCE	21
6.1 Methodology and Limiting Conditions	21
6.2 General Site Setting	22
6.3 Exterior Observations	22
6.3.1 Pits, Ponds, or Lagoons	22
6.3.2 Stained Soil or Pavement	22
6.3.3 Stressed Vegetation	22
6.3.4 Solid Waste	22
6.3.5 Wells	22
6.3.6 Septic Systems	22
6.3.7 Oil and Gas Drilling Activities	22
6.3.8 Storage Tanks	23
6.3.9 Odors	23
6.3.10 Pools of Liquid	23
6.3.11 Drums and Containers	23
6.3.12 Unidentified Substance Containers	23
6.3.13 Polychlorinated Biphenyls (PCBs)	23
6.4 Interior Observations	23
6.4.1 Heating/Cooling	24
6.4.2 Stains or Corrosion	24
6.4.3 Drains or Sumps	24
7.0 INTERVIEWS	24
8.0 FINDINGS	25
8.1 Potential REC Sites Outside Target Property Limits	26
8.2 REC at Target Property	35
9.0 OPINION	36
9.1 Data Gaps	36
10.0 CONCLUSIONS	36
11.0 DEVIATIONS	36
12.0 ADDITIONAL SERVICES	36

TABLE OF CONTENTS (cont'd)

Section	Page
12.1 Asbestos-Containing Materials	36
12.2 Lead Based Paint.....	37
13.0 SIGNATURE OF ENVIRONMENTAL PROFESSIONALS	37
14.0 QUALIFICATIONS OF ENVIRONMENTAL PROFESSIONALS.....	37
14.1 Jennifer Lindquist	37

LIST OF APPENDICES

Appendix A:	REFERENCES
Appendix B:	TITLE HISTORY AND LIEN SEARCH
Appendix C:	BUILDING PLANS
Appendix D:	EDR ENVIRONMENTAL DATABASE SEARCH
Appendix E:	HISTORICAL TENANT SEARCH
Appendix F:	SANBORN MAPS
Appendix G:	HISTORICAL TOPOGRAPHIC MAPS
Appendix H:	HISTORICAL AERIAL MAPS
Appendix I:	PHOTOGRAPHS

LIST OF TABLES

Number	Page
1	Potential Sites Identified in Federal and State Databases 10

LIST OF FIGURES

Number	Page
1	Project Location Map 4
2	Site Vicinity Map..... 6

**PHASE I
ENVIRONMENTAL
SITE ASSESSMENT**

1.0 SUMMARY

On behalf of the U.S. Army Corps of Engineers – New Orleans District (USACE), G.E.C., Inc. (GEC) has completed a Phase I Environmental Site Assessment (ESA) for the property located at 101 North Beaton Street, Corsicana, Texas. The property consists a 0.495-acre lot located at the corner of North Beaton and East Collins and improved with an eight-story building constructed in 1926. For the purpose of this ESA, “the property” refers to the entire 0.495-acre lot and all improvements therein.

The City of Corsicana has requested the assistance of the U.S. Environmental Protection Agency (EPA) to conduct an ESA of the property in accordance with applicable portions of American Society for Testing and Materials (ASTM) Standard E 1527-05 *Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process* in order to identify recognized environmental conditions (REC) located on or in the vicinity of the property.

This assessment was provided through the EPA's Targeted Brownfields Assessment (TBA) program. EPA's Brownfields program empowers states, Tribes, communities and other stakeholders to work together to assess, clean up, and sustainably reuse brownfields. A brownfields is a property, the expansion, redevelopment or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. The EPA Region 6 Brownfields Team funded the USACE to execute the work reflected in this report.

In order to characterize environmental conditions for the project, GEC:

- Reviewed federal, state, and local environmental databases;
- Conducted historical research;
- Interviewed pertinent personnel; and
- Performed a site investigation.

GEC performed this Phase I ESA in accordance with the scope and limitations of ASTM E 1527-05. Any exceptions to, or departures from, this practice are described in the report. Based on the review of federal, state, and local environmental databases, historical research, interviews, and site investigations, this assessment has revealed evidence of one potential recognized environmental condition that might have adversely impacted environmental conditions at the property: the possibility that there is an oil tank in the basement. Asbestos-containing material (ACM) and lead based paint may also be present in the building on the property.

2.0 INTRODUCTION

2.1 Purpose

The purpose of the assessment is to identify any potential RECs located on or in the vicinity of 101 North Beaton Street, Corsicana, Texas, that have, or may have in the past, adversely impacted environmental conditions at the property.

2.2 Scope of Services

As outlined in its contract with the USACE, GEC is responsible for investigating the property in order to identify RECs within and adjacent to the property. Investigation procedures comply with ASTM E 1527-05, and the scope of services for this ESA includes the following:

- Research of available federal, state, and local environmental databases for potential REC sites on, or within a specified distance of, the property;
- Reviews of historical aerial photographs, Sanborn® Fire Insurance Maps, United States Geologic Survey (USGS) topographic maps, and/or published soils and geologic information;
- Interviews with state and local government agency representatives and/or persons knowledgeable of the property regarding documented inspections, violations, incidents, spill response, or past uses of therein;
- Visual observations of accessible portions of the property to identify current and historical REC sites. Visual observations of accessible portions of properties adjacent to the property were also conducted; and
- Preparation of a written report that identifies whether the property contains potential REC and whether or not conditions warrant further investigation.

In accordance with the procedures outlined in ASTM E 1527-05, a Phase I ESA typically does not include sampling and analysis of soil and/or groundwater. Additionally, a Phase I ESA typically does not include wetland delineations or surveys for cultural or historic resources, threatened or endangered species, lead based paint, or asbestos containing materials. However, the EPA has requested that asbestos and lead-based paint observations be included as additional considerations to this Phase I ESA.

2.3 Significant Assumptions

No significant assumptions were made in the preparation of this Phase I ESA.

2.4 Limitations and Exceptions

GEC's review of record information and environmental databases included information that was reasonably ascertainable from standard sources. *Reasonably ascertainable* denotes (1) information that is publicly available, (2) information that is obtainable within reasonable time and cost constraints, and (3) information that is practically reviewable. GEC's review included information gathered directly from governmental and regulatory agencies as well as an electronic database search performed by Environmental Data Resources, Inc. (EDR). References used in the preparation of this document are included in Appendix A. Much of this information was gathered from public records and sources maintained by third parties. Although reasonable care was taken to verify this information, GEC does not accept responsibility for errors, omissions or inaccurate information.

GEC interviewed available individuals identified as having current and historical knowledge of land use, commercial and residential development, and activities and incidents associated with the property. *Available individuals* include (1) persons with whom contact can be made within reasonable time constraints, and (2) persons willing to share information with interviewers. These individuals were selected based on their employment in state and local government, association with, or proximity to, specific properties, or long-time residence in and knowledge of the area. Significant effort was made to identify and contact individuals possessing direct knowledge of sites; however, no guarantee is made or intended that all individuals with pertinent knowledge of sites were identified and interviewed. Additionally, GEC makes no guarantee that information provided during the interviews is free of errors, omissions, or inaccurate information.

Observations made during GEC's reconnaissance of the property were limited to (1) sites or portions of sites that were accessible to investigators, and (2) evidence that was visible to the investigators. Observations were based on evidence that was visible to inspectors while walking the property. No ground excavation, vegetation clearing, or physical relocation of obstacles was conducted during site investigations. Accordingly, no guarantee is made or intended that all property conditions were observed.

2.5 Special Terms and Conditions

No special terms or conditions significant with respect to ASTM E 1527-05 standards were made.

2.6 User Reliance


In accordance with ASTM E 1527-05 Section 7.5.2.1, *Reliance*, GEC is not required to verify independently the information provided by various sources but may rely on the information unless there is actual knowledge that certain information is incorrect or unless it is obvious that certain information is incorrect based on other information obtained during the course of the investigation or otherwise actually known to the investigators conducting the assessment. However, GEC has no indications that the information provided by outside sources is incorrect.

3.0 SITE DESCRIPTION

3.1 Location and Legal Description

The property consists of a 0.495-acre lot at the corner of North Beaton and East Collin (Figure 1) and includes the 100 block fronting east Collin and the 100 block fronting North Commerce Street. The physical address of the property is 101 North Beaton Street, Corsicana, Texas, and is centered at approximately 32° 5' 37.0" N latitude and - 96° 27' 49.0" W longitude. The property is improved with an eight-story commercial building constructed in 1926 as a State National Bank.

The legal description of the property as described in the title work (Appendix B) is:

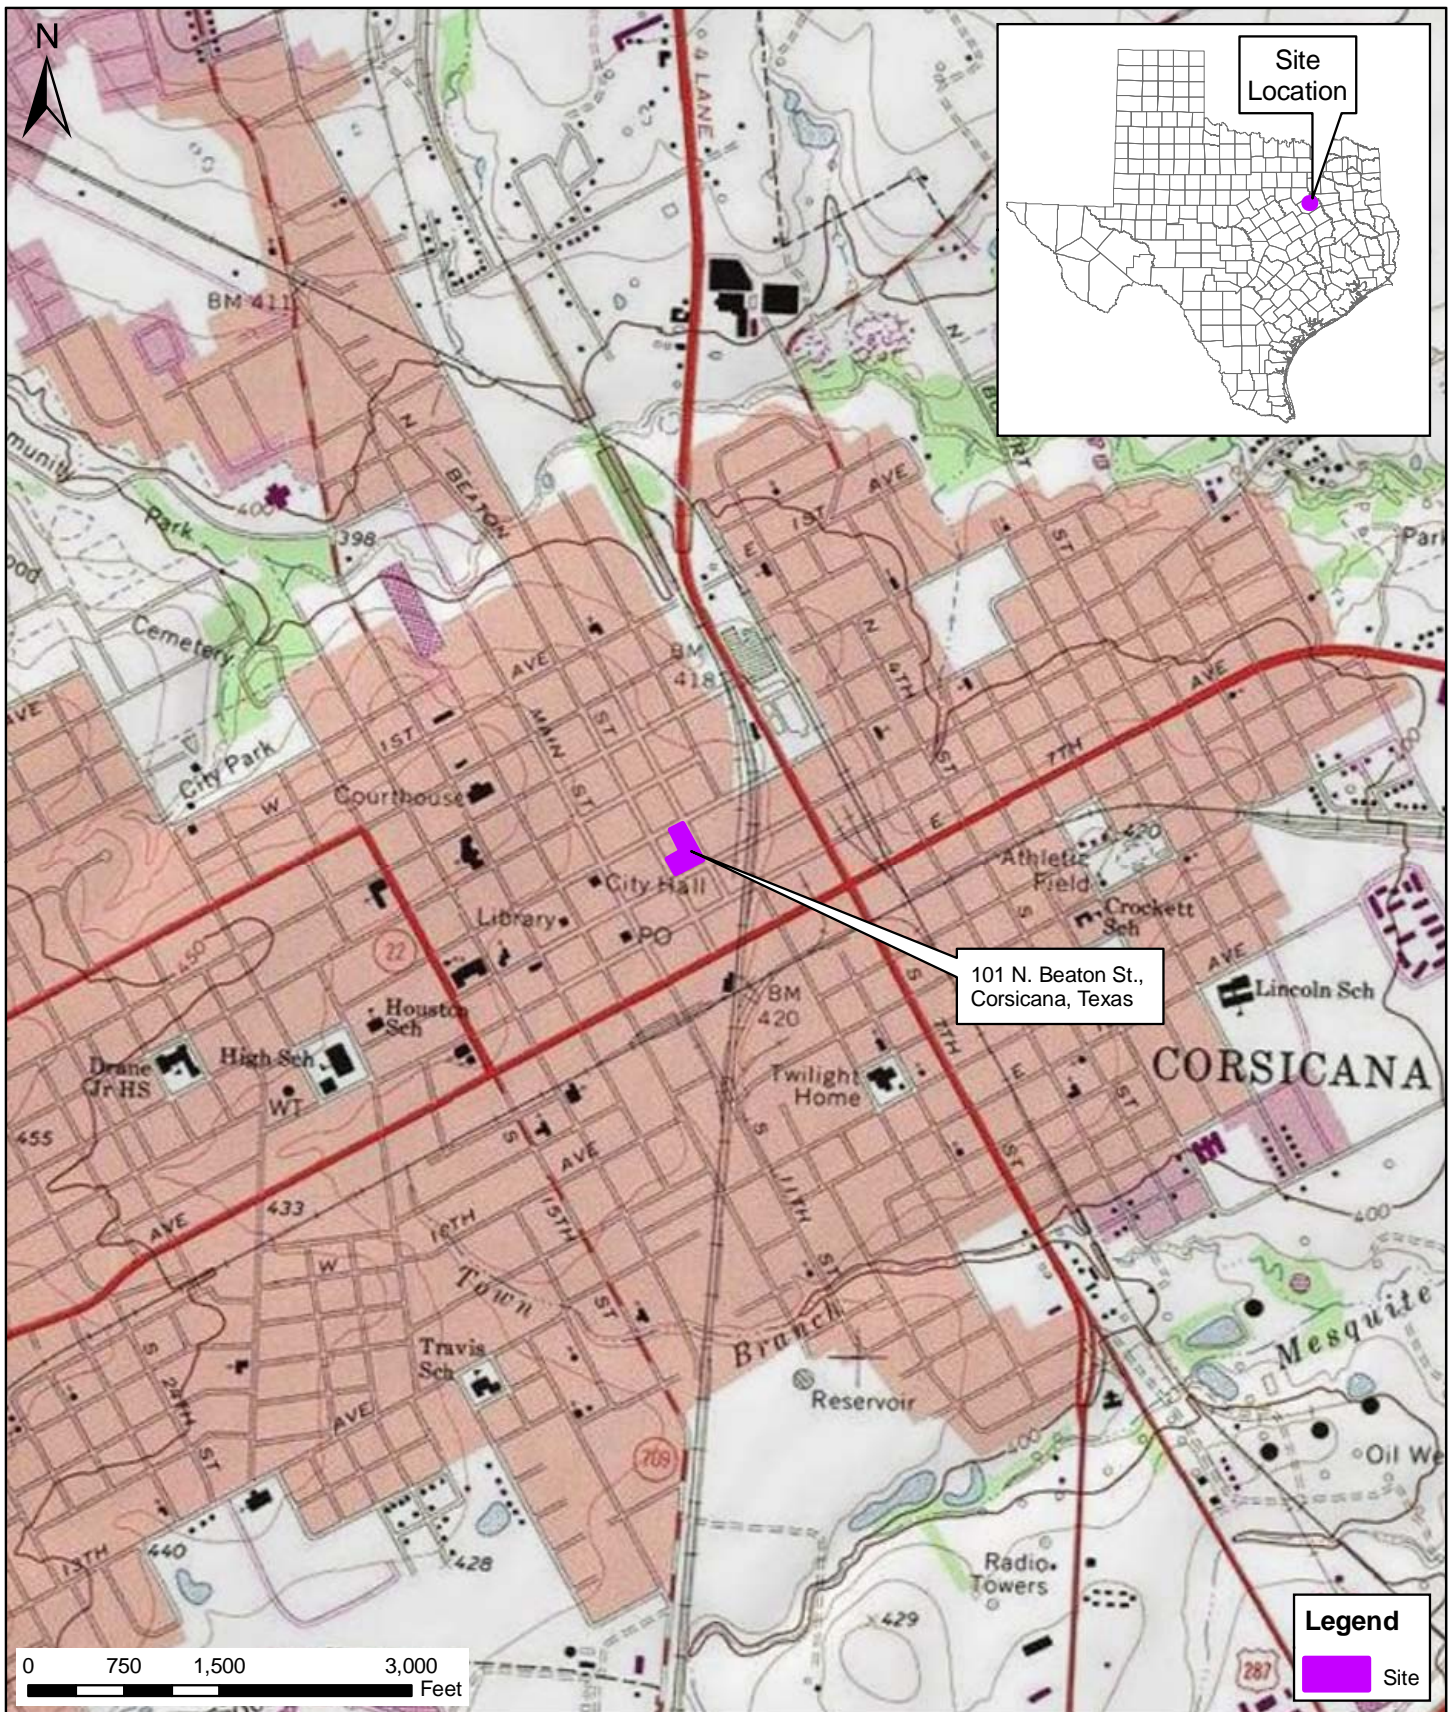

SITE LOCATION MAP

Phase I Environmental Site Assessment
101 N. Beaton St.
Corsicana, Texas

USGS 1:24,000 Quadrangle Map: Corsicana (1979)



Gulf Engineers & Consultants

Figure: 1

Date: April 2011

Scale: 1:18,000

Source: USGS/GEC

Map ID: 273160010-2761

TRACT I: A 0.495 ACRE PARCEL OF LAND SITUATED IN THE CITY OF CORSICANA, LOCATED IN NAVARRO COUNTY, TEXAS, BEING LOTS 16 THRU 24, IN BLOCK 242, ACCORDING TO THE OFFICIAL MAP OF THE CITY OF CORSICANA, TEXAS.

TRACT II: A 0.604 ACRE PARCEL OF LAND SITUATED IN THE CITY OF CORSICANA, LOCATED IN NAVARRO COUNTY, TEXAS, BEING LOTS 1 THRU 10 AND THE EAST 50 FEET OF LOTS 11 AND 12, IN BLOCK 242, ACCORDING TO THE OFFICIAL MAP OF THE CITY OF CORSICANA, TEXAS.

3.2 Site Vicinity and General Characteristics

The City of Corsicana is located in Navarro County in north central Texas. The City is the county seat of Navarro County and is located 53 miles to the southeast of the Dallas/Fort Worth Metroplex area and 54 miles northeast of Waco. The U.S. Census 2009 population estimate for the City of Corsicana was 26,252 people. Corsicana is the location where oil was first discovered to the west of the Mississippi River, thus establishing the city as an industrial and commercial center. Therefore, Corsicana became the first Texas oil boom town, and one of Texas' wealthiest cities. The area has the longest continuous oil flow in Texas, with a total production in excess of 200 million barrels since 1895. Minerals produced in the area include oil, gas, sand, and gravel. Corsicana is now defined by its impressive portfolio of diverse industries including information technology, advanced manufacturing, chemical engineering, distribution, logistics and transportation, railroads, oil and natural gas, and agriculture and cattle.


The property is located within the historic downtown area of Corsicana. Land use in the vicinity of the property (Figure 2) is commercial. The elevation of the property is approximately 424 feet above Mean Sea Level (MSL).

3.2.1 Geologic, Hydrogeologic, Topographic, and Soil Conditions

Geology. The property is located within the City of Corsicana in Navarro County, Texas. During most of the Late Cretaceous geologic period, much of Texas lay beneath marine waters. Delta and strandline sandstones originated in near shore areas and are the reservoir rocks of the most prolific oilfield in Texas. The Upper Cretaceous rocks dip southeastward beneath the East Texas and Gulf Coast basins. Eocene Claiborne Group stratified sequences of the Tertiary period overlay the oil-bearing Cretaceous era formations in the region.

The major structural feature in the county is the Mildred-Powell Graben located southeast of the City of Corsicana, which is a part of the Mexia-Talco Fault system. The rock strata associated with the Mexia-Talco Fault system are intricately faulted and locally folded into a deep structural trough that trends northeastward through the central part of Navarro County. The Mildred Fault bounds the graben on the northwest and the Powell Fault bounds it on the southeast.

Hydrogeology. The geologic units that contain fresh to slightly saline water in Navarro County are, from oldest to youngest: The Hosston Formation, Travis Peak Formation, Paluxy Sand, Woodbine Formation, Taylor Marl, and Navarro Group of Cretaceous age; the Midway and Wilcox Groups of Tertiary age; and the alluvial deposits of Quaternary age. Only the Taylor Marl and younger formations crop out in Navarro County. The Navarro Group and associated Nacatoch Sand formations outcrop in the vicinity of the property.

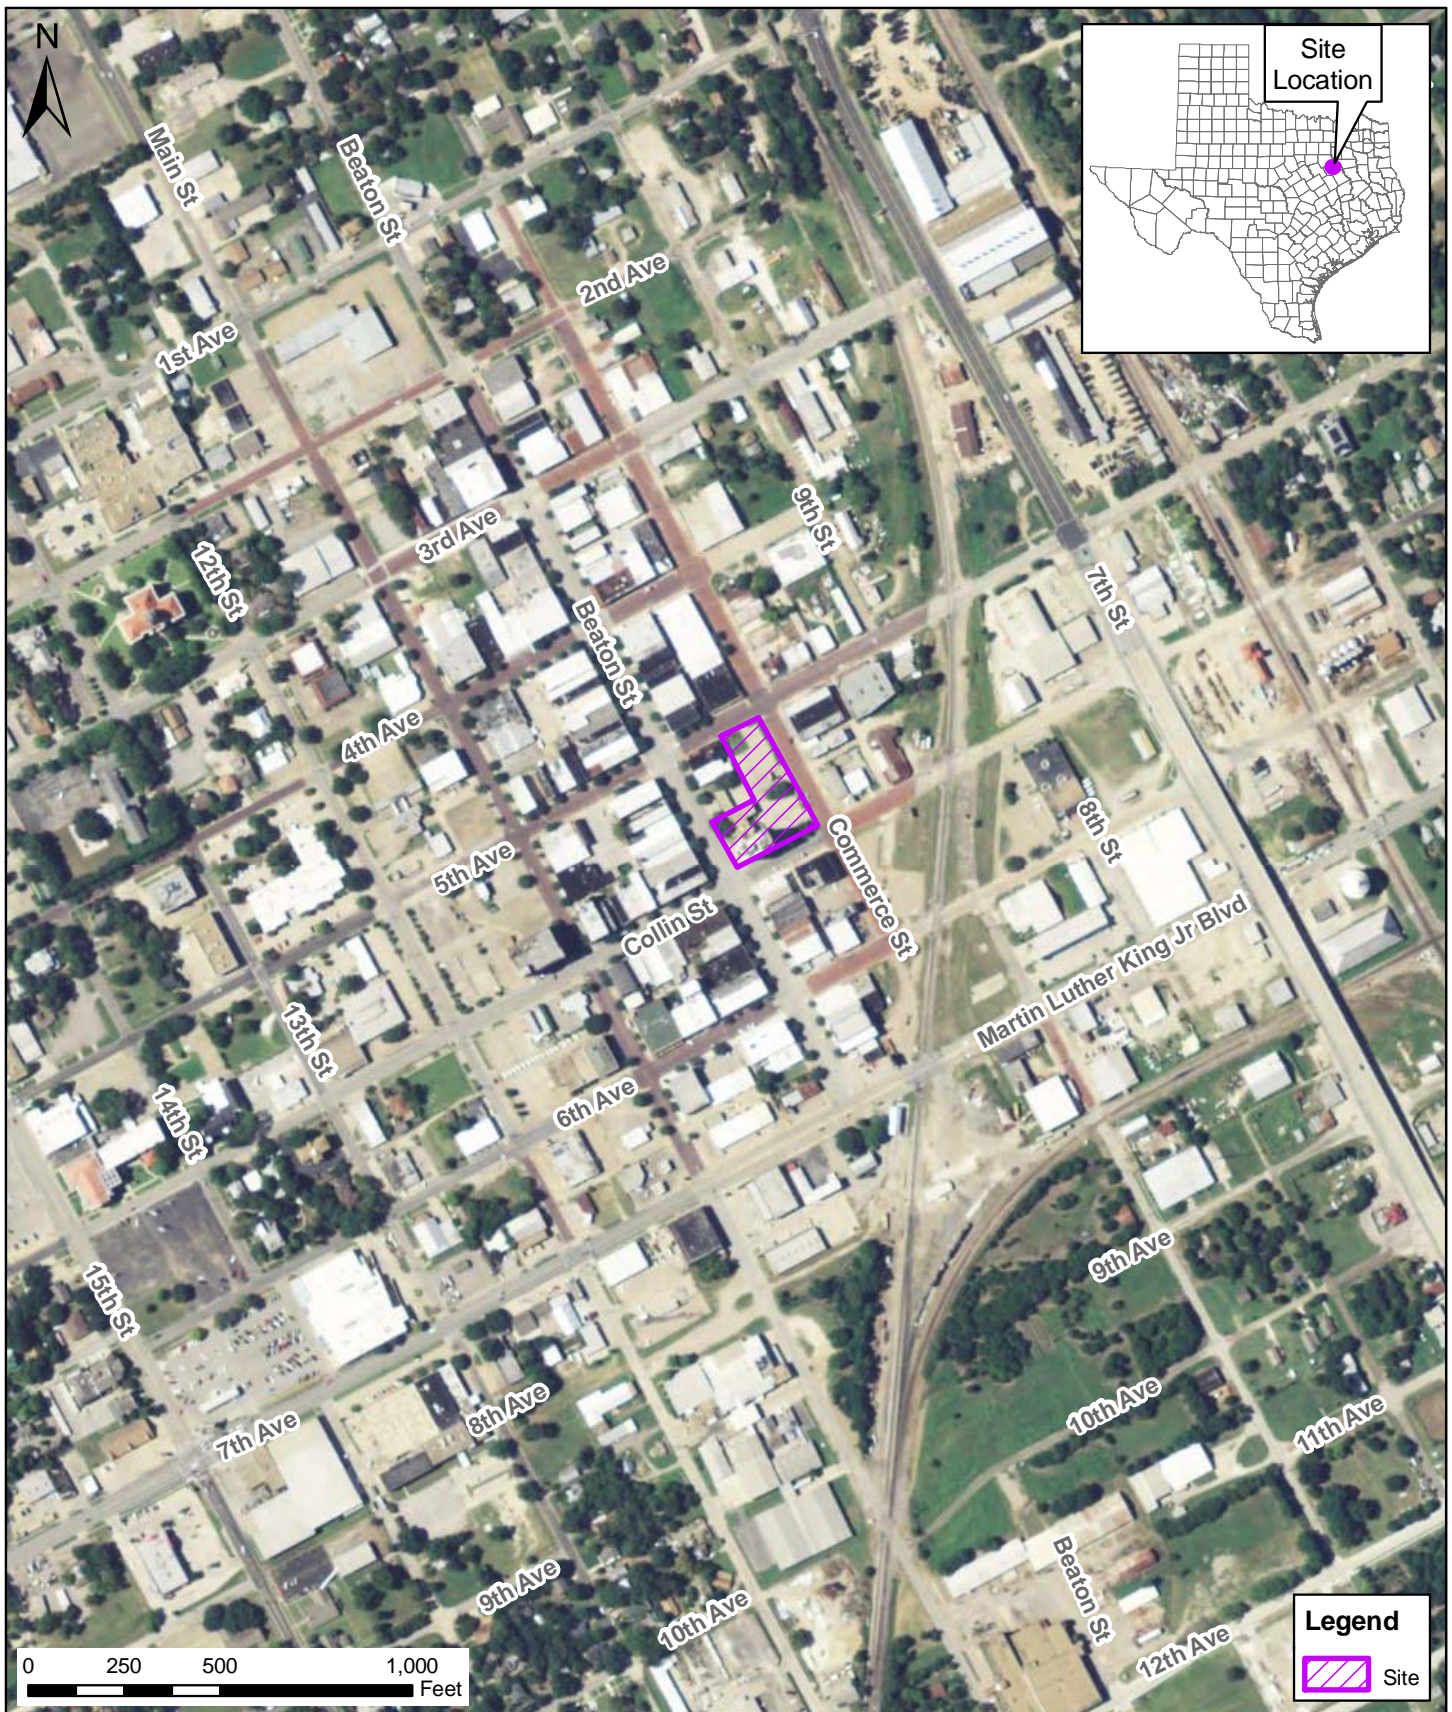

SITE VICINITY MAP

Phase I Environmental Site Assessment
101 N. Beaton St.
Corsicana, Texas

2010 USDA-FSA-APFO NAIP MrSID Mosaic; Navarro County, Texas



Gulf Engineers & Consultants

Figure: 2

Date: April 2011

Scale: 1:6,000

Source: USDA/GEC

Map ID: 273160010-2762

Topography. Corsicana lies within the drainage basin of the Trinity River. The surface topography in the vicinity of the property slopes from higher elevations in the western part of the City (450 feet above MSL) to the lower elevations associated with the drainage basins in the eastern portions of the City (400 feet above MSL).

Soils. The soils on the property are classified as Wilson Clay Loam, 0 to 1 percent slopes. These soils formed from clayey alluvium of quaternary age and are found on stream terraces. Wilson Clay Loam is moderately well drained and not prone to ponding or flooding.

3.3 Current Use of Property

The first floor of the eight-story building is currently occupied and used as a commercial business. The remaining floors are vacant.

3.4 Description of Structures, Roads, and Other Improvements on Site

The property consists of a 0.495-acre lot at the corner of North Beaton and East Collin (Figure 1) and includes the 100 block fronting East Collin and the 100 block fronting North Commerce Street. The property is improved with an eight-story glazed limestone, brick, and concrete commercial building. The building was constructed in 1926 as a State National Bank. A three-story brick addition (basement and two floors) was added to the north side of the original structure at a later date. The property includes the entire 100 block of North Commerce Street, which is currently a concrete parking lot.

3.5 Current Uses of Adjoining Properties

The property is located at 101 North Beaton Street in Corsicana, Texas. The property is bounded by:

- A commercial building currently housing a cosmetic business on the north side fronting North Beaton Street, followed by East 5th Avenue and commercial businesses;
- A concrete parking lot followed by North Commerce Street to the east;
- East Collin Street and followed by commercial buildings including a restaurant and bar to the south; and
- North Beaton Street followed by commercial buildings including a bookstore to the west.

4.0 USER PROVIDED INFORMATION

As defined in ASTM E 1527-05 Section 3.3.93, *User*, the USACE, EPA Region 6, and the City of Corsicana are the Users of this Phase I ESA. GEC conducted the assessment under contract to the USACE.

The User provided GEC with a copy of the City parcel map, property appraisal information, and a completed property information form. The realtor for the building provided copies of original building plans. Building plans are provided in Appendix C.

4.1 Title Records

As detailed in ASTM E 1527-05 Section 6.2, *Review Title and Judicial Records for Environmental Liens or Activity and Use Limitations (AULs)*, land title records should be reviewed in order to determine if environmental liens or activity and use limitations have been recorded against the property.

A review of the deed revealed no liens or activity use limitations on the property. Documentation is included in Appendix B.

4.2 Environmental Liens or Activity and Use Limitations

EDR searched Federal, state and local databases for sites with activity use limitations and/or engineering or institutional controls. None were located within required search distances of the property. The EDR Report is presented in Appendix D.

4.3 Specialized Knowledge

No specialized knowledge regarding the environmental history of the property was conveyed to GEC.

4.4 Commonly Known or Reasonably Ascertainable Information

No commonly known or reasonably ascertainable information regarding the environmental history of the property was conveyed to GEC.

4.5 Valuation Reduction for Environmental Issues

The realtor indicated that the purchase price of the property has not been reduced due to perceived environmental concerns.

4.6 Owner, Property Manager, and Occupant Information

The property is owned by Mr. Jon C. Bruegl of San Clemente, California. The first floor of the building is occupied by Chase Bank. Upper floors are currently vacant. Summaries of the interviews with the owner and occupants can be found in Section 7.0 of this document.

5.0 RECORDS REVIEW

In accordance with ASTM E 1527-05 Section 8.0, *Records Review*, GEC conducted a thorough search of Federal, state and local government environmental databases to obtain and review records and/or documents that would aid in the identification of known or potential REC sites on or near the project. ASTM E 1527-05 contains a list of records that should be reviewed and the minimum search distance to use.

5.1 Standard Environmental Record Sources

ASTM E 1527-05 Section 8.2.1, *Standard Environmental Record Sources: Federal and State*, requires a review of the following databases and proscribes various search radii:

Federal NPL ¹ Site List	1.0 mi
Federal <i>Delisted</i> NPL Site List	0.5 mi
Federal CERCLIS ² List	0.5 mi
Federal CERCLIS-NFRAP ³ Site List	0.5 mi
Federal RCRA ⁴ CORRACTS ⁵ List	1.0 mi
Federal RCRA Non-CORRACTS TSD ⁶ Site List	0.5 mi
Federal RCRA LQG/SQG ⁷	target/adjoining property
Federal IC/EC ⁸ Registries	target property
Federal ERNS ⁹ List	target property
State-Equivalent NPL List	1.0 mi
State-Equivalent CERCLIS List	0.5 mi
State Landfill and/or Solid Waste Disposal Site Lists	0.5 mi
State Leaking UST ¹⁰ Lists	0.5 mi
State-Registered UST Lists	target/adjoining property
State IC/EC Registries	target property
State VCP ¹¹	0.5 mi
State Brownfield Sites	0.5 mi

¹National Priority List

²Comprehensive Environmental Response, Compensation, and Liability Information System

³CERCLIS-No Further Remedial Action Planned

⁴Resource Conservation and Recovery Act

⁵Corrective Action Report

⁶Treatment, Storage, and Disposal Facility

⁷Large or Small Quantity Generator

⁸Institutional Control/Engineering Control

⁹Emergency Response Notification System

¹⁰Underground Storage Tank

¹¹Voluntary Cleanup Program

Table 1 provides a summary of potential sites listed in federal and state environmental databases identified by GEC and EDR during the environmental records review. The search distances used for the various databases comply with ASTM E 1527-05 Section 8.2.1, *Standard Environmental Record Sources*, except for the Federal RCRA LQG/SQG and State UST databases. For these databases, a conservative search distance of 0.25 mile was used. In addition to plottable sites, EDR generated a list of orphan sites. Orphan sites are those sites containing insufficient location information and can only be identified as being within the same zip code(s) as the project. The EDR Report is provided in Appendix D.

Table 1. Potential Sites Identified in Federal and State Databases

Database	Search Distance							
Name	Last Updated	Site	<1/8	1/8-1/4	1/4-1/2	>1/2-1	Orphan	Totals
Federal								
NPL	3-31-10	---	---	---	---	---	---	0
Proposed NPL	3-31-10	---	---	---	---	---	---	0
Delisted NPL	3-31-10	---	---	---	---	---	---	0
CERCLIS	1-29-10	---	---	---	---	NR	---	0
FED FACILITY	6-23-09	---	---	---	---	---	---	0
CERC-NFRAP	6-23-09	---	---	---	---	NR	1	1
CORRACTS	3-25-10	---	---	---	---	---	---	0
RCRA TSDF	2-17-10	---	---	---	---	NR	---	0
RCRA LQG/ SQG/CESQG	2-17-10	---	---	2	NR	NR	3	5
US ENG CONTROLS	12-20-09	---	---	---	---	NR	---	0
US INST CONTROLS	12-20-09	---	---	---	---	NR	---	0
ERNS	7-9-10	---	NR	NR	NR	NR	1	1
State / Tribal								
State Sites	3-1-10	---	---	---	---	---	---	0
SWF/LF ¹	5-7-10	---	---	3	---	NR	3	6
Leaking UST (LPST)	7-7-10	---	3	9	10	NR	5	27
Reg. UST	7-7-10	---	4	19	NR	NR	3	26
AST ³	7-7-10	---	---	---	NR	NR	3	3
AUL	6-4-10	---	---	---	---	NR	---	0
VCP	4-23-10	---	---	---	1	NR	---	1
Brownfields	6-24-10	---	---	---	---	NR	---	0
Records of Emergency Release Reports								
SPIILLS		---	---	---	---	---	1	1
Other								
RCRA-Non Gen	2-17-10	---	2	4	NR	NR	2	8
ROD	6-1-10	---	---	---	---	---	---	0
DRYCLEANERS		---	3	---	NR	NR	---	3
ENF		---	---	---	---	---	1	1
Totals		0	12	37	11	0	23	83
Notes: --- indicates no sites/items were found. LUST and UST values represent facilities, some of which contain multiple tanks. NR- not required ¹ Solid Waste Facility/Landfill Sites ² State listing of drycleaner facilities - treated as state-equivalent hazardous waste generator sites ³ Aboveground Storage Tank								

EDR research of the databases indicated 60 plottable sites located within the ASTM-recommended search radii and 23 orphan sites. Six plottable sites listed in Table 1 represent facilities with entries in multiple databases. When combined, the plottable sites represent 43 unique individual facilities.

Facility Name: Corsicana Service Center
Facility Location: 301 S 12th ST, Corsicana, TX 75110
Facility ID: TXD988025193
Database: RCRA-CESQG
Distance/Direction: 0.200 mi South-Southwest

Facility Name: Chucks Paint & Body
Facility Location: 416 N Beaton, Corsicana, TX 75110
Facility ID: TXR000003517
Database: RCRA-CESQG
Distance/Direction: 0.231 mi North-Northwest

Facility Name: City of Corsicana Landfill
Facility Location: 200 N 12th ST, Corsicana, TX 75110
Facility ID: S105243627
Database: SWF/LF
Distance/Direction: 0.173 mi West

Facility Name: Main Street Salvage
Facility Location: 222 N Main, Corsicana, TX 75110
Facility ID: UST: 0059762, LPST: 59762
Database: UST/LPST
Distance/Direction: 0.122 mi West-Northwest

Facility Name: BNK24 Interfirst Bank Corsicana
Facility Location: 301 W Collin, Corsicana, TX
Facility ID: UST: 0056030, LPST: 97348
Database: UST/LPST
Distance/Direction: 0.157 mi West-Southwest

Facility Name: Navarro County Sheriff's Office
Facility Location: 300 W 2nd Ave, Corsicana, TX 75110
Facility ID: UST: 0047074, LPST: 47074
Database: UST/LPST
Distance/Direction: 0.326 mi West-Northwest

Facility Name: Old Mobil Service Station
Facility Location: 601 W 7th Ave, Corsicana, TX 75110
Facility ID: UST: 0067218, LPST: 67218
Database: UST/LPST
Distance/Direction: 0.389 mi Southwest

Facility Name: Wallys Automotive
Facility Location: 420 N 15th Street
Facility ID: UST: 0059763, LPST: 59763
Database: UST/LPST
Distance/Direction: 0.438 mi West

Facility Name: Tex-Sun Glove Co
Facility Location: 100 E 7th, Corsicana, TX 75110
Facility ID: UST: 0063134, LPST: 63134
Database: UST/LPST
Distance/Direction: 0.061 mi South-Southeast

Facility Name: Moores Mobil Station
Facility Location: 219 S Beaton, Corsicana, TX 75110
Facility ID: UST: 0036038, LPST: 36038
Database: UST/LPST
Distance/Direction: 0.069 mi South-Southeast

Facility Name: Tiger Tote 102
Facility Location: 200 W 7th Ave, Corsicana, TX 75110
Facility ID: UST: 0044722, LPST: 44722
Database: UST/LPST
Distance/Direction: 0.150 mi South

Facility Name: The Pit Stop
Facility Location: 124 N 7th St, Corsicana, TX 75110
Facility ID: UST: 0064259, LPST: 64259
Database: UST/LPST
Distance/Direction: 0.221 mi NE

Facility Name: Dill & Nelson Oil Co
Facility Location: 222 S 7th St, Corsicana, TX 75110
Facility ID: UST: 0011633, LPST: 11633
Database: UST/LPST
Distance/Direction: 0.230 mi East-Northeast

Facility Name: ABC AG Center Inc
Facility Location: 103 N 7th, Corsicana, TX 75110
Facility ID: UST: 0057041, LPST: 57041
Database: UST/LPST
Distance/Direction: 0.236 mi East-Northeast

Facility Name: Graves Oil Co
Facility Location: 123 N 7th St, Corsicana, TX 75110
Facility ID: UST: 0029518, LPST: 29518
Database: UST/LPST
Distance/Direction: 0.236 mi Northeast

Facility Name: Goodman Service Station
Facility Location: 417 N Commerce St, Corsicana, TX 75110
Facility ID: UST: 005305, LPST: 5305
Database: UST/LPST
Distance/Direction: 0.237 mi North-Northwest

Facility Name: One Stop Citgo
Facility Location: 300 S 7th St
Facility ID: UST: 0029612, LPST: 29612
Database: UST/LPST
Distance/Direction: 0.247 mi East

Facility Name: Summerall Service Station
Facility Location: 221 S 7th St, Corsicana, TX 75110
Facility ID: UST: 0005315, LPST: 5315
Database: UST/LPST
Distance/Direction: 0.247 mi East-Northeast

Facility Name: Vacant Lot
Facility Location: 521 S 7th St, Corsicana, TX 75110
Facility ID: UST: 0010701, LPST: 10701
Database: UST/LPST
Distance/Direction: 0.330mi East-Southeast

Facility Name: Ralph Richards
Facility Location: 601 S 7th St, Corsicana, TX 75110
Facility ID: UST: 0041795, LPST: 41795
Database: UST/LPST
Distance/Direction: 0.362 mi East-Southeast

Facility Name: The Friendly Store
Facility Location: 628 S 7th, Corsicana, TX 75110
Facility ID: UST: 0056426, LPST: 56426
Database: UST/LPST
Distance/Direction: 0.363 mi East-Southeast

Facility Name: Stewart Motor
Facility Location: 600 N Beaton, Corsicana, TX 75110
Facility ID: LPST: N/A
Database: LPST
Distance/Direction: 0.236 mi East-Northeast

Facility Name: City of Corsicana
Facility Location: 620 S 12th St, Corsicana, TX 75110
Facility ID: UST: 0036805, LPST: 36805
Database: UST/LPST
Distance/Direction: 0.371 mi South

Facility Name: SPTCO Property
Facility Location: 11th & 12th St, Corsicana, TX 75110
Facility ID: UST: 0056165, LPST: 56165
Database: UST/LPST
Distance/Direction: 0.429 mi South

<u>Facility Name:</u>	One Stop Citgo
<u>Facility Location:</u>	300 S 7 th St
<u>Facility ID:</u>	UST: 0056165, LPST: 29612
<u>Database:</u>	UST/LPST
<u>Distance/Direction:</u>	0.247 mi East
<u>Facility Name:</u>	Abandoned Gas Station
<u>Facility Location:</u>	222 W 7 th Ave, Corsicana, TX 75110
<u>Facility ID:</u>	UST: 0075458
<u>Database:</u>	UST
<u>Distance/Direction:</u>	0.160 mi South
<u>Facility Name:</u>	T & Co Styling Salon
<u>Facility Location:</u>	300 N Main St, Corsicana, TX 75110
<u>Facility ID:</u>	UST: 0070786
<u>Database:</u>	UST
<u>Distance/Direction:</u>	0.168 mi West-Northwest
<u>Facility Name:</u>	Corsicana Service Center
<u>Facility Location:</u>	301 S 12 th St, Corsicana, TX 75110
<u>Facility ID:</u>	UST: 0039179
<u>Database:</u>	UST
<u>Distance/Direction:</u>	0.200 mi South-Southwest
<u>Facility Name:</u>	Avenue Fuel Dist
<u>Facility Location:</u>	301 W 7 th Ave, Corsicana, TX 75110
<u>Facility ID:</u>	UST: 0011630
<u>Database:</u>	UST
<u>Distance/Direction:</u>	0.202 mi South-Southwest
<u>Facility Name:</u>	Kilmarnock & Brown
<u>Facility Location:</u>	319 W 7 th Ave, Corsicana, TX 75110
<u>Facility ID:</u>	UST: 0068926
<u>Database:</u>	UST
<u>Distance/Direction:</u>	0.212 mi South-Southwest
<u>Facility Name:</u>	872 Co Tremont
<u>Facility Location:</u>	212 W 13 th St, Corsicana, TX 75110
<u>Facility ID:</u>	UST: 0044644
<u>Database:</u>	UST
<u>Distance/Direction:</u>	0.230 mi West-Southwest
<u>Facility Name:</u>	Southern Pacific Transport Co
<u>Facility Location:</u>	201 E 7 th Ave, Corsicana, TX 75110
<u>Facility ID:</u>	UST: 0065723
<u>Database:</u>	UST
<u>Distance/Direction:</u>	0.083 mi East-Southeast

<u>Facility Name:</u>	Tarrant 47
<u>Facility Location:</u>	409 E 7 th , Corsicana, TX 75110
<u>Facility ID:</u>	UST: 0039083
<u>Database:</u>	UST
<u>Distance/Direction:</u>	0.183 mi East
<u>Facility Name:</u>	Coca Cola Bottling Co of N TX
<u>Facility Location:</u>	409 S 9 th St, Corsicana, TX 75110
<u>Facility ID:</u>	UST: 0001187
<u>Database:</u>	UST
<u>Distance/Direction:</u>	0.213 mi East-Southeast
<u>Facility Name:</u>	Corsicana Paper & Rag Co
<u>Facility Location:</u>	518 E Collins, Corsicana, TX 75110
<u>Facility ID:</u>	UST: 0025435
<u>Database:</u>	UST
<u>Distance/Direction:</u>	0.242 mi East-Northeast
<u>Facility Name:</u>	Former Whiteselle Lumber Co
<u>Facility Location:</u>	301 E 3 rd Ave, Corsicana, TX 75110
<u>Facility ID:</u>	UST: 0073213
<u>Database:</u>	UST
<u>Distance/Direction:</u>	0.250 mi North
<u>Facility Name:</u>	National Incinerator
<u>Facility Location:</u>	305 North 7 th St, Corsicana, TX 75110
<u>Facility ID:</u>	VCP: 2004
<u>Database:</u>	VCP
<u>Distance/Direction:</u>	0.272 mi North-Northeast
<u>Facility Name:</u>	Central Linen Supply Inc
<u>Facility Location:</u>	215 N Main St, Corsicana, TX 75110
<u>Facility ID:</u>	TXD026184192
<u>Database:</u>	RCRA-NonGen
<u>Distance/Direction:</u>	0.116 mi West-Northwest
<u>Facility Name:</u>	Jim Howards Paint & Body Shop
<u>Facility Location:</u>	311 N Main St, Corsicana, TX 75110
<u>Facility ID:</u>	TXD093509420
<u>Database:</u>	RCRA-NonGen
<u>Distance/Direction:</u>	0.173 mi West-Southwest
<u>Facility Name:</u>	Custom Paint & Body Shop
<u>Facility Location:</u>	420 N Beaton St, Corsicana, TX 75110
<u>Facility ID:</u>	TXD981152051
<u>Database:</u>	RCRA-NonGen
<u>Distance/Direction:</u>	0.223 mi North-Northwest

Facility Name: Corsicana Ford Inc
Facility Location: 400 N Main St, Corsicana, TX 75110
Facility ID: TXD026184671
Database: RCRA-NonGen
Distance/Direction: 0.234 mi Northwest

Facility Name: FKI Logistex Inc
Facility Location: 211 N 7th St, Corsicana, TX 75110
Facility ID: TXR000019562
Database: RCRA-NonGen
Distance/Direction: 0.243 mi Northeast

Facility Name: Comet Cleaners
Facility Location: 201 W 6th Ave, Corsicana, TX 75110
Facility ID: N/A
Database: DRYCLEANERS
Distance/Direction: 0.105 mi South-Southwest

Each of these 43 sites is further discussed in Section 8.0 of this document. None of the orphan sites reported by EDR were found to be within ASTM-recommended search radii of the property.

5.2 Additional Environmental Record Sources

ASTM E 1527-05 Section 8.2.2, *Additional Environmental Record Sources*, states that one or more additional state or local sources may be checked to enhance and supplement the Federal and state sources identified in ASTM E 1527-05 Section 8.2.1.

Water well records obtained from federal and state agencies were reviewed. The well information and a well location map in relation to the property are included in Appendix D with the EDR Report. Forty-four water wells are identified within one mile of the property, and nine water wells are reported within ¼-mile of the property. All of the nine wells located within ¼-mile of the property are plugged and abandoned with the exception of MW-9. MW-9 is an eight-inch monitoring well drilled to 20 feet below ground surface at 114 W. Collin. A map showing the location of the wells in relation to the property is included in the EDR Report in Appendix D.

A review of Texas Railroad Commission's oil and gas well locations indicates that 108 oil and gas wells are located approximately within one mile of the property. The majority of oil and gas wells are located to the north and east of the property. A review of these 108 records indicates that: 60 wells are plugged, two were cancelled locations, 21 wells were dry holes, six are permitted locations, two are injection/disposal wells, and 17 are operational oil wells. A map showing the location of the wells in relation to the property is included in the EDR Report in Appendix D.

Five wells are located within a ¼-mile radius of the property. Of these five, one remains operational. It is located ¼-mile south of the property.

5.3 Physical Setting Sources

GEC researched historical quadrangles for structures, mines, quarries, clearings, wells, and land use in order to (1) ascertain historical development of the project area, and (2) identify indications of possible REC sites.

In accordance with ASTM E 1527-05, a current USGS 7.5-Minute Topographic Map was utilized as the primary physical setting source. Additional sources were utilized to ascertain the geologic, hydrogeologic, hydrologic, and topographic conditions of the project. The sources include the following:

- U.S. Department of Agriculture (USDA) Historical Aerial Photographs;
- Agricultural Stabilization and Conservation Service Historical Aerial Photographs;
- Aerial Measuring Service Historical Aerial Photographs;
- USGS Historical Aerial Photographs;
- Texas Department of Transportation Historical Aerial Photographs; and
- USGS 7.5-Minute Historic Topographic Quadrangle Maps.

5.4 Historical Use Information on Property and Adjoining Properties

5.4.1 Historical City Directories

Business directories including city, cross reference and telephone directories were reviewed, if available, at approximately five year intervals. Worley's City Directory was reviewed for 1941, and Polk's City Directories were reviewed for 1922, 1926, 1936, 1947, 1951, 1960, 1965, 1969, 1973, 1978, 1983, 1988, 1993, and 2001.

The property at 101 to 103 North Beaton Street was occupied by Louis Hashop, Gleming Cotton Company, and M H Thomas (cotton buyer) in 1922. From 1926 to 1983 the State National Bank occupied the building with various other commercial tenants located in the office spaces on the upper floors, including insurance and attorneys' offices. In 1988 the M Bank Corsicana occupied the building with additional retail and office space being occupied on the upper floors. In 1993 and 2001, the Polk Directory indicated that Bank One was the tenant of the first floor with additional business offices on the upper floors.

Adjacent directory listings for the area surrounding 101 and 103 North Beaton Street were obtained. The city directory listing indicated various commercial establishments were located in the vicinity of the property, including pharmacies, gift shops, and banks. B&G Auto Parts and repair shop occupied 104 North Beaton Street from 1983 to 2001.

According to the 1960 Polk City directory, White's Auto Store was located at 111 North Beaton Street, and relocated to 115 North Beaton Street in the 1969 directory. Badcock Brothers Auto Supply was located at 117 North Beaton Street from 1947 to 1960.

Documentation of the historical city directory search is included in Appendix E.

5.4.2 Sanborn® Fire Insurance Maps

Founded in 1867, the Sanborn Fire Insurance Company produced Sanborn® Fire Insurance Maps that document the historical property use of over 12,000 American towns and cities. Known for their tremendous details of size, material composition and minute construction elements of buildings as well as property boundaries and street widths, Sanborn® maps provide a valuable tool for completing an ESA in that land use of a property can be monitored in depth over a long period of time. Sanborn maps with coverage of the property in 1885, 1889, 1894, 1900, 1905, 1910, 1921, 1931, 1949, and 1965 were reviewed. Sanborn maps are included in Appendix F.

1885. The 1885 Sanborn map depicts the property as 512 and 513 Beaton Street. The property is improved with three, two-story brick buildings: one at 512, one at 513, and a third at 709 Collin Street. The corner property (513) is identified as printing and office, the property adjacent to the north (512) is a hardware, paint and tin shop, and the property to the east (709 Collin) is a grocery. There is an alley behind the buildings in the center of the block bounded by Beaton, Collin, Hardin, and White. The other businesses in the area are primarily commercial and include liquor stores, billiards rooms, drug stores, bakeries, and sleeping rooms. A marble monument storage area occupies a large portion of the block fronting Hardin Street across the alley from the property. The Houston and Texas Central Railroad is located one and one-half blocks to the east along Collin Street.

1889. The local streets have been renamed on the 1889 Sanborn map. Beaton and Collin streets have been divided into North and South Beaton and East and West Collin. The property lies at 101 and 103 North Beaton and is depicted as one, 2-story brick building with wood posts dividing lots 101 and 103. Hardin Street has been renamed 10th Street, and White Street has been renamed 5th Avenue. The building on the property is identified as cotton samples. The former grocery at 709 Collin Street (now 100 East Collin Street) is vacant. The surrounding properties are primarily commercial and include groceries, jewelers, barbers, drug stores, and liquor stores. The alley and the marble storage remain, but the marble storage is reduced in size, and a bowling alley is located on the block. Machine shops and store houses are located one block to the east of the property near the railroad.

1894. The 1894 Sanborn map identifies the building as cotton samples. The 100 East Collin Street portion of the property is identified as an insurance office. The alley remains, and commercial businesses in the vicinity of the property are similar in size and type to those depicted on the 1889 map and include banks. A light tower has been installed at the southeast corner of Beaton and Collin streets.

1900. The 1900 Sanborn map indicates that 103 North Beaton Street was a tin shop that shares a partition wall with 101 North Beaton Street which has a hardware store and cotton sample room. The address 101 North Beaton Street had an office in the back of the building that opens up to the alley. The light tower on the southeast corner of Beaton and Collin streets has been removed. A triple fire hydrant has been placed on East Collins Street across from 101 Beaton Street, near the alley. A large grocery store was under construction at 200 East Collin Street. A Merchants Opera House was located at 111 to 117 ½ South Beaton Street.

1905. The 1905 Sanborn map is very similar to the 1900 Sanborn map. The tin shop at 103 North Beaton Street has incorporated a pawn broker and became Norton's Pawn Broker and Tin Shop. A triple fire hydrant has been placed on the northeast corner of Collin Street on the edge of the alley near 100 East Collin Street. A former grain/grist mill located at 115 to 117 North 10th street is identified a meat packing company. The surrounding businesses include clothing, food, and drug stores, many with residential lodging on the second floor.

1910. On the 1910 Sanborn map, the former hardware store and cotton samples at the property has become a barber shop with a cotton office located on the second floor of 101 North Beaton Street. The tin and pawn shop occupies 103 North Beaton Street, and there are offices occupying 101 East Collin Street. A shooting gallery was located at 105 North Beaton Street. Corsicana Natatorium was located two blocks northwest of 101 North Beaton Street.

1921. The 1921 Sanborn map indicates that 101 North Beaton Street was a confectionary and 103 North Beaton Street was a barber. The cotton office is no longer on the second floor of 101 North Beaton and the floors above the confectionary and barber shops are vacant. The wall separating 101 and 103 is shown to be a permanent cement brick wall which replaced the framed partition. Many of the stores located in the vicinity of the property had residential areas on the second story of each building. There are four auto repair shops and two printing shops within a two and half block radius from 101 and 103 North Beaton Street. A large hardware store and grocer was located on the 200 block of East Collin Street.

1931. 101 and 103 North Beaton Street has been transformed into one building in the 1931 Sanborn map. The building is the State National Bank that was built with fire proof construction in 1926. Two Siamese fire department connections were located at 100 East Collin Street, and at 101 North Beaton Street. There were two dry cleaners located one and half blocks west of 101 North Beaton Street at 118 and 110 West Collin Street, and one dry cleaner located one block south at 117 South Beaton Street. There is gas station/auto repair shop located one block northwest at 121 to 125 West 5th Street, and an auto repair shop located one block northeast at 123 South Commerce Street (formerly known as South 10th Street).

1949. On the 1949 Sanborn map, the State National Bank was located at 101 to 103 North Beaton Street, with no changes from the 1931 Sanborn map. A photo shop is located at 117 North Beaton Street and two paint and wallpaper stores are located at 107 and 115 North Beaton Street. An auto repair shop with a junk yard is located a half a block south of 101 North Beaton between the alleyway and South Commerce. There are six dry cleaners within a two block radius, two of which have solvent cleaning tanks. One drycleaner is located at 117 West Fourth Street, and another is located half a block away of from the property at 114 West Collin. There are two gas station/auto repair shops, one located west of 101 North Beaton at 200 West Collin and one located northeast at 127 West 5th Street.

1965. The 1965 Sanborn map depicts the State National Bank at 101 and 103 North Beaton Street with no changes from the 1931 and 1949 Sanborn maps. The auto repair and junk yard located half a block south of 101 North Beaton Street between the alleyway and South Commerce was a parking lot in 1965. A parking lot has replaced a large grocery store/hardware store located a block east at 200 to 108 East Collin, and another has replaced several former stores between 108 to 116 North Commerce Street, across the alleyway from the bank. Two dry cleaners with solvent tanks were within a block of 101 North Beaton, one located half a

block west at 114 West Collin Street, and one a block south at 106 to 108 East Sixth Street. The two gas stations that appeared in the 1949 Sanborn map were in 1965 depicted as a vacant lot located at 127 West 5th Street; and as the First National Bank, which was constructed in 1956 located at 200 West Collin.

5.4.3 Historical Topographic Maps

GEC searched USGS historical topographic maps dating back to 1965 (Appendix G). The property is located in the City of Corsicana, Texas on the 7.5-minute series topographic maps. Maps from 1965 and 1978 were reviewed.

1965. The 1965 7.5-minute series map depicts the property located in the City of Corsicana. The area in which the property is located is a developed area and few features or buildings are depicted on the map. The Southern Pacific railroad tracks running parallel to North Beaton Avenue are depicted as well as Southwest railroad tracks running east-west three blocks south of the property. City Hall and a Post Office are shown one block west of the property.

1978. The 1978 7.5-series map is photo revised from the 1965 map. Features in the vicinity of the property remain unchanged.

5.4.4 Historical Aerial Photographs

GEC researched all historical aerial photographs of the subject property in EDR's collection. Historical aerial photographs for the years 1940, 1953, 1964, 1976, 1981, 1995, 2004, 2005, and 2006 were obtained from EDR and analyzed for information about the site history of the property. The historic aerial photographs obtained from EDR are included in Appendix H. Findings are summarized below.

1940. The 1940 aerial photograph depicts the property in an urban, commercial area of Corsicana. North Beaton Street is visible in the photograph. The property appears to be developed, and there are buildings fronting both the 100 block of East Collin and North Commerce. A railroad is located east of the property running north to south. There is undeveloped land south of the property on the east side of the railroad.

1953. The 1953 photograph is taken from a greater height than the 1940 photograph, and details are not visible. The property appears to be similar to that seen in the 1940 aerial photograph. The immediate surroundings are similar to that seen in the 1940 aerial. The undeveloped area south of the property appears to be further developed.

1964. The 1964 photograph depicts the property and immediate surrounding areas to include similar development as the 1953 photograph. A building in the center of the 100 block of North Commerce Street appears to have been removed. The less developed area south of the property shows no more development than seen in the 1953 photograph. The undeveloped areas north of the property appear more developed, with less open land and more residential areas.

1976. The 1976 photograph depicts the subject property in similar condition to that seen in 1964. All of the buildings fronting the 100 block of North Commerce Street appear to have

been removed, as well as the building that was adjacent east of the property. The addition to the eight-story building appears north of the original structure. The undeveloped area north of the property shows significant development as the open land appears to have been paved.

1981. The 1981 photograph depicts the property in similar condition as seen in the 1976 photograph. More development is seen north and northwest of the property. There is further residential development and parking lot pavement visible in this aerial photograph.

1995. The 1995 photograph shows no change to the property and surrounding areas from the 1981 aerial photograph.

2004. The 2004 photograph shows no change in the property and surrounding areas from the 1981 and 1995 aerial photographs.

2005. The 2005 photograph shows no change in the property and surrounding areas from the 2004 aerial photograph.

2006. The 2006 photograph shows no change in the property and surrounding areas from the 2004 and 2005 aerial photographs.

6.0 SITE RECONNAISSANCE

In accordance with ASTM E 1527-05 Section 9.0, *Site Reconnaissance*, field investigations were conducted in order to inspect the property and surrounding areas for structures, oil and gas exploration and production, land use, runoff patterns, and indications of environmental impacts. The investigation was conducted April 13, 2011. Photographs from the investigation are presented in Appendix I.

6.1 Methodology and Limiting Conditions

The property was investigated in order to identify potential REC sites, current and historical, that have, or may have in the past, adversely impacted environmental conditions at the property. ASTM E 1527-05 Section 9.0, *Site Reconnaissance*, addresses aspects of site field investigations. GEC, as described in this report, has investigated the property for potential RECs based on information gathered during historical research, the environmental database review, interviews with pertinent personnel, and field reconnaissance in accordance with ASTM E 1527-05 standards, as applicable and appropriate.

Observations made during GEC's reconnaissance of the property were limited to (1) portions of the site that were accessible to investigators, and (2) evidence that was visible to the investigators. Observations were based on evidence that was visible to inspectors while walking the property. No ground excavation or physical relocation of obstacles was conducted during inspections. Accordingly, no guarantee is made or intended that all property conditions were observed.

6.2 General Site Setting

ASTM E 1527-05 Section 9.4.1, *General Site Setting*, addresses current and past use of the property being assessed, adjoining properties, and surrounding area. The property is located within the historic downtown area of Corsicana. Land use in the vicinity of the property (Figure 2) is commercial. The elevation of the property is approximately 424 feet above MSL.

6.3 Exterior Observations

The property includes a concrete parking lot that covers the entire 100 block of North Commerce Street. There are four islands in the parking lot that are vegetated with grass, hedges and/or trees. A freestanding, drive-through automatic teller machine is located in the parking lot about mid-block.

6.3.1 Pits, Ponds, or Lagoons

No ponds or lagoons were observed on the exterior of property.

6.3.2 Stained Soil or Pavement

No areas of stained soil, gravel, or pavement indicating the discharge of petroleum product or hazardous substances were observed on the property other than typical parking lot stains.

6.3.3 Stressed Vegetation

No stressed vegetation was observed on the property. Trees and grass in the islands within the parking lot appeared to be healthy.

6.3.4 Solid Waste

No solid waste was observed on the property.

6.3.5 Wells

There were no wells of any type observed on the property.

6.3.6 Septic Systems

There were no septic systems observed on the property. The property is connected to city water and sewer systems.

6.3.7 Oil and Gas Drilling Activities

There was no evidence of current or past oil or gas drilling activities observed on the property.

6.3.8 Storage Tanks

No evidence of underground or aboveground storage tanks was observed on the property. No fill ports, vent lines, or remnants of a dispenser island were observed at the property.

6.3.9 Odors

No strong, pungent, or noxious odors were detected on the property during the site reconnaissance.

6.3.10 Pools of Liquid

No pools of liquid were observed on the property or adjacent properties.

6.3.11 Drums and Containers

No drums or containers were observed on the property.

6.3.12 Unidentified Substance Containers

No unidentified containers were observed on the exterior of the property.

6.3.13 Polychlorinated Biphenyls (PCBs)

Three pole-mounted electrical transformers were observed at the property. One is mounted on a pole in the center of the parking lot, along the former alley, and two are mounted on a pole along East 5th Avenue in the center of the block. Electrical transformers may contain oil with PCBs as an additive. It is not known whether these transformers contain PCBs. The transformers showed signs of corrosion, but no evidence of discharge of PCBs to the surrounding environment was observed.

6.4 Interior Observations

The property is improved with an eight-story glazed limestone, brick, and concrete commercial building. The building was constructed in 1926 as a State National Bank. A three-story brick addition (basement and two floors) was added to the north side of the original structure. The date of the addition is unknown, but the building appears to be typical of 1960s or 1970s construction, and it first appears on aerial photographs in 1976.

Exterior walls and ceilings were concrete-rebar with a painted plaster coating in the eight-story building. Exterior walls in the addition were brick. Interior walls were primarily particle board partitioning, with some drywall in the addition. Floors were concrete with carpet in the eight-story building; flooring in the addition included laminate and ceramic tiles, brick, parquet, and carpet. Bathrooms were primarily ceramic tile. Vinyl baseboards were observed throughout the building and addition. Most areas had one or two drop ceilings with ceiling tiles. Kitchen areas had laminate countertops. Doors, stairs, and windows were wooden; windows had visible glaze.

The roof access area contained elevator equipment, associated electrical panels, and a large cistern tank. The elevators were operational at the time of the site visit, and the cistern was reportedly empty. The roof was covered with painted asphalt shingles. A metal shed on the roof contained air conditioning equipment and piping, some of which was insulated. A cell phone tower and associated wiring was located on the roof.

The basement area was partially finished and in use by Chase Bank at the time of the site visit. Two bank vaults were located in the basement. The unfinished area contained numerous boilers, tanks, and piping. Labeled jugs of boiler chemicals were stored in the basement. Building plans indicate that there was once a transformer vault located in the basement. No transformers were observed.

6.4.1 Heating/Cooling

Boilers were observed in the basement and radiators were observed in the stairwells on each floor. Central air conditioning equipment was located on the roof. At the time of the site visit, only the portions of the building occupied by Chase Bank were using the heating and cooling systems. Piping was observed within the ceilings (most floors had two false ceilings), within a utility closet located in or near to the bathroom on each floor, in the basement, and on the roof. About 50 percent of the piping was insulated. Insulation was observed primarily on the upper floors and in the basement. All boilers and tanks in the basement were completely wrapped in insulation.

6.4.2 Stains or Corrosion

No unexplained stains or corrosion were observed. Minor water staining and associated discoloration were observed in various areas of the building, but no active water leaks were noted. *De minimus* staining associated with the elevator winches was noted immediately adjacent to the winched on the roof. The winch appears to be leaking fluid, possibly hydraulic fluid, onto an elevated platform within the enclosed portion of the roof. Routine maintenance should alleviate the problem.

6.4.3 Drains or Sumps

A depressed area and associated manhole cover were noted in the northeast corner of the basement. Blueprints of the building noted this area an "oil tank below." Plans also indicate a five-foot diameter "ejector pit" located in the vicinity of where the boilers were observed. Ejector pits are typically used to store sewage, which is periodically pumped to the septic system. The ejector pit was not observed during the site visit. Blueprints also indicate a 24-inch grease trap located approximately in the center of the building. The grease trap was not observed during the site visit.

7.0 INTERVIEWS

Mr. Jon Bruegl, the property owner, spoke with GEC on April 19, 2011. Mr. Bruegl indicated that he has owned the property for approximately five years. He indicated that the building has housed a bank and various commercial offices since it was constructed. He believed that doctors' offices had been located in the building, but he didn't think there was x-ray equipment

housed there. Mr. Bruegl was not sure when the building addition was constructed, but he thought it may have been in the 1970s. He stated that an asbestos inspection had been conducted on the addition, and that he believed only floor mastics contained asbestos. He was unsure of the date of the inspection. Mr. Bruegl did not believe any oil and gas activities have occurred on or in the immediate vicinity of the property, and he stated that he hasn't seen any caps or ports in the parking lot. He stated that the surrounding properties are primarily commercial. Mr. Bruegl was not aware of an oil tank in the basement; however, he was familiar with the depressed area and manhole cover. He indicated that the area noted as "transformer vault" on the building plans was used as storage when he purchased the building, and that he found bank records in that area dating back to the 1950s. He was not aware that electrical equipment had ever been housed at that location, but he indicated that portion of the basement extends under the sidewalk and is accessible via a cover in the sidewalk. Mr. Bruegl indicated that the ejector pit is operational. He repaired the float mechanism since he has owned the property. He stated that there are two sump pumps in the elevator wells that were installed during the time the ejector pit pump was not operational. All internal building drainage, as well as some external drainage, is directed to the ejector pit. When it becomes full, the float triggers a pump, which pumps out the water to the municipal sewer, which is at a higher elevation than the ejector pit. Mr. Bruegl was not aware of any major spills or other environmental incidents in the area that would have adversely affected environmental conditions at the property.

GEC spoke with Ms. Patti Taylor of Property Tech, the realtor representing the 101 North Beaton Street Property, on April 13, 2011. Ms. Taylor has lived in Corsicana for 30 years. She indicated that the property was built in 1926 as the State National Bank. An addition to the building was completed at a later date. She stated that a bank has always been a tenant in the building, and currently Chase Bank occupies the first floor, the mezzanine, and a portion of the basement. In the past, upper floors have been occupied by various professional tenants, including doctors, lawyers, and accountants. Ms. Taylor was unaware of any environmental concerns associated with the building or with any of the practices of former tenants. She informed GEC that the roof had been replaced within the last three years, and there is a cell phone tower located on the roof. She also indicated that the cistern is currently empty, and that the building is connected to municipal water and sewer systems. She indicated that the property is and has been surrounded primarily by commercial properties. She did not recall any major spills or other environmental incidents in the vicinity of the property during her time in Corsicana.

Ms. Sherry Andrus, Assistant Manager of Chase Bank, the current occupant, indicated that the bank stores no chemicals on site, and that there have been no spills at the property during the five years she has worked there. She was unaware of any environmental concerns within the bank or in the vicinity of the property. Ms. Andrus spoke with GEC on April 13, 2011.

8.0 FINDINGS

As defined in ASTM E 1527-05 Section 1.1.1, REC means:

The presence or likely presence of any hazardous substances or petroleum products on a property under conditions that indicate an existing release, a past release, or a material threat of a

release of any hazardous substances or petroleum products into structures on the property or into the ground, groundwater, or surface water of the property.

8.1 Potential REC Sites Outside Target Property Limits

GEC noted 43 potential REC sites outside the target property boundaries in the course of its review of Federal, state, and local environmental databases; historical research; interviews; and site investigations. Forty-three of these sites are noted in Section 5.1, and the location of each in relation to the property is depicted in the figures in the EDR Database Report contained in Appendix D. It is GEC's professional opinion that none of these potential off-site RECs discussed below are likely to have impacted the subject property.

Facility Name: Corsicana Service Center
Facility Location: 301 S 12th ST, Corsicana, TX 75110
Facility ID: TXD988025193
Database: RCRA-CESQG/UST
Distance/Direction: 0.200 mi South-Southwest

Corsicana Service Center currently located at 301 South 12th Street has two in use gasoline USTs and one UST was removed in 1993. All tanks are Fiberglass-reinforced plastic (FRP), with single walls and a double wall containment with factory built spill container and leak detection. There is no record of that the USTs have leaked. The Service Center is a CESQG for PCBs related to electrical transmission and maintenance. Due to its distance from the property, and because there are no records of leaks or violations, it is unlikely that operations at the Corsicana Service Center have impacted the property.

Facility Name: Chucks Paint & Body
Facility Location: 416 N Beaton, Corsicana, TX 75110
Facility ID: TXR000003517
Database: RCRA-CESQG
Distance/Direction: 0.231 mi North-Northwest

Chuck's Paint & Body is a RCRA-CESQG. The shop is not located adjacent to the property, and therefore it is unlikely to have adversely impacted environmental conditions at the property.

Facility Name: City of Corsicana Landfill
Facility Location: 200 N 12th St, Corsicana, TX 75110
Facility ID: S105243627
Database: SWF/LF
Distance/Direction: 0.173 mi West

200 North 12th Street is the location of Corsicana Government Complex which appears to have been built in the 1960s. The physical location of the City of Corsicana Landfill is 0.66 miles southeast of US 45 and State Highway 31 intersection, which is nearly a mile southeast of the property. Therefore, it is unlikely to have impacted the property.

Facility Name: Main Street Salvage
Facility Location: 222 N Main, Corsicana, TX 75110
Facility ID: UST: 0059762, LPST: 59762
Database: UST/LPST
Distance/Direction: 0.122 mi West-Northwest

Records indicate that two USTs were removed from Main Street Salvage in 1991. TCEQ issued final concurrence, and the case is classified as closed. Because TCEQ was satisfied with the UST closure, it is unlikely that the USTs at Main Street Salvage have adversely impacted the property.

Facility Name: BNK24 Interfirst Bank Corsicana
Facility Location: 301 W Collin, Corsicana, TX
Facility ID: UST: 0056030, LPST: 97348
Database: UST/LPST
Distance/Direction: 0.157 mi West-Southwest

Records indicate that four USTs were removed from BNK24 Interfirst Bank Corsicana in 1991. TCEQ issued final concurrence, and the case is classified as closed. Because TCEQ was satisfied with the UST closure, it is unlikely that the USTs at BNK24 Interfirst Bank Corsicana have adversely impacted the property.

Facility Name: Navarro County Sheriff's Office
Facility Location: 300 W 2nd Ave, Corsicana, TX 75110
Facility ID: UST: 0047074, LPST: 47074
Database: UST/LPST
Distance/Direction: 0.326 mi West-Northwest

Navarro County Sheriff's Office located at 300 West 2nd Avenue had two USTs installed in 1989 and removed from the ground in 1997. One FRP tank was a 6,000 gallon gasoline tank and the other a 500 gallon steel diesel tank. TCEQ records indicate that a groundwater at this site was affected; however, final concurrence is pending waiting on documentation of well plugging, indicating that remediation has been satisfactorily completed.

Facility Name: Old Mobil Service Station
Facility Location: 601 W 7th Ave, Corsicana, TX 75110
Facility ID: UST: 0067218, LPST: 67218
Database: UST/LPST
Distance/Direction: 0.389 mi Southwest

Old Mobile Service Station located at 601 West 7th Avenue had three steel USTs that were removed in 1987. Two of the tanks were used to store gasoline and the third to store used oil. TCEQ records indicate that a groundwater at this site was affected; however, TCEQ closed the case and issued final concurrence, indicating that remediation has been satisfactorily completed.

Facility Name: Wallys Automotive
Facility Location: 420 N 15th Street
Facility ID: UST: 0059763, LPST: 59763
Database: UST/LPST
Distance/Direction: 0.438 mi West

Wally's Automotive located at 420 North 15th Street had four steel USTs that were removed from ground in 1992. TCEQ records indicate that a groundwater at this site was affected; however, TCEQ closed the case and issued final concurrence, indicating that remediation has been satisfactorily completed.

Facility Name: Tex-Sun Glove Co
Facility Location: 100 E 7th, Corsicana, TX 75110
Facility ID: UST: 0063134, LPST: 63134
Database: UST/LPST
Distance/Direction: 0.061 mi South-Southeast

Records indicate that one UST was removed from Tex-Sun Glove Co. in 1992. TCEQ issued final concurrence, and the case is classified as closed. Because TCEQ was satisfied with the UST closure, it is unlikely that the UST at Tex-Sun Glove Co. has adversely impacted the property.

Facility Name: Moores Mobil Station
Facility Location: 219 S Beaton, Corsicana, TX 75110
Facility ID: UST: 0036038, LPST: 36038
Database: UST/LPST
Distance/Direction: 0.069 mi South-Southeast

Records indicate that four USTs were removed from Moore's Mobil Station in 1999. TCEQ issued final concurrence, and the case is classified as closed. Because TCEQ was satisfied with the UST closure, it is unlikely that the USTs at Moore's Mobil Station have adversely impacted the property.

Facility Name: Tiger Tote 102
Facility Location: 200 W 7th Ave, Corsicana, TX 75110
Facility ID: UST: 0044722, LPST: 44722
Database: UST/LPST
Distance/Direction: 0.150 mi South

Tiger Tote 102 located at 200 West 7th Avenue has four USTs, three gasoline tanks and one diesel tank. All tanks are composite tanks made of steel and FRP laminate, and were installed in 1982 and are all still currently in use. Each tank has factory built spill container, an automatic line leak detector and annual tightness test are preformed. The facility appears on TCEQ's LPST listing; however, final concurrence was issued by TCEQ and the case was closed, indicating that remediation has been satisfactorily completed.

Facility Name: The Pit Stop
Facility Location: 124 N 7th St, Corsicana, TX 75110

Facility ID: UST: 0064259, LPST: 64259
Database: UST/LPST
Distance/Direction: 0.221 mi NE

Records indicate that three USTs were removed from The Pit Stop in 1998. TCEQ issued final concurrence, and the case is classified as closed. Because TCEQ was satisfied with the UST closure, it is unlikely that the USTs at The Pit Stop have adversely impacted the property.

Facility Name: Dill & Nelson Oil Co
Facility Location: 222 S 7th St, Corsicana, TX 75110
Facility ID: UST: 0011633, LPST: 11633
Database: UST/LPST
Distance/Direction: 0.230 mi East-Northeast

Dill & Nelson Oil Company listed in TCEQ as "Abandoned Gas Station," has one UST that was installed in 1987 and was permanently filled in place in 1999. TCEQ was satisfied with the UST closure and issued a final concurrence and the case was closed.

Facility Name: ABC AG Center Inc
Facility Location: 103 N 7th, Corsicana, TX 75110
Facility ID: UST: 0057041, LPST: 57041
Database: UST/LPST
Distance/Direction: 0.236 mi East-Northeast

Records indicate that one UST was removed from ABC AG Center, Inc. in 1991. TCEQ issued final concurrence, and the case is classified as closed. Because TCEQ was satisfied with the UST closure, it is unlikely that the UST at ABC AG Center, Inc. has adversely impacted the property.

Facility Name: Graves Oil Co
Facility Location: 123 N 7th St, Corsicana, TX 75110
Facility ID: UST: 0029518, LPST: 29518
Database: UST/LPST
Distance/Direction: 0.236 mi Northeast

Records indicate that 10 USTs were removed from Graves Oil Co. in 1992, and one UST was removed in 1998. TCEQ issued final concurrence, and the case is classified as closed. Because TCEQ was satisfied with the UST closure, it is unlikely that the USTs at Graves Oil Co. have adversely impacted the property.

Facility Name: Goodman Service Station
Facility Location: 417 N Commerce St, Corsicana, TX 75110
Facility ID: UST: 005305, LPST: 5305
Database: UST/LPST
Distance/Direction: 0.237 mi North-Northwest

Records indicate that one UST was removed from Goodman Service Station in 1998. TCEQ issued final concurrence, and the case is classified as closed. Because TCEQ was satisfied with the UST closure, it is unlikely that the UST at Goodman Service Station has adversely impacted the property.

Facility Name: One Stop Citgo
Facility Location: 300 S 7th St
Facility ID: UST: 0029612, LPST: 29612
Database: UST/LPST
Distance/Direction: 0.247 mi East

One Stop Citgo located at 300 South 7th Street has three gasoline USTs that were installed in 1977. All three tanks are constructed out of FRP and have an automatic line leak detectors and monthly pressure tightness testing. TCEQ records indicate that groundwater at this site was affected. TCEQ closed the case and issued a final concurrence, indicating that remediation has been satisfactorily completed.

Facility Name: Summerall Service Station
Facility Location: 221 S 7th St, Corsicana, TX 75110
Facility ID: UST: 0005315, LPST: 5315
Database: UST/LPST
Distance/Direction: 0.247 mi East-Northeast

Records indicate that 5 USTs were removed from Summerall Service Station in 1991, and one UST was filled in place in 1983. TCEQ issued final concurrence, and the case is classified as closed. Because TCEQ was satisfied with the UST closure, it is unlikely that the USTs at Summerall Service Station have adversely impacted the property.

Facility Name: Vacant Lot
Facility Location: 521 S 7th St, Corsicana, TX 75110
Facility ID: UST: 0010701, LPST: 10701
Database: UST/LPST
Distance/Direction: 0.330mi East-Southeast

The vacant lot on 521 South 7th Street had one gasoline UST that was installed in 1981 and was removed from ground in 1991. TCEQ records indicate that a groundwater at this site was affected. TCEQ issued a final concurrence and the case is closed, indicating that remediation has been satisfactorily completed.

Facility Name: Ralph Richards
Facility Location: 601 S 7th St, Corsicana, TX 75110
Facility ID: UST: 0041795, LPST: 41795
Database: UST/LPST
Distance/Direction: 0.362 mi East-Southeast

Records indicate that five USTs were removed from Ralph Richards in 1990, and one UST was filled in place in 1968. TCEQ issued final concurrence, and the case is

classified as closed. Because TCEQ was satisfied with the UST closure, it is unlikely that the USTs at Ralph Richards have adversely impacted the property.

Facility Name: The Friendly Store
Facility Location: 628 S 7th, Corsicana, TX 75110
Facility ID: UST: 0056426, LPST: 56426
Database: UST/LPST
Distance/Direction: 0.363 mi East-Southeast

The Friendly Store located at 628 South 7th had three USTs that were installed in 1987. All three steel tanks were removed in 1996. TCEQ records indicate that a groundwater at this site was affected. TCEQ issued final concurrence and closed the case, indicating that remediation has been satisfactorily completed.

Facility Name: Stewart Motor
Facility Location: 600 N Beaton, Corsicana, TX 75110
Facility ID: LPST: N/A
Database: LPST
Distance/Direction: 0.236 mi East-Northeast

Stewart Motor located at 600 North Beaton Street had two gasoline USTs that were installed in 1987 and removed in 2003. TCEQ records indicate that a groundwater at this site was affected; however, final concurrence is pending waiting on documentation well plugging, indicating that remediation has been satisfactorily completed.

Facility Name: City of Corsicana
Facility Location: 620 S 12th St, Corsicana, TX 75110
Facility ID: UST: 0036805, LPST: 36805
Database: UST/LPST
Distance/Direction: 0.371 mi South

Records indicate that 3 USTs were removed from the City of Corsicana in 1989 and 1990, and that three USTs were filled in place in 1979. Two USTs are currently in use, a 12,000 gallon gasoline tank and a 6,000 gallon diesel tank with no recorded violations. TCEQ issued final concurrence on the UST closures, and the case is classified as closed. Because TCEQ was satisfied with the UST closures, and because there are no violations noted for the operational USTs, it is GEC's professional opinion that the USTs at the City of Corsicana are unlikely to have adversely impacted the property.

Facility Name: SPTCO Property
Facility Location: 11th and 12th St, Corsicana, TX 75110
Facility ID: UST: 0056165, LPST: 56165
Database: UST/LPST
Distance/Direction: 0.429 mi South

Records indicate that one UST was removed from the SPTCO Property in 1990. TCEQ issued final concurrence, and the case is classified as closed. Because TCEQ was

satisfied with the UST closure, it is unlikely that the UST at the SPTCO Property has adversely impacted the property.

Facility Name: Abandoned Gas Station
Facility Location: 222 W 7th Ave, Corsicana, TX 75110
Facility ID: UST: 0075458
Database: UST
Distance/Direction: 0.160 mi South

Records indicate that one UST was filled in place at the Abandoned Gas Station in 1999. There is no indication in the records that the UST had leaked; therefore, it is unlikely that the UST at the Abandoned Gas Station has adversely impacted the property.

Facility Name: T & Co Styling Salon
Facility Location: 300 N Main St, Corsicana, TX 75110
Facility ID: UST: 0070786
Database: UST
Distance/Direction: 0.168 mi West-Northwest

Records indicate that two USTs were removed from T & Co. Styling Salon, and two USTs were filled in place in 1998. There is no indication in the records that the USTs had leaked; therefore, it is unlikely that the USTs at the T & Co. Styling Salon have adversely impacted the property.

Facility Name: Avenue Fuel Dist
Facility Location: 301 W 7th Ave, Corsicana, TX 75110
Facility ID: UST: 0011630
Database: UST
Distance/Direction: 0.202 mi South-Southwest

Records indicate that five USTs were removed from Avenue Fuel Dist. in 1990. There is no indication in the records that the USTs had leaked; therefore, it is unlikely that the USTs at Avenue Fuel Dist. have adversely impacted the property.

Facility Name: Kilmarnock & Brown
Facility Location: 319 W 7th Ave, Corsicana, TX 75110
Facility ID: UST: 0068926
Database: UST
Distance/Direction: 0.212 mi South-Southwest

Records indicate that two USTs were removed from Kilmarnock & Brown in 1996. There is no indication in the records that the USTs had leaked; therefore, it is unlikely that the USTs at Kilmarnock & Brown have adversely impacted the property.

Facility Name: 872 Co Tremont
Facility Location: 212 W 13th St, Corsicana, TX 75110
Facility ID: UST: 0044644
Database: UST

Distance/Direction: 0.230 mi West-Southwest

872 Company Treatment located at 212 north 13th Street has one diesel UST currently in use, constructed of FRP with a factory built in spill container and auto delivery shut-off valve. The UST was installed in 1987 and is used for emergency generators and is gauge test and inventory controlled monthly. There is no indication of spills or leaks that could have adversely impacted the property.

Facility Name: Southern Pacific Transport Co
Facility Location: 201 E 7th Ave, Corsicana, TX 75110
Facility ID: UST: 0065723
Database: UST
Distance/Direction: 0.083 mi East-Southeast

Records indicate that one UST was removed from Southern Pacific Transport Co. in 1999. There is no indication in the records that the UST had leaked; therefore, it is unlikely that the UST at Southern Pacific Transport Co. has adversely impacted the property.

Facility Name: Tarrant 47
Facility Location: 409 E 7th, Corsicana, TX 75110
Facility ID: UST: 0039083
Database: UST
Distance/Direction: 0.183 mi East

Tarrant 47 located at 409 East 7th has three gasoline USTs that are listed with TCEQ, as temporarily out of use as of December 1998. Each steel UST was installed in 1979. There is no record that the USTs have leaked. Because the elevation of Tarrant 47 is lower than the property, and because there is no record of leaking USTs, it is unlikely that the USTs at Tarrant 47 have adversely impacted the property.

Facility Name: Coca Cola Bottling Co of N TX
Facility Location: 409 S 9th St, Corsicana, TX 75110
Facility ID: UST: 0001187
Database: UST
Distance/Direction: 0.213 mi East-Southeast

Records indicate that one UST was filled in place at Coca Cola Bottling Co. of North Texas in 1996. There is no indication in the records that the UST had leaked; therefore, it is unlikely that the UST at Coca Cola Bottling Co. of North Texas has adversely impacted the property.

Facility Name: Corsicana Paper & Rag Co
Facility Location: 518 E Collins, Corsicana, TX 75110
Facility ID: UST: 0025435
Database: UST
Distance/Direction: 0.242 mi East-Northeast

Records indicate that one UST was removed from Corsicana Paper & Rag Co. in 2001. There is no indication in the records that the UST had leaked; therefore, it is unlikely that the UST at Corsicana Paper & Rag Co. has adversely impacted the property.

Facility Name: Former Whiteselle Lumber Co
Facility Location: 301 E 3rd Ave, Corsicana, TX 75110
Facility ID: UST: 0073213
Database: UST
Distance/Direction: 0.250 mi North

Records indicate that one UST was removed from the former Whiteselle Lumber Co. in 2000. There is no indication in the records that the UST had leaked; therefore, it is unlikely that the UST at the former Whiteselle Lumber Co. has adversely impacted the property.

Facility Name: National Incinerator
Facility Location: 305 North 7th St, Corsicana, TX 75110
Facility ID: VCP: 2004
Database: VCP
Distance/Direction: 0.272 mi North-Northeast

National Incinerator located at 305 North 7th Street has been enrolled in TCEQ's Voluntary Cleanup Program for metals in the soil. An Affected Property Assessment Report was completed in 2007, and a Remedy Standard A response action was completed in 2008, indicating contaminated soils were removed from the property. A signed affidavit was issued in January 2008, indicating that site cleanup has been completed.

Facility Name: Central Linen Supply Inc
Facility Location: 215 N Main St, Corsicana, TX 75110
Facility ID: TXD026184192
Database: RCRA-NonGen
Distance/Direction: 0.116 mi West-Northwest

Central Linen Supply Inc., a laundry facility located at 215 North Main Street, is registered as an industrial hazardous waste and a RCRA-non generator for using petroleum based solvents and for handling/producing 100 kg of hazardous waste per month. There are no records of violations; therefore, it is unlikely that Central Linen Supply has adversely affected the property.

Facility Name: Jim Howards Paint & Body Shop
Facility Location: 311 N Main St, Corsicana, TX 75110
Facility ID: TXD093509420
Database: RCRA-NonGen
Distance/Direction: 0.173 mi West-Southwest

Jim Howard's Paint & Body Shop is a RCRA-non generator. The shop is not located adjacent to the property, and therefore it is unlikely to have adversely impacted environmental conditions at the property.

Facility Name: Custom Paint & Body Shop
Facility Location: 420 N Beaton St, Corsicana, TX 75110
Facility ID: TXD981152051
Database: RCRA-NonGen
Distance/Direction: 0.223 mi North-Northwest

Custom Paint & Body Shop is a RCRA-non generator. The shop is not located adjacent to the property, and there are no violations in the records. Therefore it is unlikely to have adversely impacted environmental conditions at the property.

Facility Name: Corsicana Ford Inc
Facility Location: 400 N Main St, Corsicana, TX 75110
Facility ID: TXD026184671
Database: RCRA-NonGen
Distance/Direction: 0.234 mi Northwest

Corsicana Ford Inc. is a RCRA-non generator. The shop is not located adjacent to the property, and although there are violations in the records, it is unlikely to have adversely impacted environmental conditions at the property due to its distance.

Facility Name: FKI Logistex Inc
Facility Location: 211 N 7th St, Corsicana, TX 75110
Facility ID: TXR000019562
Database: RCRA-NonGen
Distance/Direction: 0.243 mi Northeast

FKI Logistex Inc. is a RCRA-non generator. The shop is not located adjacent to the property, and although there are violations in the records, it is unlikely to have adversely impacted environmental conditions at the property due to its distance.

Facility Name: Comet Cleaners
Facility Location: 201 W 6th Ave, Corsicana, TX 75110
Facility ID: N/A
Database: DRYCLEANERS
Distance/Direction: 0.105 mi South-Southwest

Comet Cleaners located at 201 West 6th Avenue has a solid waste registration for petroleum based solvents used in the dry cleaning process. No violations or spills have been recorded. Therefore, it is unlikely that Central Linen Supply has adversely affected the property.

8.2 REC at Target Property

GEC noted two potential RECs within the target property boundaries in the course of its review of Federal, state, and local environmental databases; historical research; interviews; and site investigations. Building plans indicate an oil tank was or is located in the northeast corner of the basement. GEC noted a depressed area and an associated manhole cover at the location.

Two capped pipes are located nearby. Neither the property owner nor the realtor was aware of an oil tank at the property.

GEC additionally noted, but did not observe, the presence of an ejector pit in the basement of the property. The property owner indicated that the ejector pit float, which triggers the pump, had malfunctioned, resulting in the release of stormwater to the basement. The owner indicated that no sewage had been released, that the float had been repaired and is currently in working order. No pools or odors were observed at the time of the site visit. Therefore, it is GEC's professional opinion that the malfunctioning ejector pit float is unlikely to have adversely affected environmental conditions at the property.

9.0 OPINION

Through the review of Federal, state, and local environmental databases, historical research, interviews, and site investigations, one potential REC was noted on the target property: the possibility of a buried oil tank on the property. No potential RECs were noted off-site within ASTM-recommended search radii.

9.1 Data Gaps

Data gaps are defined in ASTM E 1527-05 Section 3.2.20, *data gap*, as a lack of or inability to obtain information required by this practice despite *good faith* efforts by the *environmental professional* to gather such information. No significant data gaps were encountered.

10.0 CONCLUSIONS

GEC has performed this Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM E 1527-05 for the 0.495-acre property located at 101 North Beaton Street, Corsicana, Texas. Any exceptions to, or deletions from this practice are described in Section 2.4, Limitations and Exceptions, of this report. This assessment has revealed evidence of one potential recognized environmental condition that might have adversely impacted environmental conditions at the property.

11.0 DEVIATIONS

Based on the scope of the project, GEC believes an appropriate inquiry level was utilized for the assessment. GEC complied with the standards specified in ASTM E 1527-05, when reasonably ascertainable. As provided for in ASTM E 1527-05 Section 4.5.2, *Not Exhaustive*, GEC did not perform an exhaustive assessment of observably clean portions of the property. Additionally, and as described in sections 4.0 and 6.0 of the report, certain observation limitations were encountered as noted.

12.0 ADDITIONAL SERVICES

12.1 Asbestos-Containing Materials

A visual inspection of the interior portions of the building indicates the potential presence of asbestos containing materials (ACM). Suspect materials identified during the site visit include


acoustical material in the ceilings, thermal system insulation (TSI) on the heating and cooling system components and piping, flooring tiles/mastics, and baseboards.

12.2 Lead Based Paint

Due to the age of the building, painted surfaces have the potential to contain lead. Cracked and peeling paint was observed throughout the unused portions of the building.

13.0 SIGNATURE OF ENVIRONMENTAL PROFESSIONAL

I declare that, to the best of my professional knowledge and belief, I meet the definition of Environmental Professional as defined in §312.10 of 40 CFR 312. I have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property. I have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.

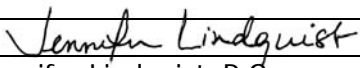Signature	
Name	Jennifer Lindquist, P.G.
Organization	G.E.C., Inc.
Date	May 5, 2011

14.0 QUALIFICATIONS OF ENVIRONMENTAL PROFESSIONAL

14.1 Jennifer Lindquist

Ms. Lindquist is an environmental scientist/geologist with over 18 years of experience in planning, coordination, and consulting services on federal and state regulatory compliance issues for numerous governmental and private clients. Environmental projects completed include:

Environmental Site Assessments – Numerous assessments for commercial, industrial and governmental clients nationwide to evaluate the presence of hazardous substances and petroleum products in accordance with ASTM Standard E 1527-00 and 1527-05, *Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process*, and ASTM Standard E 1903-97, *Standard Guide for Environmental Site Assessments: Phase II Environmental Site Assessment Process*.

Ms. Lindquist is a licensed professional geologist in Texas (license number 10842), a certified Environmental Specialist, Environmental Inspector, as well as an Asbestos Inspector (Accreditation No. 9I01539) and Lead Inspector (Accreditation No. Pb10I00467) in Louisiana. Ms. Lindquist is also trained in HAZWOPER in accordance with 29 CFR 1910.120. She completed the 40-hour training in 2003 and maintains training through the yearly eight-hour refresher course.

Appendix A

REFERENCES

REFERENCES

Texas State Government

Texas Commission on Environmental Quality

State Superfund Registry, updated semi-annually.

Permitted Solid Waste Facilities, updated annually.

Closed Landfill Inventory, updated variably.

Leaking Petroleum Storage Tank (LUST) Database, updated quarterly.

Petroleum Storage Tank (UST) Database, updated quarterly.

Petroleum Storage Tank (AST) Database, updated quarterly.

Deleted Superfund Registry Sites, updated quarterly.

Listing of Institutional and/or Engineering Controls (AUL) Database, updated variably.

Voluntary Cleanup Program (VCP) Database, updated quarterly.

Drycleaner Registration Database, updated variably.

Drycleaner Remediation Program Prioritization List, updated variably.

Brownfields, updated semi-annually.

Municipal Settings Designation Database, updated variably.

Texas Department of Transportation

Aerial Photograph. Corsicana, TX, 1976

Aerial Photograph. Corsicana, TX, 1981

Texas Water Development Board

Thompson, G.L. 1972. Ground-Water Resources of Navarro County, Texas. 41 pages.

United States Government

Environmental Protection Agency

Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database, updated quarterly.

Emergency Response Notification System (ERNS) Database, updated annually.

Engineering Controls Sites List (US Eng Controls) Database, updated quarterly.

Institutional Controls Sites List (US Inst Control) Database, updated quarterly.

National Priorities List (NPL) Database updated quarterly.

National Priorities List Deletions (Delisted NPL) Database, updated quarterly.

No Further Remedial Action Planned (NFRAP) Database, updated quarterly.

RCRA Generator Database, updated quarterly.

RCRA Treatment, Storage, and Disposal (TSD) Database, updated quarterly.

RCRA Corrective Action Sites (CORRACTS) Database, updated quarterly.

Department of Agriculture

Agricultural Stabilization and Conservation Service (ASCS). Aerial photograph, Corsicana, Texas, 1940.

<http://websoilsurvey.nrcs.usda.gov/app/WebSoilSurvey.aspx>

Department of Energy

Aerial Mapping Service (AMS). Aerial photograph, Corsicana, Texas, 1953.

Department of the Interior

U.S. Geological Survey (USGS). Aerial photograph, Corsicana, Texas, 1965.

USGS. Aerial photograph, Corsicana, Texas, 1995.

USGS. Aerial photograph, Corsicana, Texas, 2004.

USGS. 7.5-Minute Series Quadrangle, Corsicana, Texas, 1965.

USGS. 7.5-Minute Series Quadrangle, Corsicana, Texas, 1978.

Other

ASTM. 2005. *Standard Practice for Environmental Site Assessments: Phase I, Environmental Site Assessment Process*, ASTM Standard E 1527-05.

EDR. Aerial photograph, Corsicana, Texas, 2005.

EDR. Aerial photograph, Corsicana, Texas, 2005.

<http://www.ci.corsicana.tx.us/attractions>

Appendix B

TITLE HISTORY AND LIEN SEARCH



CHAIN OF OWNERSHIP REPORT COMBO Part I

CLIENT INFORMATION

Client:	Environmental Data Resources	Report Date:	04/19/2011
Client No.:	12010	Index Date:	04/05/2011
Address:	440 Wheelers Farms Rd Milford, CT 06460	Order ID:	13-201-1-10810
Contact:	Pat Merolla	Client Ref.:	3025321.9
Phone:	800-352-0050	PO Number:	N/A
Delivery:	PMerolla@edrnet.com		

CURRENT OWNER INFORMATION

Current Owner of Record:	John C. Bruegl, a single man
Current Site Address:	101 N BEATON ST CORSICANA, TX 75110-5216
County of Research:	NAVARRO

LEGAL DESCRIPTION

TRACT I: A 0.495 ACRE PARCEL OF LAND SITUATED IN THE CITY OF CORSICANA, LOCATED IN NAVARRO COUNTY, TEXAS, BEING LOTS 16 THRU 24, IN BLOCK 242, ACCORDING TO THE OFFICIAL MAP OF THE CITY OF CORSICANA, TEXAS.

TRACT II: A 0.604 ACRE PARCEL OF LAND SITUATED IN THE CITY OF CORSICANA, LOCATED IN NAVARRO COUNTY, TEXAS, BEING LOTS 1 THRU 10 AND THE EAST 50 FEET OF LOTS 11 AND 12, IN BLOCK 242, ACCORDING TO THE OFFICIAL MAP OF THE CITY OF CORSICANA, TEXAS.

NOTE: Ameristar does not represent that the above legal description, acreage, or square footage calculations are correct. We have taken this information directly from a document recorded at the courthouse.

PARCEL IDENTIFICATION NUMBER:	R000003000
--------------------------------------	-------------------

DISCLAIMER: This report contains information obtained from public records, and being that our company is not the primary provider of such, Ameristar cannot and will not, for the fee charged, be an insurer or guarantor of the accuracy or reliability of said information. Ameristar does not guarantee or warrant the accuracy, timeliness, completeness, currentness, merchantability or fitness for a particular purpose of services provided. Further, Ameristar's sole liability is limited to the cost of this report only. Ameristar is not liable to user for any loss or injury arising out of or caused, in whole or in part, by Ameristar's acts or omissions, whether negligent or otherwise, in procuring, compiling, collecting, interpreting, reporting, communicating, or delivering the services or information contained herein. THIS REPORT IS NOT AN ABSTRACT, OPINION OF TITLE, TITLE COMMITMENT NOR GUARANTEE, OR TITLE INSURANCE POLICY.

DEED / OWNERSHIP INFORMATION

*Search was performed from 04/05/1940 through 04/05/2011

DEED WITHOUT WARRANTY:

DATED: 04/24/1992
GRANTOR: FEDERAL Deposit Insurance Corporation
GRANTEE: Ban k One, Texas, N.A. formerly the Deposit Insurance
INSTRUMENT NO.: 1992-00002404

SPECIAL WARRANTY DEED:

DATED: 04/24/1992
GRANTOR: Bank One, Texas, N.A.
GRANTEE: Lawnwood Land, Co., a Texas Corporation
INSTRUMENT NO.: 1992-00002405

SPECIAL WARRANTY DEED:

DATED: 04/24/1992
GRANTOR: Lawnwood Land, Co., a Texas Corporation
GRANTEE: Tom S. Swanson
INSTRUMENT NO.: 1992-00002406

SPECIAL WARRANTY DEED:

DATED: 04/24/1992
GRANTOR: Tom S. Swanson
GRANTEE: Eagle Farms, Inc., a Texas Corporation
INSTRUMENT NO.: 1992-00002407

WARRANTY DEED WITH VENDOR'S LIEN:

DATED: 11/15/2006
GRANTOR: Eagle Farms, Inc., a Texas Corporation
GRANTEE: John C. Bruegl, a single man
INSTRUMENT NO.: 00012113

MTNC GF No. N205925

WARRANTY DEED WITH VENDOR'S LIEN

(Vendor's Lien Reserved and Assigned to Third Party Lender)

NOTICE OF CONFIDENTIALITY RIGHTS: IF YOU ARE A NATURAL PERSON, YOU MAY REMOVE OR STRIKE ANY OR ALL OF THE FOLLOWING INFORMATION FROM THIS INSTRUMENT BEFORE IT IS FILED FOR RECORD IN THE PUBLIC RECORDS: YOUR SOCIAL SECURITY NUMBER OR YOUR DRIVER'S LICENSE NUMBER.

Effective Date: November 15, 2006

Grantor: Eagle Farms, Inc., a Texas corporation

Grantor's Mailing Address:

1204 W. University Dr., Suite #400
Denton, Texas 76201

Grantee: Jon C. Bruegl, a single man

Grantee's Mailing Address:

115 West Avenue Lobos Marinos
San Clemente, California 92672

Lender: Silver Hill Financial, LLC

Lender's Mailing Address:

3773 Cherry Creek Drive North
Suite 410
Denver, Colorado 80209

Trustee: Karen G. Cowden, Esq.

Trustee's Mailing Address:

3773 Cherry Creek Drive North
Suite 410
Denver, Colorado 80209

Filed for Record in:
Havarrro County

On: Nov 21, 2006 at 11:50A

As a
Recording

Document Number: 00012113

Amount: 36.00

Receipt Number - 12230
By:
Sandra Whitener

STATE OF TEXAS

COUNTY OF HAVARRRO

I hereby certify that this instrument was
filed on the date and time stamped hereon by me and
was duly recorded in the volume and page of the
named records of: Havarrro County
as stamped hereon by me.

Nov 21, 2006

Sherry Dowd, COUNTY CLERK
Havarrro County

Consideration: TEN AND NO/100 DOLLARS (\$10.00) cash, and other good and valuable consideration to the undersigned in hand paid by the Grantee herein named, as part of an effectuation of a 1031 tax-free exchange made through M & L Exchange, Inc., a Texas corporation as qualified intermediary for the benefit of Grantor, the receipt and sufficiency of which is hereby expressly acknowledged, and the further consideration of the execution and delivery by the Grantee of that certain Promissory Note of even date herewith in the principal sum of SIX HUNDRED FORTY THOUSAND AND NO/100 DOLLARS (\$640,000.00) payable to the order of Silver Hill Financial, LLC, hereinafter called "First Mortgagee", as therein specified; said Note being secured by a first and superior Vendor's Lien retained herein in favor of said First Mortgagee, and also being secured by a primary and superior Deed of Trust of even date herewith from Grantee to Karen G. Cowden, Esq., Trustee; **AND** the further consideration of the execution and delivery by said Grantee of one certain Promissory Note in the original principal sum of EIGHTY THOUSAND AND NO/100 DOLLARS (\$80,000.00) payable to the order of Silver Hill Financial, LLC, as therein specified, hereinafter called "Second Mortgagee"; said Note being secured by a second and inferior Vendor's Lien retained herein in favor of said Second Mortgagee, and also being secured by a secondary and inferior Deed of Trust of even date herewith from Grantee to Karen G. Cowden, Esq., Trustee.

Property (Including any improvements):

All that certain lot, tract or parcel of land being more fully described on **Exhibit "A"** attached hereto and incorporated herein for all purposes.

Reservations from and Exceptions to Conveyance and Warranty:

This conveyance, however, is made and accepted subject to any and all validly existing easements, right-of-ways, and prescriptive rights, whether of record or not; all presently recorded restrictions, reservations, covenants, conditions, oil and gas leases, mineral severances, and other instruments, other than liens and conveyances, that affect the Property as now reflected by the records of the County Clerk of Navarro County, Texas; rights of adjoining owners in any walls and fences situated on a common boundary; any discrepancies, conflicts, or shortages in area or boundary lines; any encroachments or overlapping of improvements; taxes for the current year, the payment of which Grantee assumes; and subsequent assessments for the current and prior years due to change in land usage, ownership, or both, the payment of which Grantee assumes.

Grantor, for the Consideration and subject to the Reservations from and Exceptions to Conveyance and Warranty, **GRANTS, SELLS and CONVEYS** to Grantee the Property, together with all and singular the rights and appurtenances thereto in anywise belonging, to have and hold the Property to Grantee and Grantee's heirs, executors, administrators, successors, or assigns forever. Grantor hereby binds Grantor and Grantor's heirs, executors, administrators, successors and assigns to **WARRANT AND FOREVER DEFEND** all and singular the Property to Grantee and Grantee's heirs, executors, administrators, successors, and assigns, against every person whomsoever lawfully

claiming or to claim the same or any part thereof, except as to the Reservations from and Exceptions to Conveyance and Warranty.

BY ACCEPTING THIS DEED, GRANTEE ACKNOWLEDGES THAT, EXCEPT AS OTHERWISE EXPRESSLY PROVIDED IN THE PURCHASE AGREEMENT PURSUANT TO WHICH THIS DEED IS BEING EXECUTED AND THE WARRANTY OF TITLE CONTAINED IN THIS DEED, NEITHER GRANTOR, NOR ANYONE ACTING FOR OR ON BEHALF OF GRANTOR HAS MADE ANY REPRESENTATION, STATEMENT, WARRANTY, OR PROMISE TO GRANTEE CONCERNING THE CONDITION OF ANY OF THE PROPERTY OR CONCERNING THE PROJECTED INCOME OR EXPENSES FOR ANY OF THE PROPERTY AFTER THE DATE HEREOF. GRANTEE FURTHER ACKNOWLEDGES THAT IN ENTERING INTO SUCH PURCHASE AGREEMENT, GRANTEE DID NOT RELY ON ANY REPRESENTATION, STATEMENT, OR WARRANTY OF GRANTOR, WHICH WAS NOT EXPRESSLY SET FORTH IN SUCH PURCHASE AGREEMENT; AND EXCEPT AS OTHERWISE EXPRESSLY PROVIDED IN SUCH PURCHASE AGREEMENT, GRANTEE IS PURCHASING THE PROPERTY IN "AS IS" PHYSICAL CONDITION AND AN "AS IS" STATE OF REPAIR. GRANTEE HEREBY WAIVES ANY AND ALL IMPLIED WARRANTIES, INCLUDING, BUT NOT LIMITED TO ANY WARRANTIES OF HABITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, OR MARKETABILITY OF TITLE, WHICH MIGHT OTHERWISE BE IMPLIED WITH RESPECT TO ANY OF THE PROPERTY.

It is understood and agreed that the purchase price has been adjusted by prior negotiation to reflect that all of the Property is sold by Grantor and purchased by Grantee subject to the foregoing.

But it is expressly agreed that a first and superior Vendor's Lien and a second and inferior Vendor's Lien are retained against the Property, premises and improvements until the above described Promissory Notes secured by the same, and all interest therein, are fully paid according to the face, tenor, effect and reading thereof, when this Deed shall become absolute.

WHEREAS, both First Mortgagee and Second Mortgagee have, at the special instance and request of the Grantee herein, having advanced and paid in cash to the Grantor herein that portion of the purchase price of the Property as is evidenced by the herein above described Promissory Notes, said first and superior and second and inferior Vendor's Liens against the Property securing the payment of said Promissory Notes are hereby TRANSFERRED, ASSIGNED AND DELIVERED without recourse, to said First Mortgagee and Second Mortgagee, each to the extent of their respective interests, Grantor hereby conveying to said First Mortgagee and Second Mortgagee the said superior title to the Property, subrogating said Mortgagees to all the rights and remedies of Grantor in the Property by virtue of said lien.

When this Deed is executed by more than one person, or when the Grantee is more than one person, the instrument shall read as though pertinent verbs and pronouns were changed correspondingly, and when executed by or to a legal entity other than a natural person, the words "heirs, executors and administrators" or "heirs and assigns" shall be construed to mean "successors and assigns." Reference to any gender shall include either gender and, in the case of a legal entity other than a natural person, shall include the neuter gender, all as the case may be.

EXECUTED this 15th day of November, 2006.

Grantor:

Eagle Farms, Inc.,
a Texas corporation



By: John R. Porter, President

STATE OF TEXAS

§

COUNTY OF Denton

§

§

This instrument was acknowledged before me on this the 15th day of November, 2006, by John R. Porter as President of Eagle Farms, Inc., a Texas corporation, on behalf thereof and in the capacity herein stated.





Notary Public, State of Texas

(seal)

Grantee hereby accepts this Deed and consents to its form and substance.
Grantee acknowledges that the terms of this Deed conform with Grantee's intent and that they will control in the event of any conflict with the contract Grantee signed regarding the Property described in this Deed.

Grantee hereby agrees to the obligations imposed on Grantee by the terms of this Deed.

Grantee:

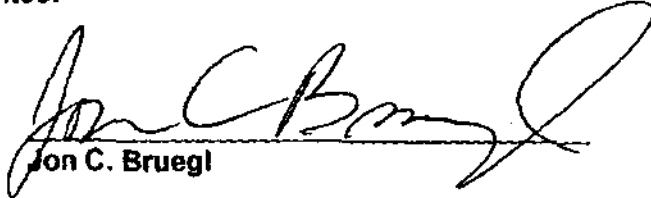

Jon C. Bruegl


STATE OF TEXAS

§
§
§

COUNTY OF NAVARRO

This instrument was acknowledged before me on this the 15 day of November, 2006, by Jon C. Bruegl.


Notary Public, State of TEXAS

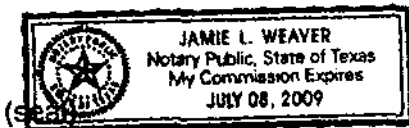

AFTER RECORDING RETURN TO:

Micro Title Navarro County, LLC
321 N. 12th Street
Corsicana, TX 75110
903.872.8485
903.872.6872 (FAX)
email: Lance@microtitle.com

PREPARED IN THE LAW OFFICE OF:

DAVID K. WAGGONER, M.B.A., J.D.
Attorney At Law
P.O. Box 3075
Corsicana, TX 75151
903.874.1000
email: WaggonerLawFirm@aol.com

"Exhibit A"

Tract I:

A 0.495-acre parcel of land situated in the City of Corsicana, located in Navarro County, Texas, being Lots 16 thru 24, in Block 242, according to the Official Map of the City of Corsicana, Texas.

Tract II:

A 0.604-acre parcel of land situated in the City of Corsicana, located in Navarro County, Texas, being Lots 1 thru 10 and the East 50 feet of Lots 11 and 12, in Block 242, according to the Official Map of the City of Corsicana, Texas.

101 N. Beaton
101 N BEATON ST
CORSICANA, TX 75110-5216

Inquiry Number: 3025321.7
04/19/2011

The EDR Environmental LienSearch™ Report



440 Wheelers Farms Road
Milford, CT 06461
800.352.0050
www.edrnet.com

EDR Environmental LienSearch™ Report

The EDR Environmental LienSearch Report provides results from a search of available current land title records for environmental cleanup liens and other activity and use limitations, such as engineering controls and institutional controls.

A network of professional, trained researchers, following established procedures, uses client supplied address information to:

- search for parcel information and/or legal description;
- search for ownership information;
- research official land title documents recorded at jurisdictional agencies such as recorders' offices, registries of deeds, county clerks' offices, etc.;
- access a copy of the deed;
- search for environmental encumbering instrument(s) associated with the deed;
- provide a copy of any environmental encumbrance(s) based upon a review of key words in the instrument(s) (title, parties involved, and description); and
- provide a copy of the deed or cite documents reviewed.

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This report was prepared for the use of Environmental Data Resources, Inc., exclusively. This report is neither a guarantee of title, a commitment to insure, or a policy of title insurance. **NO WARRANTY, EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT.** Environmental Data Resources, Inc. (EDR) specifically disclaim the making of any such warranties, including without limitation, merchantability or fitness for a particular use or purpose. The information contained in this report is retrieved as it is recorded from the various agencies that make it available. The total liability is limited to the fee paid for this report.

Copyright 2009 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EDR Environmental LienSearch™ Report

TARGET PROPERTY INFORMATION

ADDRESS

SITE NAME	101 N. Beaton
Address	101 N. Beaton St.
City ST ZIP	Corsicana, TX 75110-5216

RESEARCH SOURCE

Source 1:	Navarro County
-----------	----------------

PROPERTY INFORMATION

Deed 1:

Type of Deed:	Warranty Deed with Vendor's Lien
Title is vested in:	Jon C. Bruegl, a single man
Deed Dated:	11/15/2006
Deed Recorded:	11/21/2006
Instrument:	00012113

Legal Description:

TRACT I: A 0.495 ACRE PARCEL OF LAND SITUATED IN THE CITY OF CORSICANA, LOCATED IN NAVARRO COUNTY, TEXAS, AND BEING MORE FULLY DESCRIBED IN THE DEED RECORDS IN INSTRUMENT NO. 00012113 OF NAVARRO COUNTY STATE OF TEXAS.

Legal Current Owner:

Jon C. Bruegl, a single man

Property Identifiers:

R000003000

Comments:

EDR Environmental LienSearch™ Report

ENVIRONMENTAL LIEN

Environmental Lien: Found ☐ Not Found ☒

If found:

1st Party:

2nd Party:

Dated:

Recorded:

Book:

Page:

Instrument:

Docket:

Comments:

Miscellaneous:

OTHER ACTIVITY AND USE LIMITATIONS (AULs)

Other AUL's: Found ☐ Not Found ☒

If found:

1st Party:

2nd Party:

Dated:

Recorded:

Book:

Page:

Instrument:

Docket:

Comments:

Miscellaneous:

MTNC GF No. N205925

WARRANTY DEED WITH VENDOR'S LIEN

(Vendor's Lien Reserved and Assigned to Third Party Lender)

NOTICE OF CONFIDENTIALITY RIGHTS: IF YOU ARE A NATURAL PERSON, YOU MAY REMOVE OR STRIKE ANY OR ALL OF THE FOLLOWING INFORMATION FROM THIS INSTRUMENT BEFORE IT IS FILED FOR RECORD IN THE PUBLIC RECORDS: YOUR SOCIAL SECURITY NUMBER OR YOUR DRIVER'S LICENSE NUMBER.

Effective Date: November 15, 2006

Grantor: Eagle Farms, Inc., a Texas corporation

Grantor's Mailing Address:

1204 W. University Dr., Suite #400
Denton, Texas 76201

Grantee: Jon C. Bruegl, a single man

Grantee's Mailing Address:

115 West Avenue Lobos Marinos
San Clemente, California 92672

Lender: Silver Hill Financial, LLC

Lender's Mailing Address:

3773 Cherry Creek Drive North
Suite 410
Denver, Colorado 80209

Trustee: Karen G. Cowden, Esq.

Trustee's Mailing Address:

3773 Cherry Creek Drive North
Suite 410
Denver, Colorado 80209

Filed for Record in:
Navarro County

On: Nov 21, 2006 at 11:50A

As a
Recording

Document Number: 00012113

Amount: 36.00

Receipt Number - 12230
By:
Sandra Whitener

STATE OF TEXAS

COUNTY OF NAVARRO

I hereby certify that this instrument was
filed on the date and time stamped hereon by me and
was duly recorded in the volume and page of the
named records of: Navarro County
as stamped hereon by me.

Nov 21, 2006

Sherry Dowd, COUNTY CLERK
Navarro County

Consideration: TEN AND NO/100 DOLLARS (\$10.00) cash, and other good and valuable consideration to the undersigned in hand paid by the Grantee herein named, as part of an effectuation of a 1031 tax-free exchange made through M & L Exchange, Inc., a Texas corporation as qualified intermediary for the benefit of Grantor, the receipt and sufficiency of which is hereby expressly acknowledged, and the further consideration of the execution and delivery by the Grantee of that certain Promissory Note of even date herewith in the principal sum of SIX HUNDRED FORTY THOUSAND AND NO/100 DOLLARS (\$640,000.00) payable to the order of Silver Hill Financial, LLC, hereinafter called "First Mortgagee", as therein specified; said Note being secured by a first and superior Vendor's Lien retained herein in favor of said First Mortgagee, and also being secured by a primary and superior Deed of Trust of even date herewith from Grantee to Karen G. Cowden, Esq., Trustee; **AND** the further consideration of the execution and delivery by said Grantee of one certain Promissory Note in the original principal sum of EIGHTY THOUSAND AND NO/100 DOLLARS (\$80,000.00) payable to the order of Silver Hill Financial, LLC, as therein specified, hereinafter called "Second Mortgagee"; said Note being secured by a second and inferior Vendor's Lien retained herein in favor of said Second Mortgagee, and also being secured by a secondary and inferior Deed of Trust of even date herewith from Grantee to Karen G. Cowden, Esq., Trustee.

Property (including any improvements):

All that certain lot, tract or parcel of land being more fully described on Exhibit "A" attached hereto and incorporated herein for all purposes.

Reservations from and Exceptions to Conveyance and Warranty:

This conveyance, however, is made and accepted subject to any and all validly existing easements, right-of-ways, and prescriptive rights, whether of record or not; all presently recorded restrictions, reservations, covenants, conditions, oil and gas leases, mineral severances, and other instruments, other than liens and conveyances, that affect the Property as now reflected by the records of the County Clerk of Navarro County, Texas; rights of adjoining owners in any walls and fences situated on a common boundary; any discrepancies, conflicts, or shortages in area or boundary lines; any encroachments or overlapping of improvements; taxes for the current year, the payment of which Grantee assumes; and subsequent assessments for the current and prior years due to change in land usage, ownership, or both, the payment of which Grantee assumes.

Grantor, for the Consideration and subject to the Reservations from and Exceptions to Conveyance and Warranty, GRANTS, SELLS and CONVEYS to Grantee the Property, together with all and singular the rights and appurtenances thereto in anywise belonging, to have and hold the Property to Grantee and Grantee's heirs, executors, administrators, successors, or assigns forever. Grantor hereby binds Grantor and Grantor's heirs, executors, administrators, successors and assigns to WARRANT AND FOREVER DEFEND all and singular the Property to Grantee and Grantee's heirs, executors, administrators, successors, and assigns, against every person whomsoever lawfully

claiming or to claim the same or any part thereof, except as to the Reservations from and Exceptions to Conveyance and Warranty.

BY ACCEPTING THIS DEED, GRANTEE ACKNOWLEDGES THAT, EXCEPT AS OTHERWISE EXPRESSLY PROVIDED IN THE PURCHASE AGREEMENT PURSUANT TO WHICH THIS DEED IS BEING EXECUTED AND THE WARRANTY OF TITLE CONTAINED IN THIS DEED, NEITHER GRANTOR, NOR ANYONE ACTING FOR OR ON BEHALF OF GRANTOR HAS MADE ANY REPRESENTATION, STATEMENT, WARRANTY, OR PROMISE TO GRANTEE CONCERNING THE CONDITION OF ANY OF THE PROPERTY OR CONCERNING THE PROJECTED INCOME OR EXPENSES FOR ANY OF THE PROPERTY AFTER THE DATE HEREOF. GRANTEE FURTHER ACKNOWLEDGES THAT IN ENTERING INTO SUCH PURCHASE AGREEMENT, GRANTEE DID NOT RELY ON ANY REPRESENTATION, STATEMENT, OR WARRANTY OF GRANTOR, WHICH WAS NOT EXPRESSLY SET FORTH IN SUCH PURCHASE AGREEMENT; AND EXCEPT AS OTHERWISE EXPRESSLY PROVIDED IN SUCH PURCHASE AGREEMENT, GRANTEE IS PURCHASING THE PROPERTY IN "AS IS" PHYSICAL CONDITION AND AN "AS IS" STATE OF REPAIR. GRANTEE HEREBY WAIVES ANY AND ALL IMPLIED WARRANTIES, INCLUDING, BUT NOT LIMITED TO ANY WARRANTIES OF HABITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, OR MARKETABILITY OF TITLE, WHICH MIGHT OTHERWISE BE IMPLIED WITH RESPECT TO ANY OF THE PROPERTY.

It is understood and agreed that the purchase price has been adjusted by prior negotiation to reflect that all of the Property is sold by Grantor and purchased by Grantee subject to the foregoing.

But it is expressly agreed that a first and superior Vendor's Lien and a second and inferior Vendor's Lien are retained against the Property, premises and improvements until the above described Promissory Notes secured by the same, and all interest therein, are fully paid according to the face, tenor, effect and reading thereof, when this Deed shall become absolute.

WHEREAS, both First Mortgagee and Second Mortgagee have, at the special instance and request of the Grantee herein, having advanced and paid in cash to the Grantor herein that portion of the purchase price of the Property as is evidenced by the herein above described Promissory Notes, said first and superior and second and inferior Vendor's Liens against the Property securing the payment of said Promissory Notes are hereby TRANSFERRED, ASSIGNED AND DELIVERED without recourse, to said First Mortgagee and Second Mortgagee, each to the extent of their respective interests, Grantor hereby conveying to said First Mortgagee and Second Mortgagee the said superior title to the Property, subrogating said Mortgagees to all the rights and remedies of Grantor in the Property by virtue of said lien.

When this Deed is executed by more than one person, or when the Grantee is more than one person, the instrument shall read as though pertinent verbs and pronouns were changed correspondingly, and when executed by or to a legal entity other than a natural person, the words "heirs, executors and administrators" or "heirs and assigns" shall be construed to mean "successors and assigns." Reference to any gender shall include either gender and, in the case of a legal entity other than a natural person, shall include the neuter gender, all as the case may be.

EXECUTED this 15th day of November, 2006.

Grantor:

Eagle Farms, Inc.,
a Texas corporation



By: John R. Porter, President

STATE OF TEXAS

COUNTY OF Denton

§
§
§

This instrument was acknowledged before me on this the 15th day of November, 2006, by John R. Porter as President of Eagle Farms, Inc., a Texas corporation, on behalf thereof and in the capacity herein stated.





Notary Public, State of Texas

(seal)

Grantee hereby accepts this Deed and consents to its form and substance.
Grantee acknowledges that the terms of this Deed conform with Grantee's intent and that they will control in the event of any conflict with the contract Grantee signed regarding the Property described in this Deed.

Grantee hereby agrees to the obligations imposed on Grantee by the terms of this Deed.

Grantee:



Jon C. Bruegl


STATE OF TEXAS

§
§
§

COUNTY OF NAVARRO

This instrument was acknowledged before me on this the 15 day of November, 2006, by Jon C. Bruegl.

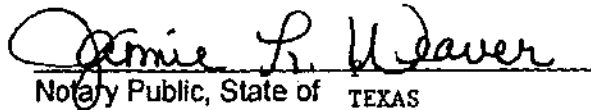
Notary Public, State of TEXAS

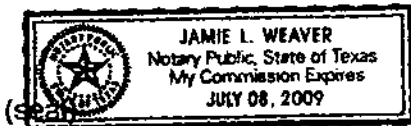

AFTER RECORDING RETURN TO:

Micro Title Navarro County, LLC
321 N. 12th Street
Corsicana, TX 75110
903.872.8485
903.872.6872 (FAX)
email: Lance@microtitle.com

PREPARED IN THE LAW OFFICE OF:

DAVID K. WAGGONER, M.B.A., J.D.
Attorney At Law
P.O. Box 3075
Corsicana, TX 75151
903.874.1000
email: WaggonerLawFirm@aol.com

"Exhibit A"

Tract I:

A 0.495-acre parcel of land situated in the City of Corsicana, located in Navarro County, Texas, being Lots 16 thru 24, in Block 242, according to the Official Map of the City of Corsicana, Texas.

Tract II:












A 0.604-acre parcel of land situated in the City of Corsicana, located in Navarro County, Texas, being Lots 1 thru 10 and the East 50 feet of Lots 11 and 12, in Block 242, according to the Official Map of the City of Corsicana, Texas.

Appendix C

BUILDING PLANS

FIRST FLOOR BEAM SCHEDULE

BEAM	CONCRETE	STEEL	STRAIGHT RODS	BENT RODS	A	B	C	D	E	F	G	H	STIRRUPS
NO.	TYPE	SIZE	NO.	SIZE	NO.	NO.	NO.	NO.	NO.	NO.	NO.	NO.	NO.
A	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
B	8" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
C	8" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
D	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
E	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
F	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
G	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
H	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
I	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
J	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
K	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
L	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
M	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
N	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
O	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
P	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
Q	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
R	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
S	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
T	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
U	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
V	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
W	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
X	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
Y	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none
Z	12" x 14"	2	10	10	6	1	1	1	1	1	1	1	none

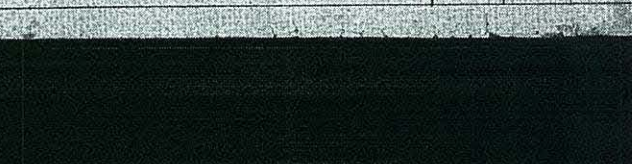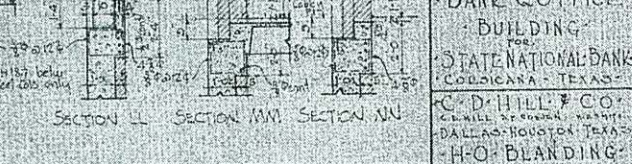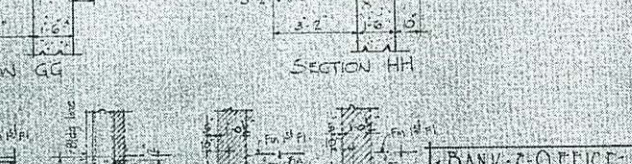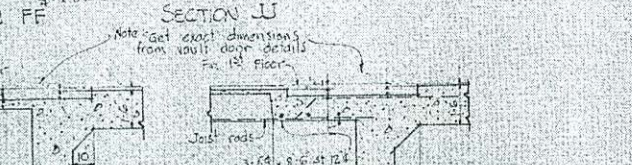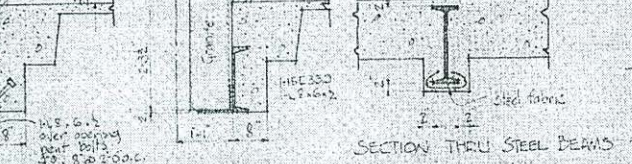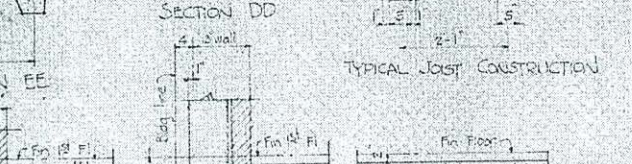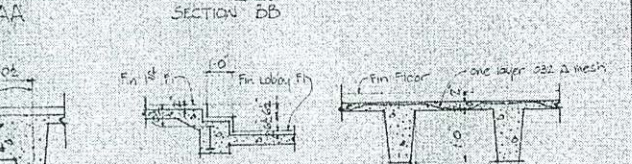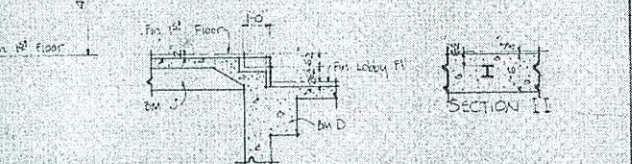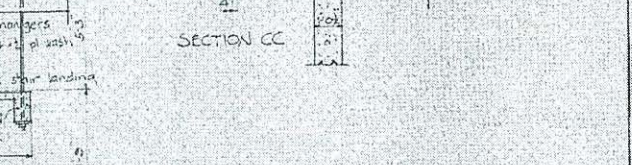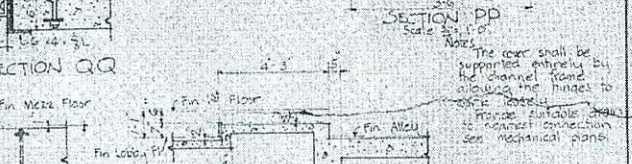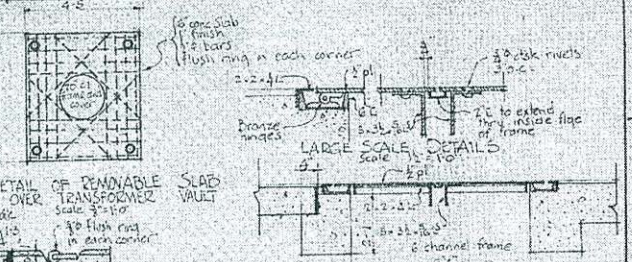

Appendix D

EDR ENVIRONMENTAL DATABASE SEARCH



101 N. Beaton


101 N. Beaton

Corsicana, TX 75110

Inquiry Number: 3025321.2s

March 28, 2011

The EDR Radius Map™ Report with GeoCheck®

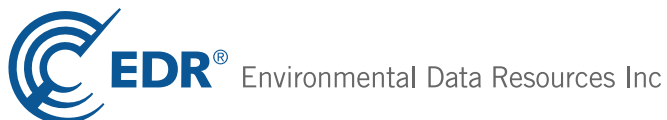

440 Wheelers Farms Road
Milford, CT 06461
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	7
Orphan Summary	292
Government Records Searched/Data Currency Tracking	GR-1
 <u>GEOCHECK ADDENDUM</u>	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map	A-10
Physical Setting Source Map Findings	A-12
Physical Setting Source Records Searched	A-98

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

101 N. BEATON
CORSICANA, TX 75110

COORDINATES

Latitude (North):	32.093600 - 32° 5' 37.0"
Longitude (West):	96.463600 - 96° 27' 49.0"
Universal Transverse Mercator:	Zone 14
UTM X (Meters):	739372.2
UTM Y (Meters):	3553438.8
Elevation:	424 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	32096-A4 CORSICANA, TX
Most Recent Revision:	1978

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	2005, 2006, 2008
Source:	USDA

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL..... National Priority List

EXECUTIVE SUMMARY

Proposed NPL..... Proposed National Priority List Sites
NPL LIENS..... Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL..... National Priority List Deletions

Federal CERCLIS list

CERCLIS..... Comprehensive Environmental Response, Compensation, and Liability Information System
FEDERAL FACILITY..... Federal Facility Site Information listing

Federal CERCLIS NFRAP site List

CERC-NFRAP..... CERCLIS No Further Remedial Action Planned

Federal RCRA CORRACTS facilities list

CORRACTS..... Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF..... RCRA - Treatment, Storage and Disposal

Federal RCRA generators list

RCRA-LQG..... RCRA - Large Quantity Generators
RCRA-SQG..... RCRA - Small Quantity Generators

Federal institutional controls / engineering controls registries

US ENG CONTROLS..... Engineering Controls Sites List
US INST CONTROL..... Sites with Institutional Controls

Federal ERNS list

ERNS..... Emergency Response Notification System

State- and tribal - equivalent NPL

SHWS..... State Superfund Registry

State and tribal landfill and/or solid waste disposal site lists

CLI..... Closed Landfill Inventory
WasteMgt..... Commercial Hazardous & Solid Waste Management Facilities

State and tribal leaking storage tank lists

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

State and tribal registered storage tank lists

AST..... Petroleum Storage Tank Database
INDIAN UST..... Underground Storage Tanks on Indian Land

EXECUTIVE SUMMARY

FEMA UST..... Underground Storage Tank Listing

State and tribal institutional control / engineering control registries

AUL..... Sites with Controls

State and tribal voluntary cleanup sites

INDIAN VCP..... Voluntary Cleanup Priority Listing

State and tribal Brownfields sites

BROWNFIELDS..... Brownfields Site Assessments

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS..... A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations

ODI..... Open Dump Inventory

INDIAN ODI..... Report on the Status of Open Dumps on Indian Lands

Local Lists of Hazardous waste / Contaminated Sites

US CDL..... Clandestine Drug Labs

DEL SHWS..... Deleted Superfund Registry Sites

PRIORITYCLEANERS..... Dry Cleaner Remediation Program Prioritization List

US HIST CDL..... National Clandestine Laboratory Register

Local Land Records

LIENS 2..... CERCLA Lien Information

LUCIS..... Land Use Control Information System

LIENS..... Environmental Liens Listing

HIST LIENS..... Environmental Liens Listing

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System

SPILLS..... Spills Database

Other Ascertainable Records

DOT OPS..... Incident and Accident Data

DOD..... Department of Defense Sites

FUDS..... Formerly Used Defense Sites

CONSENT..... Superfund (CERCLA) Consent Decrees

ROD..... Records Of Decision

UMTRA..... Uranium Mill Tailings Sites

MINES..... Mines Master Index File

EXECUTIVE SUMMARY

TRIS.....	Toxic Chemical Release Inventory System
TSCA.....	Toxic Substances Control Act
FTTS.....	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
HIST FTTS.....	FIFRA/TSCA Tracking System Administrative Case Listing
SSTS.....	Section 7 Tracking Systems
ICIS.....	Integrated Compliance Information System
PADS.....	PCB Activity Database System
MLTS.....	Material Licensing Tracking System
RADINFO.....	Radiation Information Database
FINDS.....	Facility Index System/Facility Registry System
RAATS.....	RCRA Administrative Action Tracking System
IOP.....	Innocent Owner/Operator Program
NPDES.....	NPDES Facility List
UIC.....	Underground Injection Wells Database Listing
ENF.....	Notice of Violations Listing
Ind. Haz Waste.....	Industrial & Hazardous Waste Database
ED AQUIF.....	Edwards Aquifer Permits
AIRS.....	Current Emission Inventory Data
MSD.....	Municipal Settings Designations Database
TIER 2.....	Tier 2 Chemical Inventory Reports
RWS.....	Radioactive Waste Sites
INDIAN RESERV.....	Indian Reservations
SCRD DRYCLEANERS.....	State Coalition for Remediation of Drycleaners Listing
PCB TRANSFORMER.....	PCB Transformer Registration Database
COAL ASH EPA.....	Coal Combustion Residues Surface Impoundments List
COAL ASH DOE.....	Sleam-Electric Plan Operation Data
GCC.....	Groundwater Contamination Cases
FINANCIAL ASSURANCE.....	Financial Assurance Information Listing

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property. Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal RCRA generators list

RCRA-CESQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or

EXECUTIVE SUMMARY

dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-CESQG list, as provided by EDR, and dated 02/17/2010 has revealed that there are 2 RCRA-CESQG sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
CORSICANA SERVICE CENTER	301 S 12TH STREET	SSW 1/8 - 1/4 (0.200 mi.)	F19	141
CHUCKS PAINT & BODY	416 N BEATON	NNW 1/8 - 1/4 (0.231 mi.)	I26	175

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: The Solid Waste Facilities/Landfill Sites records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. The data come from the Texas Commission on Environmental Quality's permitted Solid Waste Facilities list.

A review of the SWF/LF list, as provided by EDR, and dated 02/07/2011 has revealed that there are 3 SWF/LF sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
CITY OF CORSICANA LANDFILL	200 N 12TH ST	W 1/8 - 1/4 (0.173 mi.)	E13	70
CITY OF CORSICANA LANDFILL	200 N 12TH ST	W 1/8 - 1/4 (0.173 mi.)	E14	81
CITY OF CORSICANA LANDFILL	200 N 12TH ST	W 1/8 - 1/4 (0.173 mi.)	E15	82

State and tribal leaking storage tank lists

LPST: The Leaking Petroleum Storage Tank Incident Reports contain an inventory of reported leaking petroleum storage tank incidents. The data come from the Texas Commission on Environmental Quality's Leaking Petroleum Storage Tank Database.

A review of the LPST list, as provided by EDR, and dated 12/10/2010 has revealed that there are 22 LPST sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MAIN STREET SALVAGE Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	222 N MAIN	WNW 0 - 1/8 (0.122 mi.)	B8	39
BNK24 INTERFIRST BANK CORSICAN Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	301 W COLLIN ST	WSW 1/8 - 1/4 (0.157 mi.)	10	53
NAVARRO COUNTY SHERIFFS OFFICE Status Code: FINAL CONCURRENCE PENDING DOCUMENTATION OF WELL PLUGGING	300 W 2ND AVE	WNW 1/4 - 1/2 (0.326 mi.)	38	241
OLD MOBIL SERVICE STATION Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	601 W 7TH AVE	SW 1/4 - 1/2 (0.389 mi.)	45	276
WALLYS AUTOMOTIVE Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	420 N 15TH ST	W 1/4 - 1/2 (0.438 mi.)	47	285
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
TEX-SUN GLOVE CO Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	100 E 7TH	SSE 0 - 1/8 (0.061 mi.)	A2	16

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MOORES MOBIL STATION Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	219 S BEATON	SSE 0 - 1/8 (0.069 mi.)	A3	19
TIGER TOTE 102 Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	200 W 7TH AVE	S 1/8 - 1/4 (0.150 mi.)	C9	43
THE PIT STOP Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	124 N 7TH ST	NE 1/8 - 1/4 (0.221 mi.)	G23	159
DILL & NELSON OIL CO Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	222 S 7TH ST	ENE 1/8 - 1/4 (0.230 mi.)	H25	169
ABC AG CENTER INC Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	103 N 7TH	ENE 1/8 - 1/4 (0.236 mi.)	G29	186
GRAVES OIL CO Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	123 N 7TH ST	NE 1/8 - 1/4 (0.236 mi.)	G30	189
GOODMAN SERVICE STATION Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	417 N COMMERCE ST	NNW 1/8 - 1/4 (0.237 mi.)	31	203
ONE STOP CITGO Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	300 S 7TH ST	E 1/8 - 1/4 (0.247 mi.)	34	220
SUMMERALL SERVICE STATION Status Code: FINAL CONCURRENCE PENDING DOCUMENTATION OF WELL PLUGGING	221 S 7TH ST	ENE 1/8 - 1/4 (0.247 mi.)	H35	228
VACANT LOT Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	521 S 7TH ST	ESE 1/4 - 1/2 (0.330 mi.)	39	245
RALPH RICHARDS Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	601 S 7TH	ESE 1/4 - 1/2 (0.362 mi.)	J40	248
THE FRIENDLY STORE Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	628 S 7TH	ESE 1/4 - 1/2 (0.363 mi.)	J41	256
STEWART MOTOR Status Code: FINAL CONCURRENCE PENDING DOCUMENTATION OF WELL PLUGGING	600 N BEATON	NNW 1/4 - 1/2 (0.364 mi.)	42	262
CITY OF CORSICANA Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	620 S 12TH ST	S 1/4 - 1/2 (0.371 mi.)	K43	262
CITY OF CORSICANA SERVICE CENT Status Code: FINAL CONCURRENCE PENDING DOCUMENTATION OF WELL PLUGGING	620 S 12TH ST	S 1/4 - 1/2 (0.371 mi.)	K44	275
SPTCO PROPERTY Status Code: FINAL CONCURRENCE ISSUED, CASE CLOSED	11TH & 12TH ST	S 1/4 - 1/2 (0.429 mi.)	46	281

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Texas Commission on Environmental Quality's Petroleum Storage Tank Database.

A review of the UST list, as provided by EDR, and dated 12/03/2010 has revealed that there are 23 UST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MAIN STREET SALVAGE	222 N MAIN	WNW 0 - 1/8 (0.122 mi.)	B8	39
BNK24 INTERFIRST BANK CORSICAN	301 W COLLIN ST	WSW 1/8 - 1/4 (0.157 mi.)	10	53
ABANDONED GAS STATION	222 W 7TH AVE	S 1/8 - 1/4 (0.160 mi.)	C11	61

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
T & CO STYLING SALON	300 N MAIN ST	WNW 1/8 - 1/4 (0.168 mi.)	D12	64
CORSICANA SERVICE CENTER	301 S 12TH ST	SSW 1/8 - 1/4 (0.200 mi.)	F18	89
AVENUE FUEL DIST	301 W 7TH AVE	SSW 1/8 - 1/4 (0.202 mi.)	F20	144
KILMARNOCK & BROWN	319 W 7TH AVE	SSW 1/8 - 1/4 (0.212 mi.)	F21	152
872 CO TREMONT	212 W 13TH ST	WSW 1/8 - 1/4 (0.230 mi.)	24	164
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
TEX-SUN GLOVE CO	100 E 7TH	SSE 0 - 1/8 (0.061 mi.)	A2	16
MOORES MOBIL STATION	219 S BEATON	SSE 0 - 1/8 (0.069 mi.)	A3	19
SOUTHERN PACIFIC TRANSPORT CO	201 E 7TH AVE	ESE 0 - 1/8 (0.083 mi.)	4	26
TIGER TOTE 102	200 W 7TH AVE	S 1/8 - 1/4 (0.150 mi.)	C9	43
TARRANT 47	409 E 7TH	E 1/8 - 1/4 (0.183 mi.)	17	84
COCA COLA BOTTLING CO OF N TX	409 S 9TH ST	ESE 1/8 - 1/4 (0.213 mi.)	22	156
THE PIT STOP	124 N 7TH ST	NE 1/8 - 1/4 (0.221 mi.)	G23	159
DILL & NELSON OIL CO	222 S 7TH ST	ENE 1/8 - 1/4 (0.230 mi.)	H25	169
ABC AG CENTER INC	103 N 7TH	ENE 1/8 - 1/4 (0.236 mi.)	G29	186
GRAVES OIL CO	123 N 7TH ST	NE 1/8 - 1/4 (0.236 mi.)	G30	189
GOODMAN SERVICE STATION	417 N COMMERCE ST	NNW 1/8 - 1/4 (0.237 mi.)	31	203
CORSICANA PAPER & RAG CO	518 E COLLINS	ENE 1/8 - 1/4 (0.242 mi.)	32	207
ONE STOP CITGO	300 S 7TH ST	E 1/8 - 1/4 (0.247 mi.)	34	220
SUMMERALL SERVICE STATION	221 S 7TH ST	ENE 1/8 - 1/4 (0.247 mi.)	H35	228
FORMER WHITESELLE LUMBER CO	301 E 3RD AVE	N 1/8 - 1/4 (0.250 mi.)	36	237

State and tribal voluntary cleanup sites

VCP: Voluntary Cleanup Program Sites.

A review of the VCP list, as provided by EDR, and dated 11/05/2010 has revealed that there is 1 VCP site within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
NATIONAL INCINERATOR	305 NORTH 7TH STREET	NNE 1/4 - 1/2 (0.272 mi.)	37	240

ADDITIONAL ENVIRONMENTAL RECORDS

Other Ascertainable Records

RCRA-NonGen: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA-NonGen list, as provided by EDR, and dated 02/17/2010 has revealed that there are 6 RCRA-NonGen sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
CURINGTON CLEANERS	114 W COLLIN ST	WSW 0 - 1/8 (0.013 mi.)	1	7

EXECUTIVE SUMMARY

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
CENTRAL LINEN SUPPLY INC	215 N MAIN ST	WNW 0 - 1/8 (0.116 mi.)	B7	37
JIM HOWARDS PAINT & BODY SHOP	311 N MAIN	WNW 1/8 - 1/4 (0.173 mi.)	D16	82
CUSTOM PAINT & BODY SHOP	420 N BEATON ST	NNW 1/8 - 1/4 (0.233 mi.)	I27	177
CORSICANA FORD INC	400 N MAIN ST	NW 1/8 - 1/4 (0.234 mi.)	28	184
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
FKI LOGISTEX INC	211 N 7TH ST	NE 1/8 - 1/4 (0.243 mi.)	33	210

DRYCLEANERS: Drycleaner Registration Database Listing.

A review of the DRYCLEANERS list, as provided by EDR, and dated 10/18/2010 has revealed that there are 3 DRYCLEANERS sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
CURINGTON CLEANERS	114 W COLLIN ST	WSW 0 - 1/8 (0.013 mi.)	1	7
COMET CLEANERS	201 W 6TH AVE	SSW 0 - 1/8 (0.105 mi.)	5	29
CENTRAL LINEN SUPPLY	215 N MAIN ST	WNW 0 - 1/8 (0.116 mi.)	B6	30

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the Manufactured Gas Plants list, as provided by EDR, has revealed that there is 1 Manufactured Gas Plants site within approximately 1 mile of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
CORSICANA GAS AND ELECTRIC CO	909 S 12TH STREET	SSE 1/2 - 1 (0.571 mi.)	48	291

EXECUTIVE SUMMARY


Due to poor or inadequate address information, the following sites were not mapped. Count: 23 records.

<u>Site Name</u>	<u>Database(s)</u>
YORK FLYING SERVICE	CERC-NFRAP
CITY OF CORSICANA LANDFILL	SWF/LF
CORSICANA TRANSFER STATION	SWF/LF
REDDEN GLENN LANDFILL	SWF/LF
HILLOCK FOODS INC	LPST
BURNET PROPERTY	LPST
PENSKE TRUCK LEASING CO LP	LPST
EUREKA GROCERY	LPST, UST
MILDRED ISD	LPST
CLEARVIEW MARINA	UST, FINANCIAL ASSURANCE
MURPHY USA 6948	UST, FINANCIAL ASSURANCE
WAL-MART SUPERCENTER 565	UST
RATLIFF READY MIX P2	AST
MILDRED ISD	AST
CLEARVIEW MARINA	AST
WAL-MART SUPERCENTER 565	RCRA-SQG
PENSKE TRUCK LEASING CO LP	RCRA-NonGen, FINDS
EXXON MOBIL CORPORATION	RCRA-NonGen, FINDS
THE K WAY EQUIPMENT CO	RCRA-CESQG, FINDS
DANNYS PAINT & BODY	RCRA-CESQG, FINDS
N. HWY 76,SEC-10, R-3 WEST T-2 SOU	ERNS
3105 N. HWY 75, CORSICANA, TX	SPILLS
BEATON LAKE ESTATES WATER SYSTEM	ENF

- Indian Reservations BIA
- Power transmission lines
- Oil & Gas pipelines

Copyright © 2011 EDR, Inc. © 2010 Tele Atlas Rel. 07/2009.

DETAIL MAP - 3025321.2s

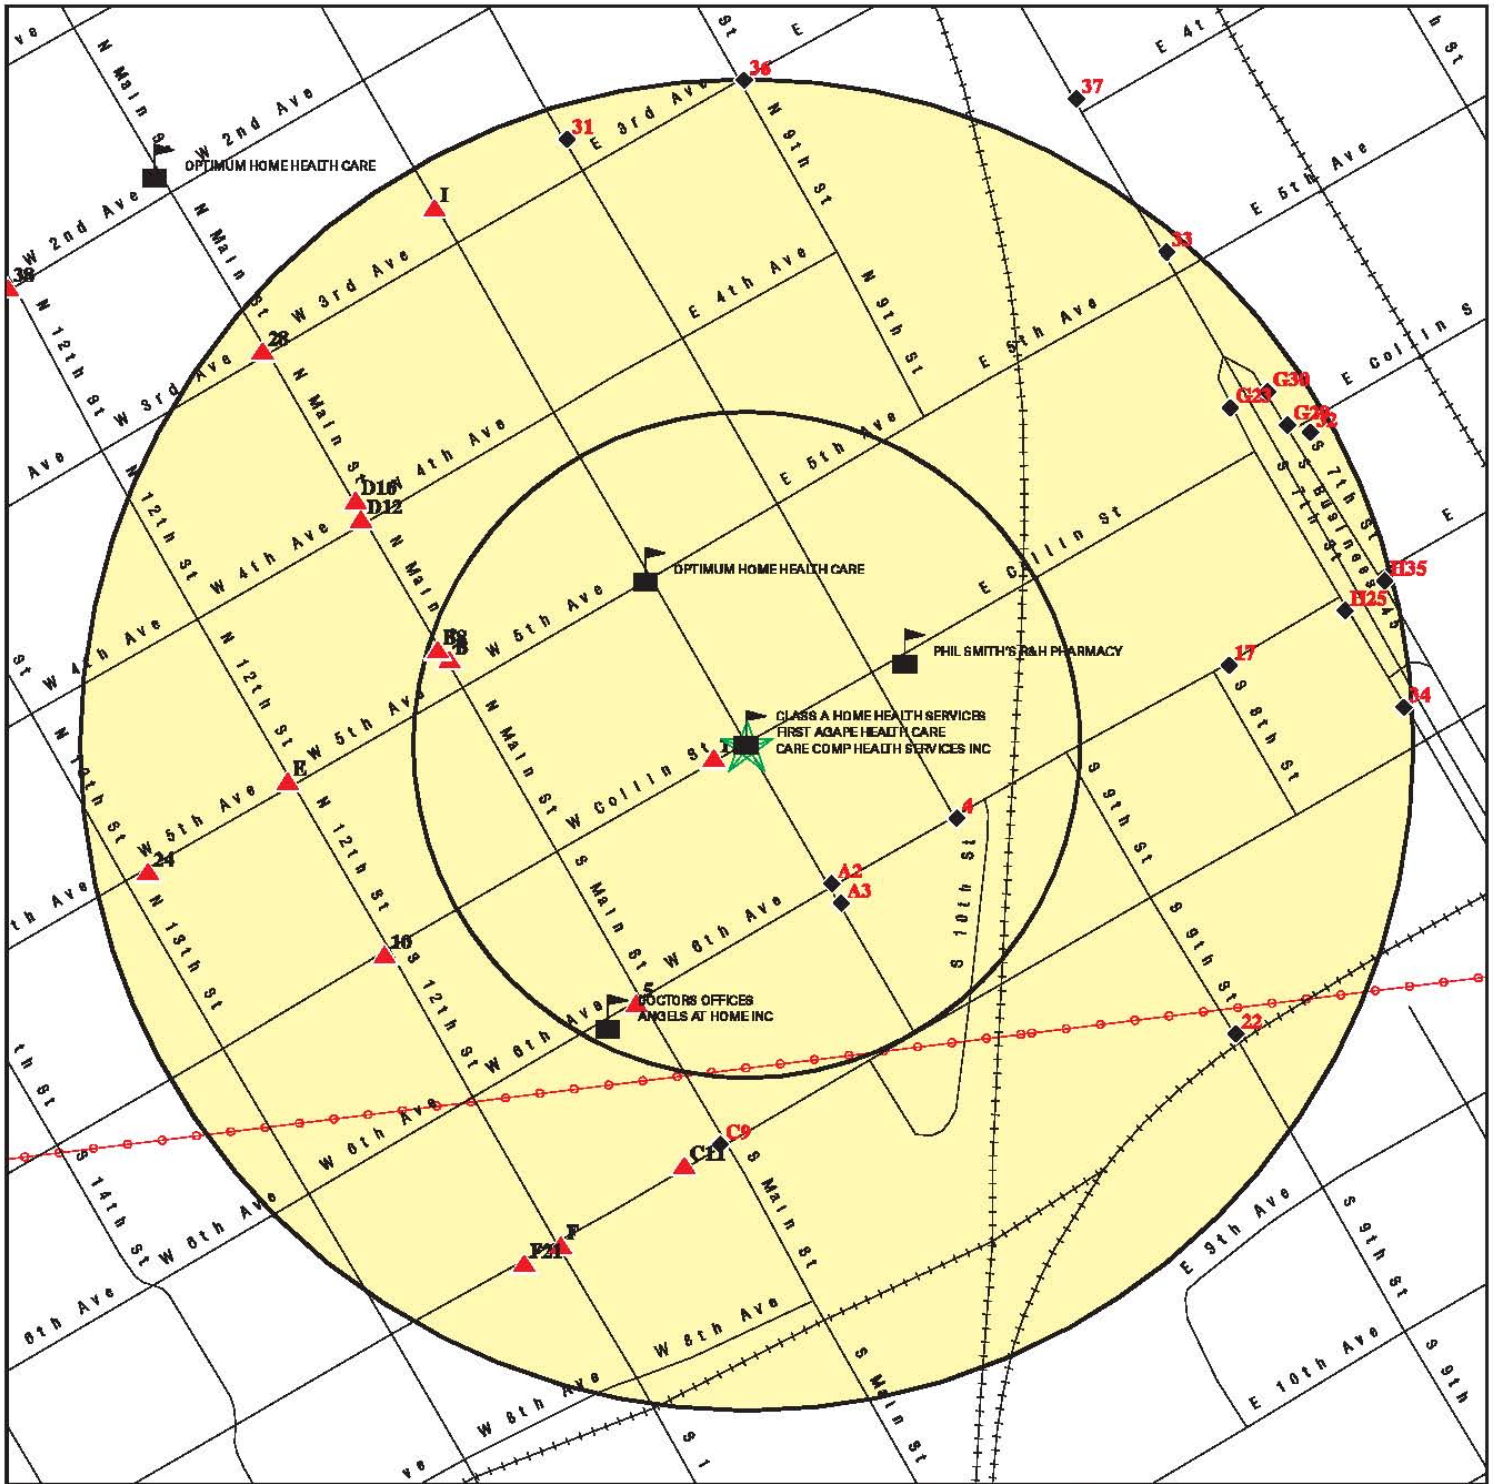

- ★ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Manufactured Gas Plants
- ▲ Sensitive Receptors
- National Priority List Sites
- Dept. Defense Sites

- Indian Reservations BIA
- Power transmission lines
- Oil & Gas pipelines

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: 101 N. Beaton
ADDRESS: 101 N. Beaton
Corsicana TX 75110
LAT/LONG: 32.0936 / 96.4636

CLIENT: G.E.C., Inc.
CONTACT: Jennifer Lindquist
INQUIRY #: 3025321.2s
DATE: March 28, 2011 3:12 pm

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
<i>Federal NPL site list</i>								
NPL		1.000	0	0	0	0	NR	0
Proposed NPL		1.000	0	0	0	0	NR	0
NPL LIENS	TP		NR	NR	NR	NR	NR	0
<i>Federal Delisted NPL site list</i>								
Delisted NPL		1.000	0	0	0	0	NR	0
<i>Federal CERCLIS list</i>								
CERCLIS		0.500	0	0	0	NR	NR	0
FEDERAL FACILITY		1.000	0	0	0	0	NR	0
<i>Federal CERCLIS NFRAP site List</i>								
CERC-NFRAP		0.500	0	0	0	NR	NR	0
<i>Federal RCRA CORRACTS facilities list</i>								
CORRACTS		1.000	0	0	0	0	NR	0
<i>Federal RCRA non-CORRACTS TSD facilities list</i>								
RCRA-TSDF		0.500	0	0	0	NR	NR	0
<i>Federal RCRA generators list</i>								
RCRA-LQG		0.250	0	0	NR	NR	NR	0
RCRA-SQG		0.250	0	0	NR	NR	NR	0
RCRA-CESQG		0.250	0	2	NR	NR	NR	2
<i>Federal institutional controls / engineering controls registries</i>								
US ENG CONTROLS		0.500	0	0	0	NR	NR	0
US INST CONTROL		0.500	0	0	0	NR	NR	0
<i>Federal ERNS list</i>								
ERNS	TP		NR	NR	NR	NR	NR	0
<i>State- and tribal - equivalent NPL</i>								
SHWS		1.000	0	0	0	0	NR	0
<i>State and tribal landfill and/or solid waste disposal site lists</i>								
SWF/LF		0.500	0	3	0	NR	NR	3
CLI		0.500	0	0	0	NR	NR	0
WasteMgt	TP		NR	NR	NR	NR	NR	0
<i>State and tribal leaking storage tank lists</i>								
LPST		0.500	3	9	10	NR	NR	22
INDIAN LUST		0.500	0	0	0	NR	NR	0
<i>State and tribal registered storage tank lists</i>								
UST		0.250	4	19	NR	NR	NR	23

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
AST		0.250	0	0	NR	NR	NR	0
INDIAN UST		0.250	0	0	NR	NR	NR	0
FEMA UST		0.250	0	0	NR	NR	NR	0
<i>State and tribal institutional control / engineering control registries</i>								
AUL		0.500	0	0	0	NR	NR	0
<i>State and tribal voluntary cleanup sites</i>								
VCP		0.500	0	0	1	NR	NR	1
INDIAN VCP		0.500	0	0	0	NR	NR	0
<i>State and tribal Brownfields sites</i>								
BROWNFIELDS		0.500	0	0	0	NR	NR	0
<u>ADDITIONAL ENVIRONMENTAL RECORDS</u>								
<i>Local Brownfield lists</i>								
US BROWNFIELDS		0.500	0	0	0	NR	NR	0
<i>Local Lists of Landfill / Solid Waste Disposal Sites</i>								
DEBRIS REGION 9		0.500	0	0	0	NR	NR	0
ODI		0.500	0	0	0	NR	NR	0
INDIAN ODI		0.500	0	0	0	NR	NR	0
<i>Local Lists of Hazardous waste / Contaminated Sites</i>								
US CDL		TP	NR	NR	NR	NR	NR	0
DEL SHWS		1.000	0	0	0	0	NR	0
PRIORITYCLEANERS		0.500	0	0	0	NR	NR	0
US HIST CDL		TP	NR	NR	NR	NR	NR	0
<i>Local Land Records</i>								
LIENS 2		TP	NR	NR	NR	NR	NR	0
LUCIS		0.500	0	0	0	NR	NR	0
LIENS		TP	NR	NR	NR	NR	NR	0
HIST LIENS		TP	NR	NR	NR	NR	NR	0
<i>Records of Emergency Release Reports</i>								
HMIRS		TP	NR	NR	NR	NR	NR	0
SPILLS		TP	NR	NR	NR	NR	NR	0
<i>Other Ascertainable Records</i>								
RCRA-NonGen		0.250	2	4	NR	NR	NR	6
DOT OPS		TP	NR	NR	NR	NR	NR	0
DOD		1.000	0	0	0	0	NR	0
FUDS		1.000	0	0	0	0	NR	0
CONSENT		1.000	0	0	0	0	NR	0
ROD		1.000	0	0	0	0	NR	0

MAP FINDINGS SUMMARY

Database	Target Property	Search Distance (Miles)	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
UMTRA		0.500	0	0	0	NR	NR	0
MINES		0.250	0	0	NR	NR	NR	0
TRIS		TP	NR	NR	NR	NR	NR	0
TSCA		TP	NR	NR	NR	NR	NR	0
FTTS		TP	NR	NR	NR	NR	NR	0
HIST FTTS		TP	NR	NR	NR	NR	NR	0
SSTS		TP	NR	NR	NR	NR	NR	0
ICIS		TP	NR	NR	NR	NR	NR	0
PADS		TP	NR	NR	NR	NR	NR	0
MLTS		TP	NR	NR	NR	NR	NR	0
RADINFO		TP	NR	NR	NR	NR	NR	0
FINDS		TP	NR	NR	NR	NR	NR	0
RAATS		TP	NR	NR	NR	NR	NR	0
IOP		TP	NR	NR	NR	NR	NR	0
NPDES		TP	NR	NR	NR	NR	NR	0
UIC		TP	NR	NR	NR	NR	NR	0
DRYCLEANERS		0.250	3	0	NR	NR	NR	3
ENF		TP	NR	NR	NR	NR	NR	0
Ind. Haz Waste		TP	NR	NR	NR	NR	NR	0
ED AQUIF		TP	NR	NR	NR	NR	NR	0
AIRS		TP	NR	NR	NR	NR	NR	0
MSD		0.500	0	0	0	NR	NR	0
TIER 2		TP	NR	NR	NR	NR	NR	0
RWS		TP	NR	NR	NR	NR	NR	0
INDIAN RESERV		1.000	0	0	0	0	NR	0
SCRD DRYCLEANERS		0.500	0	0	0	NR	NR	0
PCB TRANSFORMER		TP	NR	NR	NR	NR	NR	0
COAL ASH EPA		0.500	0	0	0	NR	NR	0
COAL ASH DOE		TP	NR	NR	NR	NR	NR	0
GCC		TP	NR	NR	NR	NR	NR	0
FINANCIAL ASSURANCE		TP	NR	NR	NR	NR	NR	0

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants	1.000	0	0	0	1	NR	1
-------------------------	-------	---	---	---	---	----	---

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

1
WSW
< 1/8
0.013 mi.
71 ft.

CURINGTON CLEANERS
114 W COLLIN ST
CORSICANA, TX 75110

RCRA-NonGen
FINDS
DRYCLEANERS
Ind. Haz Waste
1000257677
TXD110037165

Relative:
Equal

RCRA-NonGen:

Date form received by agency: 07/27/2001

Facility name: CURINGTON CLEANERS

Facility address: 114 W COLLIN ST
CORSICANA, TX 75110

EPA ID: TXD110037165

Mailing address: PO BOX1167
CORSICANA, TX 75151

Contact: MICHAEL KASTER

Contact address: PO BOX1167
CORSICANA, TX 75151

Contact country: US

Contact telephone: 214-874-5881

Contact email: Not reported

EPA Region: 06

Classification: Non-Generator

Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: CURINGTON CLEANERS

Owner/operator address: PO BOX1167
CORSICANA, TX 75151

Owner/operator country: US

Owner/operator telephone: 214-874-5881

Legal status: Not reported

Owner/Operator Type: Operator

Owner/Op start date: 07/27/2001

Owner/Op end date: Not reported

Owner/operator name: CURINGTON CLEANERS

Owner/operator address: PO BOX1167
CORSICANA, TX 75151

Owner/operator country: US

Owner/operator telephone: 214-874-5881

Legal status: Not reported

Owner/Operator Type: Owner

Owner/Op start date: 07/27/2001

Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: Not reported

Mixed waste (haz. and radioactive): Not reported

Recycler of hazardous waste: No

Transporter of hazardous waste: No

Treater, storer or disposer of HW: Not reported

Underground injection activity: Not reported

On-site burner exemption: No

Furnace exemption: No

Used oil fuel burner: No

Used oil processor: Not reported

User oil refiner: No

Used oil fuel marketer to burner: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CURINGTON CLEANERS (Continued)

1000257677

Used oil Specification marketer: No
Used oil transfer facility: Not reported
Used oil transporter: Not reported
Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 08/04/1985
Facility name: CURINGTON CLEANERS
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110005071448

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Texas Commission on Environmental Quality - Agency Central Registry (TX-TCEQ ACR) is a computer application that allows the Texas Commission on Environmental Quality (TCEQ) to use a single, centralized area to record common information, such as the company names, addresses, and telephone numbers of those the TCEQ regulates. It also contains additional IDs (permits, registrations, authorizations, etc) and their status.

DRYCLEANERS:

Fiscal Year: FY2011
PERC Status: Not reported
Owner Name: Not reported
Registration Number: Not reported
Site Type: FACILITY REGISTRATION
Registration Status: ACTIVE
LGL Id: Not reported
Phys Id: Not reported
Site Start Date: Not reported
Site Operation Status: Not reported
RN Number: RN100596394
Role Type: Not reported
Aff Begin Date: Not reported
Aff End Date: Not reported
CN Number: CN602456436
AR Number: 24000080
Principal Contact Name: MICHAEL E KASTER
Principal Legal Name: Not reported
Principal Name: Not reported
Affil Ad Type: Not reported
Solvent: PERCHLOROETHYLENE (TETRA
Gallons: 100
Part Stat: YES

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CURINGTON CLEANERS (Continued)

1000257677

Gross Receipts: \$150,000 O
Mail Delivery Address: 114 W COLLIN ST
Mail Delivery Address2: Not reported
Mail Int: Not reported
Mail City/State/Zip: CORSICANA, TX 75110 5223
Phone: 9038725728
EMail: MOETAILOR@SBCGLOBAL.NET
Physical Description: Not reported
Physical Near City/State/Zip: Not reported

Fiscal Year: FY2011
PERC Status: Not reported
Owner Name: Not reported
Registration Number: Not reported
Site Type: FACILITY REGISTRATION
Registration Status: ACTIVE
LGL Id: Not reported
Phys Id: Not reported
Site Start Date: Not reported
Site Operation Status: Not reported
RN Number: RN100596394
Role Type: Not reported
Aff Begin Date: Not reported
Aff End Date: Not reported
CN Number: CN602456436
AR Number: 24000080
Principal Contact Name: MICHAEL E KASTER
Principal Legal Name: Not reported
Principal Name: Not reported
Affil Ad Type: Not reported
Solvent: PETROLEUM
Gallons: 30
Part Stat: YES
Gross Receipts: \$150,000 O
Mail Delivery Address: 114 W COLLIN ST
Mail Delivery Address2: Not reported
Mail Int: Not reported
Mail City/State/Zip: CORSICANA, TX 75110 5223
Phone: 9038725728
EMail: MOETAILOR@SBCGLOBAL.NET
Physical Description: Not reported
Physical Near City/State/Zip: Not reported

Fiscal Year: FY2010
PERC Status: Not reported
Owner Name: Not reported
Registration Number: 100596394
Site Type: FACILITY REGISTRATION
Registration Status: ACTIVE
LGL Id: 12799742
Phys Id: 3000168
Site Start Date: 7/13/2010
Site Operation Status: ACTIVE
RN Number: RN100596394
Role Type: BILLING
Aff Begin Date: 9/1/2003
Aff End Date: 12/31/3000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CURINGTON CLEANERS (Continued)

1000257677

CN Number: CN602456436
AR Number: Not reported
Principal Contact Name: MICHAEL E KASTER
Principal Legal Name: Michael E Kaster
Principal Name: Not reported
Affil Ad Type: Not reported
Solvent: Not reported
Gallons: Not reported
Part Stat: Not reported
Gross Receipts: Not reported
Mail Delivery Address: Not reported
Mail Delivery Address2: Not reported
Mail Int: Not reported
Mail City/State/Zip: Not reported
Phone: Not reported
EMail: Not reported
Physical Description: 114 W Collin Street, Corsicana, TX
Physical Near City/State/Zip: TX 75110

Fiscal Year: FY2010
PERC Status: Not reported
Owner Name: Not reported
Registration Number: 100596394
Site Type: FACILITY REGISTRATION
Registration Status: ACTIVE
LGL Id: 12799742
Phys Id: 3000168
Site Start Date: 7/13/2010
Site Operation Status: ACTIVE
RN Number: RN100596394
Role Type: OWN
Aff Begin Date: 9/1/2003
Aff End Date: 12/31/3000

CN Number: CN602456436
AR Number: Not reported
Principal Contact Name: MICHAEL E KASTER
Principal Legal Name: Michael E Kaster
Principal Name: Not reported
Affil Ad Type: CUSTMAIL
Solvent: Not reported
Gallons: Not reported
Part Stat: Not reported
Gross Receipts: Not reported
Mail Delivery Address: 114 W COLLIN ST
Mail Delivery Address2: Not reported
Mail Int: Not reported
Mail City/State/Zip: CORSICANA, TX 75110 5223
Phone: Not reported
EMail: Not reported
Physical Description: 114 W Collin Street, Corsicana, TX
Physical Near City/State/Zip: TX 75110

Ind. Haz Waste:

Transporters Registration Number: 55326
Registration Initial Notification Date: 19850808
Registration Last Amendment Date: 20010727
EPA Identification: TXD110037165

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CURINGTON CLEANERS (Continued)

1000257677

Primary NAICS Code: 999999
Status Change Date: 19970822
Land Type: Not reported
Description of Facility Site Location: 114 W Collin Street, Corsicana, TX
Site Primary Standard Industrial Code: 99990
Site Primary SIC Description: Nonclassi
Registration is Generator of Waste: Yes
Registration is Receivers of Waste: No
Registration is Transporter of Waste: No
Registration is Transfer Facility: No
Facility is STEERS Reporter: No
Required to Submit Annual Waste Summary: No
Facility Involved In Recycling: No
Revcr Has Monthly Reporting Requirement: 0
Mexican Facility: Does not represent a Maquiladora (Mexican Facility)
Facility Status: Inactive
Type of Generator: Non-industrial and/or municipal, CESQG
TNRCC Region: Not reported
Company Name: Curington Cleaners
Contact Name: Michael Kaster
Contact Telephone Number: 214-874-5881
Mailing Address: Not reported
Mailing Address2: Not reported
Mailing City,St,Zip: Corsicana, TX 75151
Mailing County: USA
Facility County: Not reported
Facility Country: Not reported
TNRCC Facility ID: 019288
Site Owner Tax ID: Not reported
Site Location Latitude: Not reported
Site Location Longitude: Not reported
Last Update to NOR Data: 20020213
Ind. waste permit Number: Not reported
Mun waste permit Number: Not reported
Non Notifier: No
Year: 2010

OWNER:

Owner Mailing Address: Not reported
Owner Mailing Address2: Not reported
Owner Mailing Address3: PO Box1167
Owner City,St,Zip: Corsicana, TX 75151
Owner Country: USA
Owner Phone Number: 214-874-5881
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Unknown
Owner Tax Id: Not reported
Owner Bankruptcy Code: 0

OWNER:

Owner Mailing Address: Not reported
Owner Mailing Address2: Not reported
Owner Mailing Address3: PO Box1167
Owner City,St,Zip: Corsicana, TX 75151
Owner Country: USA
Owner Phone Number: 214-874-5881
Owner Fax Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CURINGTON CLEANERS (Continued)

1000257677

Owner Email Address: Not reported
Owner Business Type: Unknown
Owner Tax Id: Not reported
Owner Bankruptcy Code: 0

OWNER:

Owner Mailing Address: Not reported
Owner Mailing Address2: Not reported
Owner Mailing Address3: PO Box1167
Owner City,St,Zip: Corsicana, TX 75151
Owner Country: USA
Owner Phone Number: 214-874-5881
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Unknown
Owner Tax Id: Not reported
Owner Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Curington Cleaners
Operator First Name: Not reported
Operator Name: Curington Cleaners
Operator Mailing Address: Not reported
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75151
Operator Country: USA
Operator Phone: 214-874-5881
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Unknown
Operator Tax Id: Not reported
Operator Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Curington Cleaners
Operator First Name: Not reported
Operator Name: Curington Cleaners
Operator Mailing Address: Not reported
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75151
Operator Country: USA
Operator Phone: 214-874-5881
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Unknown
Operator Tax Id: Not reported
Operator Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Curington Cleaners
Operator First Name: Not reported
Operator Name: Curington Cleaners
Operator Mailing Address: Not reported
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75151
Operator Country: USA
Operator Phone: 214-874-5881
Operator Fax: Not reported
Operator Email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CURINGTON CLEANERS (Continued)

1000257677

Operator Business Type: Unknown
Operator Tax Id: Not reported
Operator Bankruptcy Code: 0

CONTACT:

Contact Name: Michael Kaster
Contact Title: Environmental Manager
Contact Role: Primary Contact
Contact Address: Not reported
Contact Address2: Not reported
Contact City,St,Zip: Corsicana, TX 75151
Contact Phone: 214-874-5881
Contact Fax: Not reported
Contact Email: Not reported

CONTACT:

Contact Name: Michael Kaster
Contact Title: Environmental Manager
Contact Role: Primary Contact
Contact Address: Not reported
Contact Address2: Not reported
Contact City,St,Zip: Corsicana, TX 75151
Contact Phone: 214-874-5881
Contact Fax: Not reported
Contact Email: Not reported

CONTACT:

Contact Name: Michael Kaster
Contact Title: Environmental Manager
Contact Role: Primary Contact
Contact Address: Not reported
Contact Address2: Not reported
Contact City,St,Zip: Corsicana, TX 75151
Contact Phone: 214-874-5881
Contact Fax: Not reported
Contact Email: Not reported

Business Desc: This registration was inactivated because there were only 6-digit waste codes onthe NOR and no waste activity was reported in 1994, 1995 and 1996.This registration was inactivated because there were only 6-digit waste codes onthe NOR and no waste activity was reported in 1994, 1995 and 1996.This registration was inactivated because there were only 6-digit waste codes onthe NOR and no waste activity was reported in 1994, 1995 and 1996.

UNIT:

Deed Record Needed: Not reported
Deed Recording Date: Not reported
Unit No: Not reported
Unit Type Code: Not reported
Unit Type: Not reported
Unit Status: Not reported
Unit Regulatory Status: Not reported
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CURINGTON CLEANERS (Continued)

1000257677

System Type Code: Not reported
System Type: Not reported
System Type Code 1: Not reported
System Type 1: Not reported
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Not reported
Dt Last Changed: Not reported
Waste Management: Not reported
WasteID: ,

ACTIVITY:

Activity Type Involves: Not reported
Activity Desc: Not reported

OTS:

Site Name: Not reported
One-time Shipper ID: Not reported
Location Desc: Not reported
Location Address: Not reported
Location Address 2: Not reported
Location City: Not reported
Location Zip: Not reported
Broker Name: Not reported
EPA Waste Source Code: Not reported
EPA System Type Code: Not reported
EPA Form: Not reported
EPA Waste No: Not reported
Broker Phone: Not reported
Date Processing Complete: Not reported
Date Request Sent: Not reported
Company Name: Not reported
Waste ID: Not reported
Waste Form: Not reported
Waste Class: Not reported
Waste Origin Code: Not reported
Shipment Request ID: Not reported
Waste Code Audited: Not reported

RCV:

Waste Receipts Summary Form Code: Not reported
State Manifest Documentaion Number: Not reported
Generators TX Registration Number: Not reported
Generators EPA ID: Not reported
Generators Waste Code: Not reported
Generators Waste Classification: Not reported
Generators Waste Form Code: Not reported
Generators Waste Form: Not reported
Quantity Shipped: Not reported
Units: Not reported
How Waste Handled by Receivers: Not reported
Receivers Date: Not reported
Transporters Registration Number: Not reported
Shipment Comment: Not reported

1000257677

EPA Haz Waste:	Not reported
EPA Haz Waste:	Not reported
EPA Haz Waste:	Not reported
EPA Haz Waste:	Not reported
Receiver Name:	Not reported
Reporting method:	Not reported
No Shipmnts Recvd In Rept Period:	Not reported
Record Creation Date:	Not reported
Record Contains Error:	Not reported
Record ID:	Not reported
Co. Submitting Report:	Not reported
Authorized Agent Submitting Report:	Not reported
Authorized Agent Title:	Not reported

WASTE:

Waste ID:	00044116
Waste Desc Yr:	2001
Waste Descriptn:	Not reported
Desc of Waste:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOR THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOR THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOR THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOR THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOR THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOR THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOR THE FOLLOWING SPENT HALOGENATED SOLVENTS: SPENT HALOGENATED SOLVENTS: TETRACHLOROETHY-
Texas Waste Code:	991002
Texas Waste Code 2:	Not reported
Waste Code Status:	Inactive
Waste Form Code:	Not reported
Waste Form:	Not reported
Waste Classification:	H
Waste is Radioactive:	Not reported
Waste Treated Off Site:	0
Primary Standard Industrial Code:	Not reported
Standard Industrial Classification:	Not reported
Primary Source:	Not reported
Primary Source:	Not reported
Primary Measurement Point Code:	Not reported
Primary Measurement Point:	Not reported
Primary Origin Code:	Not reported
Primary Origin:	Not reported
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	Not reported
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported
Reason Waste Form No Longer Gen.:	NOR Inactivated
EPA Haz Waste:	Not reported

Click this hyperlink while viewing on your computer to access additional TX IHW: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A2
SSE
< 1/8
0.061 mi.
322 ft.

TEX-SUN GLOVE CO
100 E 7TH
CORSICANA, TX 75110
Site 1 of 2 in cluster A

LPST
UST

U001292230
N/A

Relative:
Lower

LPST:

Facility ID: 63134
Facility Location: 100 BLOCK EAST 7TH STREET
Region City ID: 4
Region City: ARLINGTON
LPST Id: 105571
Reported Date: 1992-11-17 00:00:00
Entered Date: 1993-02-04 00:00:00
Priority Description: The vertical extent of contamination has been defined and the assessment results document that groundwater is not affected.

Status: FINAL CONCURRENCE ISSUED, CASE CLOSED

RPR Coordinator: RPR
Responsible Party Name: TEX SUN GLOVE COMPANY
Responsible Party Contact: ROB KENNEDY
Responsible Party Address: PO BOX 1441
Responsible Party City,St,Zip: CORSICANA, TX 75151
Responsible Party Telephone: 817/751-3470

UST:

Facility ID: 0063134
Facility Type: Fleet Refueling
Name of Facility Manager: CARTER HART
Title of Facility Manager: Not reported
Facility Manager Phone: 903-874-6587
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 094004
Owner ID: 38754
Disputed Owner: Not reported
Date Registration Form Received: 060992
Region Number: 04
Number of USTs: 1
Sign Name on Registration Form: S J BEEBE
Title of Signer of Registration Form: OWNER
Date of Signature on Registration Form: 060492
Owner Effective Begin Date: 060992

Owner ID: 38754
In Care Of: Not reported
Owner Name: BEEBE S J MR
Owner Address: Not reported
Owner PO Box: PO BOX 1441
Owner City,St,Zip: CORSICANA, TX 75151
Owner Contact Name: CARTER HART
Contact Telephone: 903-874-6587
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Contact Changed
Owner Amendment Date: 042808
Number of Facilities reported by Owner: 0001
Of Underground Storage Tanks: 0001
Of Aboveground Storage Tanks: 0000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TEX-SUN GLOVE CO (Continued)

U001292230

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported
Operator Name: Not reported
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: Not reported
Operator City,St,Zip: Not reported
Operator Contact Name: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported

Tank ID: 1
Unit ID: 00145932
Tank Status: **Removed from the Ground**
Tank Regulatory Status: Fully Regulated
Status Date: 11171992
Installation Date: Not reported
Tank Registration Date: 06091992
Capacity: 0000000
Tank Emptied: No
Tank Construction and Containment: Single Wall
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Not reported
Pipe Construction and Containment II: Not reported
Piping Design and Ext. Containment 3: Not reported
Piping Design and Ext. Containment 4: Not reported
Type of Piping: Suction
Internal Tank Lining Date: 00000000
Tank Material of Construction: Steel
Other Materials of Construction: Not reported
Pipe Material of Construction: Not reported
Other Construction and Containment: Not reported
Pipe Connectors and Valves 1: Not reported
Pipe Connectors and Valves 2: Not reported
Pipe Connectors and Valves 3: Not reported
Tank Corrosion Protection: Not reported
Tank Corrosion Protection II: Not reported
Tank Corrosion Protection III: Not reported
Other Tank Corrosion Protection Text: None
Tank Corrosion Protection Variance: No Variance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TEX-SUN GLOVE CO (Continued)

U001292230

Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported

Self-Certification Date:	Not reported
Compartment:	Not reported

Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:	
Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:	
Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TEX-SUN GLOVE CO (Continued)

U001292230

Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

A3
SSE
< 1/8
0.069 mi.
365 ft.

MOORES MOBIL STATION
219 S BEATON
CORSICANA, TX 75110
Site 2 of 2 in cluster A

LPST U001268946
UST N/A

Relative:
Lower

LPST:

Actual:
423 ft.

Facility ID: 36038
Facility Location: 219 S BEATON
Region City ID: 4
Region City: ARLINGTON
LPST Id: 113806
Reported Date: 1998-12-07 00:00:00
Entered Date: 1998-12-09 00:00:00
Priority Description: Groundwater is affected.
Status: FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator: RWD
Responsible Party Name: MOORE & MOSES CO
Responsible Party Contact: LEWIS E MOORE
Responsible Party Address: 218 S BEATON
Responsible Party City,St,Zip: CROSICANA, TX 75110
Responsible Party Telephone: 903/874-3671

UST:

Facility ID: 0036038
Facility Type: Retail
Name of Facility Manager: LEWIS E MOORE JR
Title of Facility Manager: OWNER
Facility Manager Phone: 903-874-3671
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 067894
Owner ID: 16589
Disputed Owner: Not reported
Date Registration Form Received: 050886
Region Number: 04
Number of USTs: 4
Sign Name on Registration Form: LEWIS E MOORE JR
Title of Signer of Registration Form: OWNER
Date of Signature on Registration Form: 041686
Owner Effective Begin Date: 050886

Owner ID: 16589
In Care Of: Not reported
Owner Name: MOORE & MOSES CO
Owner Address: Not reported
Owner PO Box: PO BOX 1531

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOORES MOBIL STATION (Continued)

U001268946

Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: Not reported
Contact Telephone: 2148743671
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Unknown, Migrated Data
Owner Amendment Date: 042893
Number of Facilities reported by Owner: 0001
Of Underground Storage Tanks: 0004
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported
Operator Name: Not reported
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: Not reported
Operator City,St,Zip: Not reported
Operator Contact Name: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported

Tank ID: 1
Unit ID: 00095357
Tank Status: Removed from the Ground
Tank Regulatory Status: Fully Regulated
Status Date: 05051999
Installation Date: 01011955
Tank Registration Date: 05081986
Capacity: 0005000
Tank Emptied: No
Tank Construction and Containment: Not reported
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Not reported
Pipe Construction and Containment II: Not reported
Piping Design and Ext. Containment 3: Not reported
Piping Design and Ext. Containment 4: Not reported
Type of Piping: Not reported
Internal Tank Lining Date: 00000000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOORES MOBIL STATION (Continued)

U001268946

Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00095358
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	05051999
Installation Date:	01011955
Tank Registration Date:	05081986
Capacity:	0005000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOORES MOBIL STATION (Continued)

U001268946

Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOORES MOBIL STATION (Continued)

U001268946

Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	3
Unit ID:	00095359
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	05051999
Installation Date:	01011955
Tank Registration Date:	05081986
Capacity:	0000500
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Used Oil
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOORES MOBIL STATION (Continued)

U001268946

Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	4
Unit ID:	00191809
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Exempt Remv'd w/i 60 days
Status Date:	05051999
Installation Date:	08311987
Tank Registration Date:	08021999
Capacity:	0005000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Suction
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOORES MOBIL STATION (Continued)

U001268946

Installer License Number: Not reported
Tank Installer: Not reported

Self-Certification Date: Not reported
Compartment: Not reported

Compartment Letter: A
Compartment Capacity: 0000000
Compartment Substance Stored: Gasoline
Compartment Other Substance: Not reported
Tank Release Method Detection I: Not reported
Tank Release Method Detection II: Not reported
Tank Release Method Detection III: Not reported
Other Tank Release Method Detection: Not reported
Tank Release Detection Variance: No Variance
Pipe Release Detection Method: Not reported
Pipe Release Detection Method II: Not reported
Pipe Release Detection Method III: Not reported
Other Pipe Release Detection Method: None
Pipe Release Detection Variance: No Variance
Spill and Overfill Protection: Not reported
Spill and Overfill Protection II: Not reported
Spill and Overfill Protection III: Not reported
Spill Overfill Prevention Variation: No Variance

Operator History:
Operator ID: Not reported
Operator Name or Business Name: Not reported
Operator Effective Begin Date: Not reported
Operator Effective End Date: Not reported
Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:
Facility ID: Not reported
Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

4
ESE
< 1/8
0.083 mi.
439 ft.

SOUTHERN PACIFIC TRANSPORT CO
201 E 7TH AVE
CORSICANA, TX 75110

UST **U001962201**
N/A

Relative:
Lower

UST:

Actual:
421 ft.

Facility ID:	0065723
Facility Type:	Fleet Refueling
Name of Facility Manager:	Steve McNaughton
Title of Facility Manager:	Not reported
Facility Manager Phone:	402-271-2219
Facility Rural Box:	Not reported
Facility in Ozone non-attainment area:	Not reported
TCEQ Num:	047396
Owner ID:	04112
Disputed Owner:	Not reported
Date Registration Form Received:	060194
Region Number:	04
Number of USTs:	1
Sign Name on Registration Form:	TONY K LOVE
Title of Signer of Registration Form:	ASST REG DIR REAL ES
Date of Signature on Registration Form:	060194
Owner Effective Begin Date:	060194
Owner ID:	04112
In Care Of:	Not reported
Owner Name:	SOUTHERN PACIFIC TRANSPORTATION COMPANY
Owner Address:	1416 DODGE ST
Owner PO Box:	Not reported
Owner City,St,Zip:	OMAHA, NE 68179
Owner Contact Name:	Steve McNaughton
Contact Telephone:	402-271-2219
Owner Type:	Common Carrier Railroad
Mail Undeliverable:	Not reported
Bankruptcy is in effect:	Not reported
Owner Amendment Reason Code:	Owner Name Changed
Owner Amendment Date:	031803
Number of Facilities reported by Owner:	0087
# Of Underground Storage Tanks:	0178
# Of Aboveground Storage Tanks:	0010
Self-Certification Date:	Not reported
Signature Name:	Not reported
Signature Title Name:	Not reported
Signature Type Text:	Not reported
Certification Submitted Type:	Not reported
Registration Self-Certification Flag:	Not reported
Fees Self-Certification Flag:	Not reported
Financial Assurance Self-Certification flag:	Not reported
Technical standards Self-Certification flag:	Not reported
UST Delivery Certificate Expiration Date:	Not reported
Operator ID:	Not reported
Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN PACIFIC TRANSPORT CO (Continued)

U001962201

Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City,St,Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	1
Unit ID:	00150057
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	08121997
Installation Date:	08311987
Tank Registration Date:	06011994
Capacity:	0000560
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Suction
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN PACIFIC TRANSPORT CO (Continued)

U001962201

Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:

Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:

Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

5
SSW
< 1/8
0.105 mi.
557 ft.

COMET CLEANERS
201 W 6TH AVE
CORSICANA, TX 75110

DRYCLEANERS **S105532694**
N/A

Relative:
Higher

Actual:
425 ft.

DRYCLEANERS:

Fiscal Year: FY2010
PERC Status: Not reported
Owner Name: Not reported
Registration Number: 100712199
Site Type: FACILITY REGISTRATION
Registration Status: ACTIVE
LGL Id: 12809590
Phys Id: 3000517
Site Start Date: 3/25/2009 7:55:38 PM
Site Operation Status: ACTIVE
RN Number: RN100712199
Role Type: BILLING
Aff Begin Date: 9/1/2005
Aff End Date: 12/31/3000
CN Number: CN602924862
AR Number: Not reported
Principal Contact Name: SZT ENTERPRISES LLC
Principal Legal Name: SZT ENTERPRISES, LLC
Principal Name: Not reported
Affil Ad Type: Not reported
Solvent: Not reported
Gallons: Not reported
Part Stat: Not reported
Gross Receipts: Not reported
Mail Delivery Address: Not reported
Mail Delivery Address2: Not reported
Mail Int: Not reported
Mail City/State/Zip: Not reported
Phone: Not reported
EMail: Not reported
Physical Description: 201 W 6th Ave, Corsicana, TX
Physical Near City/State/Zip: CORSICANA, TX 75110

Fiscal Year: FY2010
PERC Status: Not reported
Owner Name: Not reported
Registration Number: 100712199
Site Type: FACILITY REGISTRATION
Registration Status: ACTIVE
LGL Id: 12809590
Phys Id: 3000517
Site Start Date: 3/25/2009 7:55:38 PM
Site Operation Status: ACTIVE
RN Number: RN100712199
Role Type: OWN
Aff Begin Date: 9/1/2005
Aff End Date: 12/31/3000
CN Number: CN602924862
AR Number: Not reported
Principal Contact Name: SZT ENTERPRISES LLC
Principal Legal Name: SZT ENTERPRISES, LLC
Principal Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COMET CLEANERS (Continued)

S105532694

Affil Ad Type:	CUSTMAIL
Solvent:	Not reported
Gallons:	Not reported
Part Stat:	Not reported
Gross Receipts:	Not reported
Mail Delivery Address:	PO BOX 2
Mail Delivery Address2:	Not reported
Mail Int:	Not reported
Mail City/State/Zip:	CORSICANA, TX 75151 0002
Phone:	Not reported
EMail:	Not reported
Physical Description:	201 W 6th Ave, Corsicana, TX
Physical Near City/State/Zip:	CORSICANA, TX 75110
Fiscal Year:	FY2011
PERC Status:	Not reported
Owner Name:	Not reported
Registration Number:	Not reported
Site Type:	FACILITY REGISTRATION
Registration Status:	ACTIVE
LGL Id:	Not reported
Phys Id:	Not reported
Site Start Date:	Not reported
Site Operation Status:	Not reported
RN Number:	RN100712199
Role Type:	Not reported
Aff Begin Date:	Not reported
Aff End Date:	Not reported
CN Number:	CN602924862
AR Number:	24003321
Principal Contact Name:	SZT ENTERPRISES LLC
Principal Legal Name:	Not reported
Principal Name:	Not reported
Affil Ad Type:	Not reported
Solvent:	PETROLEUM
Gallons:	8
Part Stat:	YES
Gross Receipts:	> \$150,000
Mail Delivery Address:	PO BOX 2
Mail Delivery Address2:	Not reported
Mail Int:	Not reported
Mail City/State/Zip:	CORSICANA, TX 75151 0002
Phone:	9038729029
EMail:	CORSICANACOMET@SBCGLOBAL.NET
Physical Description:	Not reported
Physical Near City/State/Zip:	Not reported

B6
WNW
< 1/8
0.116 mi.
612 ft.

CENTRAL LINEN SUPPLY
215 N MAIN ST
CORSICANA, TX 75110
Site 1 of 3 in cluster B

DRYCLEANERS **S103605512**
Ind. Haz Waste **N/A**

Relative:
Higher

DRYCLEANERS:	
Fiscal Year:	FY2011
PERC Status:	Not reported
Owner Name:	Not reported
Registration Number:	Not reported

Actual:
428 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTRAL LINEN SUPPLY (Continued)

S103605512

Site Type:	FACILITY REGISTRATION
Registration Status:	ACTIVE
LGL Id:	Not reported
Phys Id:	Not reported
Site Start Date:	Not reported
Site Operation Status:	Not reported
RN Number:	RN103952560
Role Type:	Not reported
Aff Begin Date:	Not reported
Aff End Date:	Not reported
CN Number:	CN600347645
AR Number:	24005671
Principal Contact Name:	CENTRAL LINEN SUPPLY INC
Principal Legal Name:	Not reported
Principal Name:	Not reported
Affil Ad Type:	Not reported
Solvent:	PETROLEUM
Gallons:	275
Part Stat:	NO
Gross Receipts:	> \$150,000
Mail Delivery Address:	215 N MAIN ST
Mail Delivery Address2:	Not reported
Mail Int:	Not reported
Mail City/State/Zip:	CORSICANA, TX 75110 4619
Phone:	9038744786
EMail:	JIMACKER10@HOTMAIL.COM
Physical Description:	Not reported
Physical Near City/State/Zip:	Not reported
Fiscal Year:	FY2010
PERC Status:	Not reported
Owner Name:	Not reported
Registration Number:	103952560
Site Type:	FACILITY REGISTRATION
Registration Status:	ACTIVE
LGL Id:	12955047
Phys Id:	3001136
Site Start Date:	3/25/2009 7:55:38 PM
Site Operation Status:	ACTIVE
RN Number:	RN103952560
Role Type:	OWN
Aff Begin Date:	9/1/2008
Aff End Date:	12/31/3000
CN Number:	CN600347645
AR Number:	Not reported
Principal Contact Name:	CENTRAL LINEN SUPPLY INC
Principal Legal Name:	Central Linen Supply, Inc.
Principal Name:	Not reported
Affil Ad Type:	CUSTMAIL
Solvent:	Not reported
Gallons:	Not reported
Part Stat:	Not reported
Gross Receipts:	Not reported
Mail Delivery Address:	215 N MAIN ST
Mail Delivery Address2:	Not reported
Mail Int:	Not reported
Mail City/State/Zip:	CORSICANA, TX 75110 4619

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTRAL LINEN SUPPLY (Continued)

S103605512

Phone: Not reported
EMail: Not reported
Physical Description: 215 N Main St, Corsicana, TX
Physical Near City/State/Zip: TX 75110

Fiscal Year: FY2010
PERC Status: Not reported
Owner Name: Not reported
Registration Number: 103952560
Site Type: FACILITY REGISTRATION
Registration Status: ACTIVE
LGL Id: 12955047
Phys Id: 3001136
Site Start Date: 3/25/2009 7:55:38 PM
Site Operation Status: ACTIVE
RN Number: RN103952560
Role Type: BILLING
Aff Begin Date: 9/1/2008
Aff End Date: 12/31/3000
CN Number: CN600347645
AR Number: Not reported
Principal Contact Name: CENTRAL LINEN SUPPLY INC
Principal Legal Name: Central Linen Supply, Inc.
Principal Name: Not reported
Affil Ad Type: Not reported
Solvent: Not reported
Gallons: Not reported
Part Stat: Not reported
Gross Receipts: Not reported
Mail Delivery Address: Not reported
Mail Delivery Address2: Not reported
Mail Int: Not reported
Mail City/State/Zip: Not reported
Phone: Not reported
EMail: Not reported
Physical Description: 215 N Main St, Corsicana, TX
Physical Near City/State/Zip: TX 75110

Ind. Haz Waste:

Transporters Registration Number: 55293
Registration Initial Notification Date: 19850726
Registration Last Amendment Date: 20010727
EPA Identification: TXD026184192
Primary NAICS Code: 999999
Status Change Date: 19970822
Land Type: Not reported
Description of Facility Site Location: 215 N Main St, Corsicana, TX
Site Primary Standard Industrial Code: 99990
Site Primary SIC Description: Nonclassi
Registration is Generator of Waste: Yes
Registration is Receivers of Waste: No
Registration is Transporter of Waste: No
Registration is Transfer Facility: No
Facility is STEERS Reporter: No
Required to Submit Annual Waste Summary: No
Facility Involved In Recycling: No
Revcr Has Monthly Reporting Requirement: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTRAL LINEN SUPPLY (Continued)

S103605512

Mexican Facility: Does not represent a Maquiladora (Mexican Facility)
Facility Status: Inactive
Type of Generator: Non-industrial and/or municipal, CESQG
TNRCC Region: Not reported
Company Name: Central Linen Supply Inc
Contact Name: Jim Acker
Contact Telephone Number: 214-874-4786
Mailing Address: 215 N Main St
Mailing Address2: Not reported
Mailing City,St,Zip: Corsicana, TX 75110 4619
Mailing County: USA
Facility County: Not reported
Facility Country: USA
TNRCC Facility ID: 019256
Site Owner Tax ID: Not reported
Site Location Latitude: Not reported
Site Location Longitude: Not reported
Last Update to NOR Data: 20040114
Ind. waste permit Number: Not reported
Mun waste permit Number: Not reported
Non Notifier: No
Year: 2010

OWNER:

Owner Mailing Address: 215 N Main St
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: Corsicana, TX 75110 4619
Owner Country: USA
Owner Phone Number: 214-874-4786
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Corporation
Owner Tax Id: Not reported
Owner Bankruptcy Code: 0

OWNER:

Owner Mailing Address: 215 N Main St
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: Corsicana, TX 75110 4619
Owner Country: USA
Owner Phone Number: 214-874-4786
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Corporation
Owner Tax Id: Not reported
Owner Bankruptcy Code: 0

OWNER:

Owner Mailing Address: 215 N Main St
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: Corsicana, TX 75110 4619
Owner Country: USA
Owner Phone Number: 214-874-4786
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Corporation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTRAL LINEN SUPPLY (Continued)

S103605512

Owner Tax Id: Not reported
Owner Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Central Linen Supply Inc
Operator First Name: Not reported
Operator Name: Central Linen Supply Inc
Operator Mailing Address: 215 N Main St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75110 4619
Operator Country: USA
Operator Phone: 214-874-4786
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Corporation
Operator Tax Id: Not reported
Operator Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Central Linen Supply Inc
Operator First Name: Not reported
Operator Name: Central Linen Supply Inc
Operator Mailing Address: 215 N Main St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75110 4619
Operator Country: USA
Operator Phone: 214-874-4786
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Corporation
Operator Tax Id: Not reported
Operator Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Central Linen Supply Inc
Operator First Name: Not reported
Operator Name: Central Linen Supply Inc
Operator Mailing Address: 215 N Main St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75110 4619
Operator Country: USA
Operator Phone: 214-874-4786
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Corporation
Operator Tax Id: Not reported
Operator Bankruptcy Code: 0

CONTACT:

Contact Name: Jim Acker
Contact Title: Environmental Manager
Contact Role: Primary Contact
Contact Address: 215 N Main St
Contact Address2: Not reported
Contact City,St,Zip: Corsicana, TX 75110 4619
Contact Phone: 214-874-4786
Contact Fax: Not reported
Contact Email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTRAL LINEN SUPPLY (Continued)

S103605512

CONTACT:

Contact Name: Jim Acker
Contact Title: Environmental Manager
Contact Role: Primary Contact
Contact Address: 215 N Main St
Contact Address2: Not reported
Contact City,St,Zip: Corsicana, TX 75110 4619
Contact Phone: 214-874-4786
Contact Fax: Not reported
Contact Email: Not reported

CONTACT:

Contact Name: Jim Acker
Contact Title: Environmental Manager
Contact Role: Primary Contact
Contact Address: 215 N Main St
Contact Address2: Not reported
Contact City,St,Zip: Corsicana, TX 75110 4619
Contact Phone: 214-874-4786
Contact Fax: Not reported
Contact Email: Not reported
Business Desc: This registration was inactivated because there were only 6-digit waste codes onthe NOR and no waste activity was reported in 1994, 1995 and 1996.This registration was inactivated because there were only 6-digit waste codes onthe NOR and no waste activity was reported in 1994, 1995 and 1996.This registration was inactivated because there were only 6-digit waste codes onthe NOR and no waste activity was reported in 1994, 1995 and 1996.

UNIT:

Deed Record Needed: Not reported
Deed Recording Date: Not reported
Unit No: Not reported
Unit Type Code: Not reported
Unit Type: Not reported
Unit Status: Not reported
Unit Regulatory Status: Not reported
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: Not reported
System Type 1: Not reported
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Not reported
Dt Last Changed: Not reported
Waste Management: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTRAL LINEN SUPPLY (Continued)

S103605512

WasteID:

,

ACTIVITY:

Activity Type Involves: Not reported
Activity Desc: Not reported

OTS:

Site Name: Not reported
One-time Shipper ID: Not reported
Location Desc: Not reported
Location Address: Not reported
Location Address 2: Not reported
Location City: Not reported
Location Zip: Not reported
Broker Name: Not reported
EPA Waste Source Code: Not reported
EPA System Type Code: Not reported
EPA Form: Not reported
EPA Waste No: Not reported
Broker Phone: Not reported
Date Processing Complete: Not reported
Date Request Sent: Not reported
Company Name: Not reported
Waste ID: Not reported
Waste Form: Not reported
Waste Class: Not reported
Waste Origin Code: Not reported
Shipment Request ID: Not reported
Waste Code Audited: Not reported

RCV:

Waste Receipts Summary Form Code: Not reported
State Manifest Documentaion Number: Not reported
Generators TX Registration Number: Not reported
Generators EPA ID: Not reported
Generators Waste Code: Not reported
Generators Waste Classification: Not reported
Generators Waste Form Code: Not reported
Generators Waste Form: Not reported
Quantity Shipped: Not reported
Units: Not reported
How Waste Handled by Receivers: Not reported
Receivers Date: Not reported
Transporters Registration Number: Not reported
Shipment Comment: Not reported
EPA Haz Waste: Not reported
EPA Haz Waste: Not reported
EPA Haz Waste: Not reported
EPA Haz Waste: Not reported
Receiver Name: Not reported
Reporting method: Not reported
No Shipmnts Recvd In Rept Period: Not reported
Record Creation Date: Not reported
Record Contains Error: Not reported
Record ID: Not reported
Co. Submitting Report: Not reported
Authorized Agent Submitting Report: Not reported
Authorized Agent Title: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTRAL LINEN SUPPLY (Continued)

S103605512

WASTE:

Waste ID: 00044104
Waste Desc Yr: 2001
Waste Descriptn: Not reported
Desc of Waste: D001 CHARACTERISTIC OF IGNITABILITYD001 CHARACTERISTIC OF IGNITABILITYD001
CHARACTERISTIC OF IGNITABILITY D001 CHARACTERISTIC OF IGNITABILITYD001
CHARACTERISTIC OF IGNITABILITYD001 CHARACTERISTIC OF IGNITABILITYD001
CHARACTERISTIC OF IGNITABILITYD001 CHARACTERISTIC OF IGNITABILITY
Texas Waste Code: 990001
Texas Waste Code 2: Not reported
Waste Code Status: Inactive
Waste Form Code: Not reported
Waste Form: Not reported
Waste Classification: H
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: Not reported
Primary Origin: Not reported
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: NOR Inactivated
EPA Haz Waste: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional TX IHW: detail in the EDR Site Report.

B7
WNW
< 1/8
0.116 mi.
612 ft.

CENTRAL LINEN SUPPLY INC
215 N MAIN ST
CORSICANA, TX 75110
Site 2 of 3 in cluster B

RCRA-NonGen **1000419050**
FINDS **TXD026184192**

Relative:
Higher

RCRA-NonGen:
Date form received by agency: 07/27/2001
Facility name: CENTRAL LINEN SUPPLY INC
Facility address: 215 N MAIN ST
CORSICANA, TX 75110
EPA ID: TXD026184192
Mailing address: N MAIN ST
CORSICANA, TX 75110
Contact: JIM ACKER
Contact address: N MAIN ST
CORSICANA, TX 75110
Contact country: US
Contact telephone: 214-874-4786
Contact email: Not reported

Actual:
428 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTRAL LINEN SUPPLY INC (Continued)

1000419050

EPA Region: 06
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: CENTRAL LINEN SUPPLY INC
Owner/operator address: N MAIN ST
CORSICANA, TX 75110
Owner/operator country: US
Owner/operator telephone: 214-874-4786
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 07/27/2001
Owner/Op end date: Not reported

Owner/operator name: CENTRAL LINEN SUPPLY INC
Owner/operator address: N MAIN ST
CORSICANA, TX 75110
Owner/operator country: US
Owner/operator telephone: 214-874-4786
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 07/27/2001
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: Not reported
Mixed waste (haz. and radioactive): Not reported
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: Not reported
Underground injection activity: Not reported
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: Not reported
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: Not reported
Used oil transporter: Not reported
Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 08/21/1985
Facility name: CENTRAL LINEN SUPPLY INC
Site name: CENTRAL LINEN SUPPLY
Classification: Small Quantity Generator

Hazardous Waste Summary:

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CENTRAL LINEN SUPPLY INC (Continued)

1000419050

WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Violation Status: No violations found

FINDS:

Registry ID: 110005042006

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

B8
WNW
< 1/8
0.122 mi.
642 ft.

MAIN STREET SALVAGE
222 N MAIN
CORSICANA, TX 75110

LPST **U001289292**
UST **N/A**

Site 3 of 3 in cluster B

Relative:
Higher

LPST:

Actual:
428 ft.

Facility ID: 59762
Facility Location: 222 N MAIN
Region City ID: 4
Region City: ARLINGTON
LPST Id: 101498
Reported Date: 1992-01-09 00:00:00
Entered Date: 1992-02-06 00:00:00
Priority Description: Groundwater is affected.
Status: FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator: RWD
Responsible Party Name: COOPER VICTOR
Responsible Party Contact: VICTOR COOPER
Responsible Party Address: 904 DOBBINS RD
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: /-

UST:

Facility ID: 0059762
Facility Type: Not reported
Name of Facility Manager: VICTOR COOPER
Title of Facility Manager: Not reported
Facility Manager Phone: 9038742257
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 090162
Owner ID: 35103
Disputed Owner: Not reported
Date Registration Form Received: 090991
Region Number: 04
Number of USTs: 2
Sign Name on Registration Form: VICTOR COOPER
Title of Signer of Registration Form: OWNER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAIN STREET SALVAGE (Continued)

U001289292

Date of Signature on Registration Form: 082891
Owner Effective Begin Date: 090991

Owner ID: 35103
In Care Of: Not reported
Owner Name: COOPER VICTOR
Owner Address: 904 DOBBINS RD
Owner PO Box: Not reported
Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: VICTOR COOPER
Contact Telephone: 9038748112
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Name Changed
Owner Amendment Date: 101801
Number of Facilities reported by Owner: 0002
Of Underground Storage Tanks: 0006
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported
Operator Name: Not reported
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: Not reported
Operator City,St,Zip: Not reported
Operator Contact Name: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported

Tank ID: 1
Unit ID: 00140929
Tank Status: Removed from the Ground
Tank Regulatory Status: Fully Regulated
Status Date: 10281991
Installation Date: Not reported
Tank Registration Date: 09091991
Capacity: 0000550
Tank Emptied: Yes
Tank Construction and Containment: Single Wall
Tank Construction and Containment II: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAIN STREET SALVAGE (Continued)

U001289292

Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Suction
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Empty
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAIN STREET SALVAGE (Continued)

U001289292

Tank ID:	2
Unit ID:	00140930
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10281991
Installation Date:	Not reported
Tank Registration Date:	09091991
Capacity:	0000550
Tank Emptied:	Yes
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Suction
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Empty
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAIN STREET SALVAGE (Continued)

U001289292

Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:

Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:

Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

C9
South
1/8-1/4
0.150 mi.
794 ft.

TIGER TOTE 102
200 W 7TH AVE
CORSICANA, TX 75110
Site 1 of 2 in cluster C

LPST **U001276432**
UST **N/A**
FINANCIAL ASSURANCE

Relative:
Lower

LPST:

Actual:
423 ft.

Facility ID:	44722
Facility Location:	200 WEST 7TH AVE
Region City ID:	4
Region City:	ARLINGTON
LPST Id:	105066
Reported Date:	1992-09-30 00:00:00
Entered Date:	1992-12-08 00:00:00
Priority Description:	Not reported
Status:	FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator:	RPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TIGER TOTE 102 (Continued)

U001276432

Responsible Party Name: BILL JOHNSON OIL CO
Responsible Party Contact: TOM JOHNSON
Responsible Party Address: PO BOX 3016
Responsible Party City,St,Zip: CORSICANA, TX 75151
Responsible Party Telephone: 903/872-6621

UST:

Facility ID: 0044722
Facility Type: Retail
Name of Facility Manager: DEBBIE TAYLOR
Title of Facility Manager: MANAGER
Facility Manager Phone: 903-872-1527
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 061672
Owner ID: 12457
Disputed Owner: Not reported
Date Registration Form Received: 033187
Region Number: 04
Number of USTs: 4
Sign Name on Registration Form: BILL JOHNSON
Title of Signer of Registration Form: OWNER
Date of Signature on Registration Form: 032787
Owner Effective Begin Date: 090187

Owner ID: 12457
In Care Of: Not reported
Owner Name: WM G JOHNSON OIL CO
Owner Address: Not reported
Owner PO Box: PO BOX 3016
Owner City,St,Zip: CORSICANA, TX 75151
Owner Contact Name: TOM JOHNSON
Contact Telephone: 903-872-6621
Owner Type: Corporation
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Contact Changed
Owner Amendment Date: 071204
Number of Facilities reported by Owner: 0007
Of Underground Storage Tanks: 0021
Of Aboveground Storage Tanks: 0004

Self-Certification Date: 083110
Signature Name: TOM JOHNSON
Signature Title Name: VP
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 201107

Self-Certification Date: 081408
Signature Name: TOM JOHNSON
Signature Title Name: VP
Signature Type Text: Legally-Authorized Rep of Owner

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TIGER TOTE 102 (Continued)

U001276432

Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200907
Self-Certification Date:	062707
Signature Name:	TOM JOHNSON
Signature Title Name:	VICE PRESIDENT
Signature Type Text:	Legally-Authorized Rep of Owner
Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200807
Self-Certification Date:	072906
Signature Name:	TOM JOHNSON
Signature Title Name:	OPS MGR
Signature Type Text:	Legally-Authorized Rep of Owner
Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200707
Self-Certification Date:	072905
Signature Name:	TOM JOHNSON
Signature Title Name:	MANAGER
Signature Type Text:	Legally-Authorized Rep of Owner
Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200607
Self-Certification Date:	070204
Signature Name:	TOM JOHNSON
Signature Title Name:	Not reported
Signature Type Text:	Legally-Authorized Rep of Owner
Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200507
Self-Certification Date:	063003
Signature Name:	TOM JOHNSON
Signature Title Name:	OPER MGR
Signature Type Text:	Legally-Authorized Rep of Owner
Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TIGER TOTE 102 (Continued)

U001276432

Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200407
Self-Certification Date:	041003
Signature Name:	TOM JOHNSON
Signature Title Name:	OPS MGR
Signature Type Text:	Legally-Authorized Rep of Owner
Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200307
Self-Certification Date:	012101
Signature Name:	TOM JOHNSON
Signature Title Name:	OPS MGR
Signature Type Text:	Legally-Authorized Rep of Owner
Certification Submitted Type:	Initial
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200207
Operator ID:	048960
Operator Effective Date:	090187
Operator Type:	Corporation
Operator First Name:	Not reported
Operator Name:	WM G JOHNSON OIL CO
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	PO BOX 3016
Operator City,St,Zip:	CORSICANA, TX 75151
Operator Contact Name:	TOM JOHNSON
Operator Contact Title:	OPS MGR
Operator Contact Phone:	903-872-6621
Tank ID:	1
Unit ID:	00117181
Tank Status:	In Use
Tank Regulatory Status:	Fully Regulated
Status Date:	Not reported
Installation Date:	01011982
Tank Registration Date:	03311987
Capacity:	0008000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Single Wall
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Single Wall

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TIGER TOTE 102 (Continued)

U001276432

Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Pressurized
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Composite (steel w/external FRP cladding)
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	FRP tank or piping (noncorrodible)
Tank Corrosion Protection II:	Composite Tank (steel w/FRP external laminate)
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	FRP tank or piping (noncorrodible)
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	083110
Compartment:	A
Self-Certification Date:	081408
Compartment:	A
Self-Certification Date:	062707
Compartment:	A
Self-Certification Date:	072906
Compartment:	A
Self-Certification Date:	012101
Compartment:	A
Self-Certification Date:	070204
Compartment:	A
Self-Certification Date:	063003
Compartment:	A
Self-Certification Date:	041003
Compartment:	A
Self-Certification Date:	072905
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection II:	Vapor Monitoring
Tank Release Method Detection III:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TIGER TOTE 102 (Continued)

U001276432

Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Auto. Line Leak Detector (3.0 gph for pressure piping)
Pipe Release Detection Method II:	Annual Piping Tightness Test (@0.1 gph)
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Delivery Shut-off Valve
Spill and Overfill Protection II:	Factory-Built Spill Container/Bucket/Sump
Spill and Overfill Protection III:	1
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00117184
Tank Status:	In Use
Tank Regulatory Status:	Fully Regulated
Status Date:	Not reported
Installation Date:	01011982
Tank Registration Date:	03311987
Capacity:	0006000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Single Wall
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Pressurized
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Composite (steel w/external FRP cladding)
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Composite Tank (steel w/FRP external laminate)
Tank Corrosion Protection II:	FRP tank or piping (noncorrodible)
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	FRP tank or piping (noncorrodible)
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TIGER TOTE 102 (Continued)

U001276432

Self-Certification Date:	083110
Compartment:	A
Self-Certification Date:	081408
Compartment:	A
Self-Certification Date:	062707
Compartment:	A
Self-Certification Date:	072906
Compartment:	A
Self-Certification Date:	012101
Compartment:	A
Self-Certification Date:	070204
Compartment:	A
Self-Certification Date:	063003
Compartment:	A
Self-Certification Date:	041003
Compartment:	A
Self-Certification Date:	072905
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection II:	Vapor Monitoring
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Auto. Line Leak Detector (3.0 gph for pressure piping)
Pipe Release Detection Method II:	Annual Piping Tightness Test (@0.1 gph)
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Delivery Shut-off Valve
Spill and Overfill Protection II:	Factory-Built Spill Container/Bucket/Sump
Spill and Overfill Protection III:	1
Spill Overfill Prevention Variation:	No Variance
Tank ID:	3
Unit ID:	00117183
Tank Status:	In Use
Tank Regulatory Status:	Fully Regulated
Status Date:	Not reported
Installation Date:	01011982
Tank Registration Date:	03311987
Capacity:	0006000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Single Wall
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Single Wall
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Pressurized
Internal Tank Lining Date:	00000000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TIGER TOTE 102 (Continued)

U001276432

Tank Material of Construction:	Composite (steel w/external FRP cladding)
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	FRP tank or piping (noncorrodible)
Tank Corrosion Protection II:	Composite Tank (steel w/FRP external laminate)
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	FRP tank or piping (noncorrodible)
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	083110
Compartment:	A
Self-Certification Date:	081408
Compartment:	A
Self-Certification Date:	062707
Compartment:	A
Self-Certification Date:	072906
Compartment:	A
Self-Certification Date:	012101
Compartment:	A
Self-Certification Date:	070204
Compartment:	A
Self-Certification Date:	063003
Compartment:	A
Self-Certification Date:	041003
Compartment:	A
Self-Certification Date:	072905
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection II:	Vapor Monitoring
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Auto. Line Leak Detector (3.0 gph for pressure piping)
Pipe Release Detection Method II:	Annual Piping Tightness Test (@0.1 gph)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TIGER TOTE 102 (Continued)

U001276432

Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Delivery Shut-off Valve
Spill and Overfill Protection II:	Factory-Built Spill Container/Bucket/Sump
Spill and Overfill Protection III:	1
Spill Overfill Prevention Variation:	No Variance
Tank ID:	4
Unit ID:	00117182
Tank Status:	In Use
Tank Regulatory Status:	Fully Regulated
Status Date:	Not reported
Installation Date:	01011982
Tank Registration Date:	03311987
Capacity:	0006000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Single Wall
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Single Wall
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Pressurized
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Composite (steel w/external FRP cladding)
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	FRP tank or piping (noncorrodible)
Tank Corrosion Protection II:	Composite Tank (steel w/FRP external laminate)
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	FRP tank or piping (noncorrodible)
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	083110
Compartment:	A
Self-Certification Date:	081408

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TIGER TOTE 102 (Continued)

U001276432

Compartment:	A
Self-Certification Date:	062707
Compartment:	A
Self-Certification Date:	072906
Compartment:	A
Self-Certification Date:	012101
Compartment:	A
Self-Certification Date:	070204
Compartment:	A
Self-Certification Date:	063003
Compartment:	A
Self-Certification Date:	041003
Compartment:	A
Self-Certification Date:	072905
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Diesel
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection II:	Vapor Monitoring
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Auto. Line Leak Detector (3.0 gph for pressure piping)
Pipe Release Detection Method II:	Annual Piping Tightness Test (@0.1 gph)
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Delivery Shut-off Valve
Spill and Overfill Protection II:	Factory-Built Spill Container/Bucket/Sump
Spill and Overfill Protection III:	1
Spill Overfill Prevention Variation:	No Variance
Operator History:	
Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported
Owner History:	
Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TIGER TOTE 102 (Continued)

U001276432

Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

10
WSW
1/8-1/4
0.157 mi.
828 ft.

BNK24 INTERFIRST BANK CORSICANA
301 W COLLIN ST
CORSICANA, TX

LPST **U001293715**
UST **N/A**

Relative:
Higher

LPST:

Actual:
427 ft.

Facility ID: 56030
Facility Location: 301 W COLLIN
Region City ID: 4
Region City: ARLINGTON
LPST Id: 97348
Reported Date: 1990-11-26 00:00:00
Entered Date: 1990-11-29 00:00:00
Priority Description: Groundwater is affected.
Status: FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator: RD2
Responsible Party Name: KASTER MICHAEL
Responsible Party Contact: MICHAEL KASTER
Responsible Party Address: 114 WEST COLLIN
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: 903/872-5728

UST:

Facility ID: 0056030
Facility Type: Other
Name of Facility Manager: LESTER ATKINS
Title of Facility Manager: Not reported
Facility Manager Phone: 2148747551
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 095279
Owner ID: 40042
Disputed Owner: Not reported
Date Registration Form Received: 100290
Region Number: 04
Number of USTs: 5
Sign Name on Registration Form: JEFF MCLAUGHLIN
Title of Signer of Registration Form: ENV REVIEW ANALYST
Date of Signature on Registration Form: 092790
Owner Effective Begin Date: 090187

Owner ID: 40042
In Care Of: Not reported
Owner Name: FDIC LIQ INTERFIRST BANK
Owner Address: 1201 MAIN ST
Owner PO Box: Not reported
Owner City,St,Zip: DALLAS, TX 75202
Owner Contact Name: WOODY OGLESBY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BNK24 INTERFIRST BANK CORSICANA (Continued)

U001293715

Contact Telephone: 2145084748
Owner Type: Federal Government
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Billing Address Changed
Owner Amendment Date: 083006
Number of Facilities reported by Owner: 0005
Of Underground Storage Tanks: 0018
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported
Operator Name: Not reported
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: Not reported
Operator City,St,Zip: Not reported
Operator Contact Name: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported

Tank ID: 1
Unit ID: 00135851
Tank Status: Removed from the Ground
Tank Regulatory Status: Fully Regulated
Status Date: 07021991
Installation Date: 01011931
Tank Registration Date: 10021990
Capacity: 0001000
Tank Emptied: No
Tank Construction and Containment: Not reported
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Not reported
Pipe Construction and Containment II: Not reported
Piping Design and Ext. Containment 3: Not reported
Piping Design and Ext. Containment 4: Not reported
Type of Piping: Not reported
Internal Tank Lining Date: 00000000
Tank Material of Construction: Steel
Other Materials of Construction: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BNK24 INTERFIRST BANK CORSICANA (Continued)

U001293715

Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00135850
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07021991
Installation Date:	01011931
Tank Registration Date:	10021990
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BNK24 INTERFIRST BANK CORSICANA (Continued)

U001293715

Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BNK24 INTERFIRST BANK CORSICANA (Continued)

U001293715

Tank ID:	3
Unit ID:	00135849
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07021991
Installation Date:	01011931
Tank Registration Date:	10021990
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BNK24 INTERFIRST BANK CORSICANA (Continued)

U001293715

Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	4
Unit ID:	00135848
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07021991
Installation Date:	01011931
Tank Registration Date:	10021990
Capacity:	0000500
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BNK24 INTERFIRST BANK CORSICANA (Continued)

U001293715

Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	5
Unit ID:	00135847
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07021991
Installation Date:	01011931
Tank Registration Date:	10021990
Capacity:	0000500
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BNK24 INTERFIRST BANK CORSICANA (Continued)

U001293715

Pipe Corrosion Protection Variance: No Variance
Stage 1 Vapor Recovery Equipment Status: Not Reported
Stage 1 Equipment Installed Date: Not reported
Stage 2 Vapor Recry Equipment Status: Not Reported
Stage 2 Equipment Installed Date: Not reported
Equipment Installer: Not reported
Contractor Registration Number: Not reported
Tank Tested: Not reported
Installer License Number: Not reported
Tank Installer: Not reported

Self-Certification Date: Not reported
Compartment: Not reported

Compartment Letter: A
Compartment Capacity: 0000000
Compartment Substance Stored: Used Oil
Compartment Other Substance: Not reported
Tank Release Method Detection I: Not reported
Tank Release Method Detection II: Not reported
Tank Release Method Detection III: Not reported
Other Tank Release Method Detection: Not reported
Tank Release Detection Variance: No Variance
Pipe Release Detection Method: Not reported
Pipe Release Detection Method II: Not reported
Pipe Release Detection Method III: Not reported
Other Pipe Release Detection Method: None
Pipe Release Detection Variance: No Variance
Spill and Overfill Protection: Not reported
Spill and Overfill Protection II: Not reported
Spill and Overfill Protection III: Not reported
Spill Overfill Prevention Variation: No Variance

Operator History:
Operator ID: Not reported
Operator Name or Business Name: Not reported
Operator Effective Begin Date: Not reported
Operator Effective End Date: Not reported
Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:
Facility ID: 095279
Facility Number: 0056030
Customer Number: 30458
Individual Name or Business Name: FEDERAL DEPOSIT INSURANCE COMPANY
Owner Effective Begin Date: 083187
Owner Effective End Date: 083187
Owner Address: 1201 MAIN ST
Owner Building: 4th Floor
Owner PO Box: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BNK24 INTERFIRST BANK CORSICANA (Continued)

U001293715

Owner City: DALLAS
Owner State: TX
Owner Zip: 75202
Owner Zip extension: Not reported

C11
South
1/8-1/4
0.160 mi.
843 ft.

ABANDONED GAS STATION
222 W 7TH AVE
CORSICANA, TX 75110

UST **U003886435**
N/A

Site 2 of 2 in cluster C

Relative:
Equal

UST:

Actual:
424 ft.

Facility ID: 0075458
Facility Type: Not reported
Name of Facility Manager: HERBERT SILVERBERG
Title of Facility Manager: TRUSTEE
Facility Manager Phone: 254-399-8837
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 115592
Owner ID: 60199
Disputed Owner: Not reported
Date Registration Form Received: 102102
Region Number: 04
Number of USTs: 1
Sign Name on Registration Form: HERBERT L SILVERBERG
Title of Signer of Registration Form: TRUSTEE
Date of Signature on Registration Form: 101002
Owner Effective Begin Date: 083187

Owner ID: 60199
In Care Of: Not reported
Owner Name: HLS FAMILY TRUST AND MBS FAMILY TRUST
Owner Address: 4310 GREEN OAK DR
Owner PO Box: Not reported
Owner City,St,Zip: WACO, TX 76710
Owner Contact Name: HERBERT L SILVERBERG
Contact Telephone: 254-399-8837
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Account added
Owner Amendment Date: 102402
Number of Facilities reported by Owner: 0001
Of Underground Storage Tanks: 0001
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ABANDONED GAS STATION (Continued)

U003886435

Operator ID:	Not reported
Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City, St, Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	1
Unit ID:	00200722
Tank Status:	Permanently Filled In-Place
Tank Regulatory Status:	Exempt Non-use since 1974
Status Date:	12221999
Installation Date:	08311987
Tank Registration Date:	10212002
Capacity:	0000600
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ABANDONED GAS STATION (Continued)

U003886435

Installer License Number: Not reported
Tank Installer: Not reported

Self-Certification Date: Not reported
Compartment: Not reported

Compartment Letter: A
Compartment Capacity: 0000000
Compartment Substance Stored: Not reported
Compartment Other Substance: Unknown
Tank Release Method Detection I: Not reported
Tank Release Method Detection II: Not reported
Tank Release Method Detection III: Not reported
Other Tank Release Method Detection: Not reported
Tank Release Detection Variance: No Variance
Pipe Release Detection Method: Not reported
Pipe Release Detection Method II: Not reported
Pipe Release Detection Method III: Not reported
Other Pipe Release Detection Method: Not reported
Pipe Release Detection Variance: No Variance
Spill and Overfill Protection: Not reported
Spill and Overfill Protection II: Not reported
Spill and Overfill Protection III: Not reported
Spill Overfill Prevention Variation: No Variance

Operator History:
Operator ID: Not reported
Operator Name or Business Name: Not reported
Operator Effective Begin Date: Not reported
Operator Effective End Date: Not reported
Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:
Facility ID: Not reported
Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

D12
WNW
1/8-1/4
0.168 mi.
885 ft.

T & CO STYLING SALON
300 N MAIN ST
CORSICANA, TX 75110

Site 1 of 2 in cluster D

UST **U003371398**
N/A

Relative:
Higher

UST:

Actual:
430 ft.

Facility ID:	0070786
Facility Type:	Retail
Name of Facility Manager:	WD Wyatt
Title of Facility Manager:	Owner
Facility Manager Phone:	903-874-3088
Facility Rural Box:	Not reported
Facility in Ozone non-attainment area:	Not reported
TCEQ Num:	107710
Owner ID:	51975
Disputed Owner:	Not reported
Date Registration Form Received:	070198
Region Number:	04
Number of USTs:	4
Sign Name on Registration Form:	W D Wyatt
Title of Signer of Registration Form:	Owner
Date of Signature on Registration Form:	062998
Owner Effective Begin Date:	083187
Owner ID:	51975
In Care Of:	Not reported
Owner Name:	WYATT W D
Owner Address:	1444 OAKLAWN Dr
Owner PO Box:	Not reported
Owner City,St,Zip:	CORSICANA, TX 75110
Owner Contact Name:	WD Wyatt
Contact Telephone:	903-874-3088
Owner Type:	Private or Corporate
Mail Undeliverable:	Not reported
Bankruptcy is in effect:	Not reported
Owner Amendment Reason Code:	Owner Contact Changed
Owner Amendment Date:	021607
Number of Facilities reported by Owner:	0001
# Of Underground Storage Tanks:	0004
# Of Aboveground Storage Tanks:	0000
Self-Certification Date:	Not reported
Signature Name:	Not reported
Signature Title Name:	Not reported
Signature Type Text:	Not reported
Certification Submitted Type:	Not reported
Registration Self-Certification Flag:	Not reported
Fees Self-Certification Flag:	Not reported
Financial Assurance Self-Certification flag:	Not reported
Technical standards Self-Certification flag:	Not reported
UST Delivery Certificate Expiration Date:	Not reported
Operator ID:	Not reported
Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & CO STYLING SALON (Continued)

U003371398

Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City,St,Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	3
Unit ID:	00186935
Tank Status:	Permanently Filled In-Place
Tank Regulatory Status:	Exempt Non-use since 1974
Status Date:	06091998
Installation Date:	08311987
Tank Registration Date:	07011998
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & CO STYLING SALON (Continued)

U003371398

Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	4
Unit ID:	00186936
Tank Status:	Permanently Filled In-Place
Tank Regulatory Status:	Exempt Non-use since 1974
Status Date:	06091998
Installation Date:	08311987
Tank Registration Date:	07011998
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & CO STYLING SALON (Continued)

U003371398

Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	1
Unit ID:	00186933
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Exempt Non-use since 1974
Status Date:	06091998
Installation Date:	08311987
Tank Registration Date:	07011998
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & CO STYLING SALON (Continued)

U003371398

Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported

Self-Certification Date:	Not reported
Compartment:	Not reported

Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Tank ID:	2
Unit ID:	00186934
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Exempt Non-use since 1974
Status Date:	06091998
Installation Date:	08311987
Tank Registration Date:	07011998
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & CO STYLING SALON (Continued)

U003371398

Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Operator History:	
Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

T & CO STYLING SALON (Continued)

U003371398

Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:

Facility ID: Not reported
Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

E13
West
1/8-1/4
0.173 mi.
913 ft.

CITY OF CORSICANA LANDFILL
200 N 12TH ST
CORSICANA, TX 75110
Site 1 of 3 in cluster E

SWF/LF S105243627
N/A

Relative:
Higher

SWF/LF:

Actual:
430 ft.

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 238.703
Permit Start: 2/21/2008
Permit End: 3/29/2010
Pollution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: NOTICE MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA LANDFILL (Continued)

S105243627

Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 21.48
Permit Start: 9/1/2005
Permit End: 10/31/2005
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 21.48
Permit Start: 6/29/2005
Permit End: 8/29/2005
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 21.48
Permit Start: 9/30/2010
Permit End: 11/17/2010
Polution Served: 120000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA LANDFILL (Continued)

S105243627

Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 238.703
Permit Start: 6/29/2005
Permit End: 8/29/2005
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 238.703
Permit Start: 9/30/2010
Permit End: 11/17/2010
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA LANDFILL (Continued)

S105243627

Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 238.703
Permit Start: 3/3/2008
Permit End: 3/29/2010
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 238.703
Permit Start: 8/28/1992
Permit End: 6/23/1993
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: NEW APPLICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 21.48
Permit Start: 6/30/2009
Permit End: 8/25/2009
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA LANDFILL (Continued)

S105243627

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 21.48
Permit Start: 2/21/2008
Permit End: 3/29/2010
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: NOTICE MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 21.48
Permit Start: 3/3/2008
Permit End: 3/29/2010
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA LANDFILL (Continued)

S105243627

Permit Acreage: 238.703
Permit Start: 9/26/2006
Permit End: 11/3/2009
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 21.48
Permit Start: 3/16/2006
Permit End: 5/15/2006
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 21.48
Permit Start: 8/28/1992
Permit End: 6/23/1993
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: NEW APPLICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA LANDFILL (Continued)

S105243627

Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 238.703
Permit Start: 11/3/2008
Permit End: 12/18/2008
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 21.48
Permit Start: 9/26/2006
Permit End: 11/3/2009
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 238.703
Permit Start: 10/27/2006
Permit End: 7/9/2007
Polution Served: 120000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA LANDFILL (Continued)

S105243627

Tons per Day: 300
Yards per Day: 1
Application: NOTICE MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 21.48
Permit Start: 10/27/2006
Permit End: 7/9/2007
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: NOTICE MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 238.703
Permit Start: 9/1/2005
Permit End: 10/31/2005
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA LANDFILL (Continued)

S105243627

Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 21.48
Permit Start: 11/3/2008
Permit End: 12/18/2008
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 238.703
Permit Start: 6/30/2009
Permit End: 8/25/2009
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 2190
Facility Status: ACTIVE
Facility Type: 1
Permit Status: ISSUED
Status Date: 1/21/1999
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: Not reported
Estimated Closure Date: 1/1/1901
Permit Acreage: 238.703
Permit Start: 3/16/2006
Permit End: 5/15/2006
Polution Served: 120000
Tons per Day: 300
Yards per Day: 1
Application: MODIFICATION
Lat/Long: 32.090330000000002 / -96.4250000000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA LANDFILL (Continued)

S105243627

Region: 4
Permit Number: 350
Facility Status: CLOSED
Facility Type: 1
Permit Status: SUPERSEDED
Status Date: 8/18/1997
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: CORSICANA
Estimated Closure Date: 12/1/1983
Permit Acreage: 20
Permit Start: Not reported
Permit End: Not reported
Pollution Served: 25000
Tons per Day: 67
Yards per Day: Not reported
Application: Not reported
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 350
Facility Status: CLOSED
Facility Type: 1
Permit Status: SUPERSEDED
Status Date: 8/18/1997
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: CORSICANA
Estimated Closure Date: 12/1/1983
Permit Acreage: 50.68
Permit Start: Not reported
Permit End: Not reported
Pollution Served: 25000
Tons per Day: 67
Yards per Day: Not reported
Application: Not reported
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 350A
Facility Status: CLOSED
Facility Type: 1
Permit Status: SUPERSEDED
Status Date: 8/18/1997
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: CORSICANA
Estimated Closure Date: 12/1/1983

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA LANDFILL (Continued)

S105243627

Permit Acreage: 20
Permit Start: Not reported
Permit End: Not reported
Pollution Served: 25000
Tons per Day: 67
Yards per Day: Not reported
Application: Not reported
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 350A
Facility Status: CLOSED
Facility Type: 1
Permit Status: SUPERSEDED
Status Date: 8/18/1997
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: CORSICANA
Estimated Closure Date: 12/1/1983
Permit Acreage: 50.68
Permit Start: Not reported
Permit End: Not reported
Pollution Served: 25000
Tons per Day: 67
Yards per Day: Not reported
Application: Not reported
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 350B
Facility Status: CLOSED
Facility Type: 1
Permit Status: REVOKED
Status Date: 8/18/1997
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: CORSICANA
Estimated Closure Date: 12/1/1983
Permit Acreage: 50.68
Permit Start: Not reported
Permit End: Not reported
Pollution Served: 25000
Tons per Day: 67
Yards per Day: Not reported
Application: Not reported
Lat/Long: 32.090330000000002 / -96.4250000000

Region: 4
Permit Number: 350B
Facility Status: CLOSED
Facility Type: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA LANDFILL (Continued)

S105243627

Permit Status: REVOKED
Status Date: 8/18/1997
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: CORSICANA
Estimated Closure Date: 12/1/1983
Permit Acreage: 20
Permit Start: Not reported
Permit End: Not reported
Polution Served: 25000
Tons per Day: 67
Yards per Day: Not reported
Application: Not reported
Lat/Long: 32.090330000000002 / -96.4250000000

E14
West
1/8-1/4
0.173 mi.
913 ft.

CITY OF CORSICANA LANDFILL
200 N 12TH ST
CORSICANA, TX 75110

SWF/LF S106169354
N/A

Site 2 of 3 in cluster E

Relative:
Higher

SWF/LF:

Actual:
430 ft.

Region: 4
Permit Number: 425
Facility Status: CLOSED
Facility Type: 1
Permit Status: ISSUED
Status Date: 11/8/1977
Mailing Address: Not reported
Client Name: Not reported
Client Address: Not reported
Client Telephone: N/A
Business Type: CITY
Area Served: CORSICANA
Estimated Closure Date: 3/1/1976
Permit Acreage: 55
Permit Start: Not reported
Permit End: Not reported
Polution Served: 25000
Tons per Day: 81
Yards per Day: Not reported
Application: Not reported
Lat/Long: 32.090330000000002 / -96.4250000000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

E15
West
1/8-1/4
0.173 mi.
913 ft.
CITY OF CORSICANA LANDFILL
200 N 12TH ST
CORSICANA, TX 75110
Site 3 of 3 in cluster E

SWF/LF
S108424958
N/A

Relative:
Higher

SWF/LF:

Region: 4
Permit Number: 1353
Facility Status: CLOSED
Facility Type: 4
Permit Status: ISSUED
Status Date: 1/9/1980
Mailing Address: Not reported
Client Name: CN600334494, City of Corsicana
Client Address: PO BOX 626 CORSICANA, TX 75151-0626
Client Telephone: (214) 872 - 0028
Business Type: 03
Area Served: CORSICANA AREA
Estimated Closure Date: 1/1/1995
Permit Acreage: 7.77
Permit Start: Not reported
Permit End: Not reported
Pollution Served: 25000
Tons per Day: 25
Yards per Day: 25
Application: Not reported
Lat/Long: 32.090330000000002 / -96.4250000000

D16
WNW
1/8-1/4
0.173 mi.
914 ft.
JIM HOWARDS PAINT & BODY SHOP
311 N MAIN
CORSICANA, TX 75110
Site 2 of 2 in cluster D

RCRA-NonGen
FINDS
1000118260
TXD093509420

Relative:
Higher

RCRA-NonGen:

Date form received by agency: 08/23/2001
Facility name: JIM HOWARDS PAINT & BODY SHOP
Facility address: 311 N MAIN
CORSICANA, TX 75110
EPA ID: TXD093509420
Mailing address: PO BOX 13
CORSICANA, TX 75110
Contact: JIM HOWARD
Contact address: PO BOX 13
CORSICANA, TX 75110
Contact country: US
Contact telephone: 214-872-5212
Contact email: Not reported
EPA Region: 06
Land type: Private
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: JIM HOWARDS PAINT & BODY SHOP
Owner/operator address: PO BOX 13
CORSICANA, TX 75110
Owner/operator country: US

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JIM HOWARDS PAINT & BODY SHOP (Continued)

1000118260

Owner/operator telephone: 214-872-5212
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 08/23/2001
Owner/Op end date: Not reported

Owner/operator name: JIM HOWARDS PAINT & BODY SHOP
Owner/operator address: PO BOX 13
CORNICANA, TX 75110

Owner/operator country: US
Owner/operator telephone: 214-872-5212
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 08/23/2001
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: Not reported
Mixed waste (haz. and radioactive): Not reported
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: Not reported
Underground injection activity: Not reported
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: Not reported
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: Not reported
Used oil transporter: Not reported
Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 02/04/1986
Facility name: JIM HOWARDS PAINT & BODY SHOP
Site name: JIM HOWARDS PAINT BODY SHOP
Classification: Small Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: SR - 335.9A2/3
Area of violation: State Statute or Regulation
Date violation determined: 07/25/1991
Date achieved compliance: 08/23/1991
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 07/25/1991
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JIM HOWARDS PAINT & BODY SHOP (Continued)

1000118260

Evaluation Action Summary:

Evaluation date: 07/25/1991
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: State Statute or Regulation
Date achieved compliance: 08/23/1991
Evaluation lead agency: State

FINDS:

Registry ID: 110005066855

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

17
East
1/8-1/4
0.183 mi.
968 ft.

TARRANT 47
409 E 7TH
CORSICANA, TX 75110

UST
FINANCIAL ASSURANCE

U001271651
N/A

Relative:
Lower

UST:

Actual:
418 ft.

Facility ID: 0039083
Facility Type: Not reported
Name of Facility Manager: JOE TARRANT
Title of Facility Manager: OWNER
Facility Manager Phone: 2146753616
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 069938
Owner ID: 18163
Disputed Owner: Not reported
Date Registration Form Received: 050886
Region Number: 04
Number of USTs: 3
Sign Name on Registration Form: JOE TARRANT
Title of Signer of Registration Form: OWNER
Date of Signature on Registration Form: 050686
Owner Effective Begin Date: 090188

Owner ID: 18163
In Care Of: JOE TARRANT
Owner Name: JOE G TARRANT OIL COMPANY
Owner Address: 10453 CR 4530
Owner PO Box: Not reported
Owner City,St,Zip: LARUE, TX 75770
Owner Contact Name: BOB SARLAY
Contact Telephone: 903-939-9311
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Yes
Owner Amendment Reason Code: Owner Name Changed
Owner Amendment Date: 052709

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TARRANT 47 (Continued)

U001271651

Number of Facilities reported by Owner: 0009
Of Underground Storage Tanks: 0030
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported
Operator Name: Not reported
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: Not reported
Operator City,St,Zip: Not reported
Operator Contact Name: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported

Tank ID: 1
Unit ID: 00103248
Tank Status: **Temporarily Out of Use**
Tank Regulatory Status: Fully Regulated
Status Date: 12011998
Installation Date: 01011979
Tank Registration Date: 05081986
Capacity: 0010000
Tank Emptied: No
Tank Construction and Containment: Not reported
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Not reported
Pipe Construction and Containment II: Not reported
Piping Design and Ext. Containment 3: Not reported
Piping Design and Ext. Containment 4: Not reported
Type of Piping: Not reported
Internal Tank Lining Date: 00000000
Tank Material of Construction: Steel
Other Materials of Construction: Not reported
Pipe Material of Construction: Steel
Other Construction and Containment: Not reported
Pipe Connectors and Valves 1: Not reported
Pipe Connectors and Valves 2: Not reported
Pipe Connectors and Valves 3: Not reported
Tank Corrosion Protection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TARRANT 47 (Continued)

U001271651

Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported

Self-Certification Date:	Not reported
Compartment:	Not reported

Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Tank ID:	2
Unit ID:	00103247
Tank Status:	Temporarily Out of Use
Tank Regulatory Status:	Fully Regulated
Status Date:	12011998
Installation Date:	01011979
Tank Registration Date:	05081986
Capacity:	0010000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TARRANT 47 (Continued)

U001271651

Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	3
Unit ID:	00103249
Tank Status:	Temporarily Out of Use
Tank Regulatory Status:	Fully Regulated
Status Date:	12011998

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TARRANT 47 (Continued)

U001271651

Installation Date:	01011979
Tank Registration Date:	05081986
Capacity:	0010000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TARRANT 47 (Continued)

U001271651

Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:

Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:

Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

F18
SSW
1/8-1/4
0.200 mi.
1058 ft.

CORSICANA SERVICE CENTER
301 S 12TH ST
CORSICANA, TX 75110

Site 1 of 4 in cluster F

UST
Ind. Haz Waste
FINANCIAL ASSURANCE

U001271739
N/A

Relative:
Equal

UST:

Actual:
424 ft.

Facility ID:	0039179
Facility Type:	Fleet Refueling
Name of Facility Manager:	DEBORAH A BOYLE
Title of Facility Manager:	DIRECTOR EHST
Facility Manager Phone:	214-486-2022
Facility Rural Box:	Not reported
Facility in Ozone non-attainment area:	Not reported
TCEQ Num:	092540
Owner ID:	60333
Disputed Owner:	Not reported
Date Registration Form Received:	050886
Region Number:	04
Number of USTs:	3
Sign Name on Registration Form:	DANA R CRISSEY
Title of Signer of Registration Form:	SUP ENG & DRAFTING

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Date of Signature on Registration Form: 050586
Owner Effective Begin Date: 070107

Owner ID: 60333
In Care Of: DEBORAH A BOYLE
Owner Name: ONCOR ELECTRIC DELIVERY COMPANY LLC
Owner Address: Not reported
Owner PO Box: PO BOX 132280
Owner City,St,Zip: DALLAS, TX 75313
Owner Contact Name: DEBORAH A BOYLE
Contact Telephone: 214-486-2022
Owner Type: Corporation
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Name Changed
Owner Amendment Date: 071708
Number of Facilities reported by Owner: 0032
Of Underground Storage Tanks: 0127
Of Aboveground Storage Tanks: 0006

Self-Certification Date: 120309
Signature Name: DEBORAH A BOYLE
Signature Title Name: DIR EHST
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 201103

Self-Certification Date: 121008
Signature Name: DEBORAH A BOYLE
Signature Title Name: DIR OF EHST
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 201003

Self-Certification Date: 120107
Signature Name: DEBORAH A BOYLE
Signature Title Name: DIR EHST
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200903

Self-Certification Date: 113007
Signature Name: DEBORAH A BOYLE
Signature Title Name: DIR EHST
Signature Type Text: Legally-Authorized Rep of Owner

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200803

Self-Certification Date: 120803
Signature Name: JIM OKELLY
Signature Title Name: DIR ENV SAFETY
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200503

Self-Certification Date: 103102
Signature Name: DEBORAH A BOYLE
Signature Title Name: ONCOR EHS MGR
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200403

Self-Certification Date: 103002
Signature Name: DEBORAH A BOYLE
Signature Title Name: ONCOR EHS MGR
Signature Type Text: Owner
Certification Submitted Type: Initial
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200303

Operator ID: 127373
Operator Effective Date: 070107
Operator Type: Corporation
Operator First Name: Not reported
Operator Name: ONCOR ELECTRIC DELIVERY COMPANY LLC
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: PO BOX 132280
Operator City,St,Zip: DALLAS, TX 75313 2280
Operator Contact Name: DEBORAH BOYLE
Operator Contact Title: DIR ESIH
Operator Contact Phone: 214-486-2022

Tank ID: 1
Unit ID: 00103515

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Tank Status:	In Use
Tank Regulatory Status:	Fully Regulated
Status Date:	Not reported
Installation Date:	02011994
Tank Registration Date:	05081986
Capacity:	0004000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Double Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Pressurized
Internal Tank Lining Date:	00000000
Tank Material of Construction:	FRP (fiberglass-reinforced plastic
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	3
Pipe Connectors and Valves 2:	1
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	FRP tank or piping (noncorrodible)
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	FRP tank or piping (noncorrodible)
Pipe Corrosion Protection II:	Nonmetallic flexible piping
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Two-Point system or Coaxial system type
Stage 1 Equipment Installed Date:	02011994
Stage 2 Vapor Recry Equipment Status:	Balance system or Assist system type
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	120309
Compartment:	A
Self-Certification Date:	121008
Compartment:	A
Self-Certification Date:	120107
Compartment:	A
Self-Certification Date:	113007
Compartment:	A
Self-Certification Date:	112706
Compartment:	A
Self-Certification Date:	111405
Compartment:	A
Self-Certification Date:	011701

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Compartment:	A
Self-Certification Date:	112204
Compartment:	A
Self-Certification Date:	120803
Compartment:	A
Self-Certification Date:	103102
Compartment:	A
Self-Certification Date:	103002
Compartment:	A
Self-Certification Date:	102902
Compartment:	A
Self-Certification Date:	121201
Compartment:	A
Self-Certification Date:	112304
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Interstitial Monitoring within Secondary Wall/Jacket
Pipe Release Detection Method II:	Auto. Line Leak Detector (3.0 gph for pressure piping)
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Flow Restrictor Valve
Spill and Overfill Protection II:	Auto. High Level Alarm with 3 or 4
Spill and Overfill Protection III:	2
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00103516
Tank Status:	In Use
Tank Regulatory Status:	Fully Regulated
Status Date:	Not reported
Installation Date:	02011994
Tank Registration Date:	05081986
Capacity:	0006000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Double Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Pressurized
Internal Tank Lining Date:	00000000
Tank Material of Construction:	FRP (fiberglass-reinforced plastic
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	3
Pipe Connectors and Valves 2:	1
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	FRP tank or piping (noncorrodible)
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Nonmetallic flexible piping
Pipe Corrosion Protection II:	FRP tank or piping (noncorrodible)
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	120309
Compartment:	A
Self-Certification Date:	121008
Compartment:	A
Self-Certification Date:	120107
Compartment:	A
Self-Certification Date:	113007
Compartment:	A
Self-Certification Date:	112706
Compartment:	A
Self-Certification Date:	111405
Compartment:	A
Self-Certification Date:	011701
Compartment:	A
Self-Certification Date:	112204
Compartment:	A
Self-Certification Date:	120803
Compartment:	A
Self-Certification Date:	103102
Compartment:	A
Self-Certification Date:	103002
Compartment:	A
Self-Certification Date:	102902
Compartment:	A
Self-Certification Date:	121201
Compartment:	A
Self-Certification Date:	112304
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Diesel
Compartment Other Substance:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Tank Release Method Detection I:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Interstitial Monitoring within Secondary Wall/Jacket
Pipe Release Detection Method II:	Auto. Line Leak Detector (3.0 gph for pressure piping)
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Flow Restrictor Valve
Spill and Overfill Protection II:	Auto. High Level Alarm with 3 or 4
Spill and Overfill Protection III:	2
Spill Overfill Prevention Variation:	No Variance
Tank ID:	1
Unit ID:	00103514
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	12301993
Installation Date:	01011979
Tank Registration Date:	05081986
Capacity:	0004000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	FRP (fiberglass-reinforced plastic
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Tank Tested: Not reported
Installer License Number: Not reported
Tank Installer: Not reported

Self-Certification Date: 120309
Compartment: A
Self-Certification Date: 121008
Compartment: A
Self-Certification Date: 120107
Compartment: A
Self-Certification Date: 113007
Compartment: A
Self-Certification Date: 112706
Compartment: A
Self-Certification Date: 111405
Compartment: A
Self-Certification Date: 011701
Compartment: A
Self-Certification Date: 112204
Compartment: A
Self-Certification Date: 120803
Compartment: A
Self-Certification Date: 103102
Compartment: A
Self-Certification Date: 103002
Compartment: A
Self-Certification Date: 102902
Compartment: A
Self-Certification Date: 121201
Compartment: A
Self-Certification Date: 112304
Compartment: A

Compartment Letter: A
Compartment Capacity: 0000000
Compartment Substance Stored: Gasoline
Compartment Other Substance: Not reported
Tank Release Method Detection I: Not reported
Tank Release Method Detection II: Not reported
Tank Release Method Detection III: Not reported
Other Tank Release Method Detection: Not reported
Tank Release Detection Variance: No Variance
Pipe Release Detection Method: Not reported
Pipe Release Detection Method II: Not reported
Pipe Release Detection Method III: Not reported
Other Pipe Release Detection Method: None
Pipe Release Detection Variance: No Variance
Spill and Overfill Protection: Not reported
Spill and Overfill Protection II: Not reported
Spill and Overfill Protection III: Not reported
Spill Overfill Prevention Variation: No Variance

Operator History:
Operator ID: 98745
Operator Name or Business Name: TXU ELECTRIC DELIVERY COMPANY
Operator Effective Begin Date: 061999
Operator Effective End Date: 111302

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Operator Address: 500 N AKARD
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: DALLAS
Operator State: TX
Operator Zip: 75201
Operator Zip extension: Not reported

Operator ID: 98745
Operator Name or Business Name: TXU ELECTRIC DELIVERY COMPANY
Operator Effective Begin Date: 112904
Operator Effective End Date: 070107
Operator Address: 500 N AKARD
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: DALLAS
Operator State: TX
Operator Zip: 75201
Operator Zip extension: Not reported

Operator ID: 127373
Operator Name or Business Name: ONCOR ELECTRIC DELIVERY COMPANY LLC
Operator Effective Begin Date: 111302
Operator Effective End Date: 112904
Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: PO BOX 132280
Operator City: DALLAS
Operator State: TX
Operator Zip: 75313
Operator Zip extension: 2280

Owner History:

Facility ID: 092540
Facility Number: 0039179
Customer Number: 54402
Individual Name or Business Name: TXU ELECTRIC DELIVERY COMPANY
Owner Effective Begin Date: 061999
Owner Effective End Date: 111302
Owner Address: 500 N AKARD
Owner Building: LP11040/0057
Owner PO Box: Not reported
Owner City: DALLAS
Owner State: TX
Owner Zip: 75201
Owner Zip extension: Not reported

Facility ID: 092540
Facility Number: 0039179
Customer Number: 60333
Individual Name or Business Name: ONCOR ELECTRIC DELIVERY COMPANY LLC
Owner Effective Begin Date: 111302
Owner Effective End Date: 112904
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: PO BOX 132280
Owner City: DALLAS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Owner State: TX
Owner Zip: 75313
Owner Zip extension: 2280

Facility ID: 092540
Facility Number: 0039179
Customer Number: 37424
Individual Name or Business Name: TU ELECTRIC
Owner Effective Begin Date: 090190
Owner Effective End Date: 061999
Owner Address: 1601 BRYAN ST
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: DALLAS
Owner State: TX
Owner Zip: 75201
Owner Zip extension: Not reported

Facility ID: 092540
Facility Number: 0039179
Customer Number: 54402
Individual Name or Business Name: TXU ELECTRIC DELIVERY COMPANY
Owner Effective Begin Date: 112904
Owner Effective End Date: 070107
Owner Address: 500 N AKARD
Owner Building: LP11040/0057
Owner PO Box: Not reported
Owner City: DALLAS
Owner State: TX
Owner Zip: 75201
Owner Zip extension: Not reported

Ind. Haz Waste:
Transporters Registration Number: 34243
Registration Initial Notification Date: 19831220
Registration Last Amendment Date: 20080528
EPA Identification: TXD988025193
Primary NAICS Code: 221122
Status Change Date: Not reported
Land Type: Not reported
Description of Facility Site Location: 301 S 12th Street, Corsicana, TX
Site Primary Standard Industrial Code: 49110
Site Primary SIC Description: Electric
Registration is Generator of Waste: Yes
Registration is Receivers of Waste: No
Registration is Transporter of Waste: No
Registration is Transfer Facility: No
Facility is STEERS Reporter: Yes
Required to Submit Annual Waste Summary: Yes
Facility Involved In Recycling: No
Revcr Has Monthly Reporting Requirement: 0
Mexican Facility: Does not represent a Maquiladora (Mexican Facility)
Facility Status: Active
Type of Generator: CESQG
TNRCC Region: Not reported
Company Name: Oncor Electric Delivery Company LLC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Contact Name: Deborah A Boyle
Contact Telephone Number: 214-812-8410
Mailing Address: Not reported
Mailing Address2: Not reported
Mailing City,St,Zip: Dallas, TX 75313 2280
Mailing County: USA
Facility County: Not reported
Facility Country: Not reported
TNRCC Facility ID: 011689
Site Owner Tax ID: 17529678306
Site Location Latitude: Not reported
Site Location Longitude: Not reported
Last Update to NOR Data: 20090601
Ind. waste permit Number: Not reported
Mun waste permit Number: Not reported
Non Notifier: No
Year: 2010

OWNER:

Owner Mailing Address: Not reported
Owner Mailing Address2: Not reported
Owner Mailing Address3: PO Box 132280
Owner City,St,Zip: Dallas, TX 75313 2280
Owner Country: USA
Owner Phone Number: 214-486-2022
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Corporation
Owner Tax Id: 17529678306
Owner Bankruptcy Code: 0

OWNER:

Owner Mailing Address: Not reported
Owner Mailing Address2: Not reported
Owner Mailing Address3: PO Box 132280
Owner City,St,Zip: Dallas, TX 75313 2280
Owner Country: USA
Owner Phone Number: 214-486-2022
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Corporation
Owner Tax Id: 17529678306
Owner Bankruptcy Code: 0

OWNER:

Owner Mailing Address: Not reported
Owner Mailing Address2: Not reported
Owner Mailing Address3: PO Box 132280
Owner City,St,Zip: Dallas, TX 75313 2280
Owner Country: USA
Owner Phone Number: 214-486-2022
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Corporation
Owner Tax Id: 17529678306
Owner Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Oncor Electric Delivery Company LLC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Operator First Name: Not reported
Operator Name: Oncor Electric Delivery Company LLC
Operator Mailing Address: 1601 Bryan St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Dallas, TX 75201 3430
Operator Country: USA
Operator Phone: 214-812-8410
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Unknown
Operator Tax Id: Not reported
Operator Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Oncor Electric Delivery Company LLC
Operator First Name: Not reported
Operator Name: Oncor Electric Delivery Company LLC
Operator Mailing Address: 1601 Bryan St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Dallas, TX 75201 3430
Operator Country: USA
Operator Phone: 214-812-8410
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Unknown
Operator Tax Id: Not reported
Operator Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Oncor Electric Delivery Company LLC
Operator First Name: Not reported
Operator Name: Oncor Electric Delivery Company LLC
Operator Mailing Address: 1601 Bryan St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Dallas, TX 75201 3430
Operator Country: USA
Operator Phone: 214-812-8410
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Unknown
Operator Tax Id: Not reported
Operator Bankruptcy Code: 0

CONTACT:

Contact Name: Deborah A Boyle
Contact Title: Waste Management Manager
Contact Role: Primary Contact
Contact Address: Not reported
Contact Address2: Not reported
Contact City,St,Zip: Dallas, TX 75313 2280
Contact Phone: 214-812-8410
Contact Fax: Not reported
Contact Email: Not reported

CONTACT:

Contact Name: Sheila Williams
Contact Title: Not reported
Contact Role: STEERS Contact
Contact Address: 500 Akard St

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Contact Address2: Not reported
Contact City,St,Zip: Dallas, TX 75201 3402
Contact Phone: 214-486-3657
Contact Fax: 214-486-4399
Contact Email: s.williams@txu.com

CONTACT:

Contact Name: Deborah A Boyle
Contact Title: Waste Management Manager
Contact Role: Primary Contact
Contact Address: Not reported
Contact Address2: Not reported
Contact City,St,Zip: Dallas, TX 75313 2280
Contact Phone: 214-812-8410
Contact Fax: Not reported
Contact Email: Not reported

CONTACT:

Contact Name: Sheila Williams
Contact Title: Not reported
Contact Role: STEERS Contact
Contact Address: 500 Akard St
Contact Address2: Not reported
Contact City,St,Zip: Dallas, TX 75201 3402
Contact Phone: 214-486-3657
Contact Fax: 214-486-4399
Contact Email: s.williams@txu.com

CONTACT:

Contact Name: Deborah A Boyle
Contact Title: Waste Management Manager
Contact Role: Primary Contact
Contact Address: Not reported
Contact Address2: Not reported
Contact City,St,Zip: Dallas, TX 75313 2280
Contact Phone: 214-812-8410
Contact Fax: Not reported
Contact Email: Not reported

CONTACT:

Contact Name: Sheila Williams
Contact Title: Not reported
Contact Role: STEERS Contact
Contact Address: 500 Akard St
Contact Address2: Not reported
Contact City,St,Zip: Dallas, TX 75201 3402
Contact Phone: 214-486-3657
Contact Fax: 214-486-4399
Contact Email: s.williams@txu.com
Business Desc: Ttransmission & distribution of electric power. Work crews that maintain & construct power lines operate from this facility.Ttransmission & distribution of electric power. Work crews that maintain & construct power lines operate from this facility.Ttransmission & distribution of electric power. Work crews that maintain & construct power lines operate from this facility.

UNIT:

Deed Record Needed: Not reported
Deed Recording Date: Not reported
Unit No: 001
Unit Type Code: 14

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Unit Type: Container
Unit Status: Active
Unit Regulatory Status: RCRA Pmt Exempt - Accumulation Time
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: 141
System Type 1: Storage
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Paved area for temporary storage of drums & miscellaneous containers
prior to shipment off-site. This was previously registered as
"Miscellaneous Storage Containers."
Dt Last Changed: 19831201
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Previously Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported

U001271739

Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
WasteID:	00075351, 00031131, 00031144, 00031143, 00075366, 00075358, 00075361, 00075363, 00075362, 00075375, 00031127, 00031129, 00100395, 00075375, 00031144, 00031133, 00075362, 00075349, 00075367, 00031128, 00031130, 00075365, 00031145, 00075358, 00031128, 00144505, 00031130, 00075364, 00031138, 00031132, 00031127, 00144505, 00031134, 00144506, 00144503, 00075367, 00158687, 00075370, 00075365, 00031131, 00075366, 00031132, 00031137, 00075361, 00075368, 00075369, 00075371, 00031135, 00075363, 00075360, 00144503, 00031137, 00075371, 00031129, 00075364, 00031142, 00157169, 00075370, 00075360, 00031135, 00100395, 00031134, 00075349, 00031138, 00031133, 00031143, 00075369, 00031142, 00031145, 00075351, 00157169, 00144506, 00075368, 00158687,
NIT:	
Deed Record Needed:	Not reported
Deed Recording Date:	Not reported
Unit No:	002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Unit Type Code: 22
Unit Type: Miscellan
Unit Status: Active
Unit Regulatory Status: Non-Hazardous Regulated
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: 141
System Type 1: Storage
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Roll off box for the collection of scrap metal prior to shipment
off-site for recycling.
Dt Last Changed: 19931124
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Currently Managed
WasteID: 00144503, 00144505, 00144505, 00031139, 00031139, 00144503,

UNIT:

Deed Record Needed: Not reported
Deed Recording Date: Not reported
Unit No: 003
Unit Type Code: 22
Unit Type: Miscellan
Unit Status: Active
Unit Regulatory Status: Non-Hazardous Regulated
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: 141
System Type 1: Storage
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Dumpster for the collection of general plant office refuse.
Dt Last Changed: 19931124
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Not reported
WasteID: 00144507, 00031140, 00144502, 00144508, 00031140, 00144502, 00144507, 00144508, 00100396, 00100396,

UNIT:

Deed Record Needed: No
Deed Recording Date: Not reported
Unit No: 001
Unit Type Code: 14
Unit Type: Container
Unit Status: Active
Unit Regulatory Status: RCRA Pmt Exempt - Accumulation Time
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: 141
System Type 1: Storage
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Paved area for temporary storage of drums & miscellaneous containers prior to shipment off-site. This was previously registered as "Miscellaneous Storage Containers."
Dt Last Changed: 19831201
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Currently Managed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Currently Managed
Waste Management:	Previously Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
WasteID: 00075351, 00031131, 00031144, 00031143, 00075366, 00075358, 00075361, 00075363, 00075362, 00075375, 00031127, 00031129, 00100395, 00075375, 00031144, 00031133, 00075362, 00075349, 00075367, 00031128, 00031130, 00075365, 00031145, 00075358, 00031128, 00144505, 00031130, 00075364, 00031138, 00031132, 00031127, 00144505, 00031134, 00144506, 00144503, 00075367, 00158687, 00075370, 00075365, 00031131, 00075366, 00031132, 00031137, 00075361, 00075368, 00075369, 00075371, 00031135, 00075363, 00075360, 00144503, 00031137, 00075371, 00031129, 00075364, 00031142, 00157169, 00075370, 00075360, 00031135, 00100395, 00031134, 00075349, 00031138, 00031133, 00031143, 00075369, 00031142, 00031145, 00075351, 00157169, 00144506, 00075368, 00158687,

UNIT:

Deed Record Needed: No
Deed Recording Date: Not reported
Unit No: 002
Unit Type Code: 22
Unit Type: Miscellan
Unit Status: Active
Unit Regulatory Status: Non-Hazardous Regulated
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: 141
System Type 1: Storage
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Roll off box for the collection of scrap metal prior to shipment off-site for recycling.
Dt Last Changed: 19931124
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Currently Managed
WasteID: 00144503, 00144505, 00144505, 00031139, 00031139, 00144503,

UNIT:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Deed Record Needed: No
Deed Recording Date: Not reported
Unit No: 003
Unit Type Code: 22
Unit Type: Miscellan
Unit Status: Active
Unit Regulatory Status: Non-Hazardous Regulated
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: 141
System Type 1: Storage
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Dumpster for the collection of general plant office refuse.
Dt Last Changed: 19931124
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Not reported
WasteID: 00144507, 00031140, 00144502, 00144508, 00031140, 00144502, 00144507, 00144508, 00100396, 00100396,

UNIT:

Deed Record Needed: Not reported
Deed Recording Date: Not reported
Unit No: 001
Unit Type Code: 14
Unit Type: Container
Unit Status: Active
Unit Regulatory Status: RCRA Pmt Exempt - Accumulation Time
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

System Type: Not reported
System Type Code 1: 141
System Type 1: Storage
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported

Unit Description: Paved area for temporary storage of drums & miscellaneous containers prior to shipment off-site. This was previously registered as "Miscellaneous Storage Containers."

Dt Last Changed: 19831201
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Previously Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Currently Managed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Currently Managed
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
Waste Management:	Not reported
WasteID:	00075351, 00031131, 00031144, 00031143, 00075366, 00075358, 00075361, 00075363, 00075362, 00075375, 00031127, 00031129, 00100395, 00075375, 00031144, 00031133, 00075362, 00075349, 00075367, 00031128, 00031130, 00075365, 00031145, 00075358, 00031128, 00144505, 00031130, 00075364, 00031138, 00031132, 00031127, 00144505, 00031134, 00144506, 00144503, 00075367, 00158687, 00075370, 00075365, 00031131, 00075366, 00031132, 00031137, 00075361, 00075368, 00075369, 00075371, 00031135, 00075363, 00075360, 00144503, 00031137, 00075371, 00031129, 00075364, 00031142, 00157169, 00075370, 00075360, 00031135, 00100395, 00031134, 00075349, 00031138, 00031133, 00031143, 00075369, 00031142, 00031145, 00075351, 00157169, 00144506, 00075368, 00158687,

UNIT:

Deed Record Needed:	Not reported
Deed Recording Date:	Not reported
Unit No:	003
Unit Type Code:	22
Unit Type:	Miscellan
Unit Status:	Active
Unit Regulatory Status:	Non-Hazardous Regulated
UIC Permit Number:	Not reported
Capacity:	Not reported
Capacity Measurment:	Not reported
Off Site Hazardous Waste:	No
Off Site Class 1 Waste:	Not reported
Off Site Class 2 Waste:	Not reported
Off Site Class 3 Waste:	Not reported
Off Site Non Indstrial Wst:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

System Type Code: Not reported
System Type: Not reported
System Type Code 1: 141
System Type 1: Storage
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Dumpster for the collection of general plant office refuse.
Dt Last Changed: 19931124
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Not reported
WasteID: 00144507, 00031140, 00144502, 00144508, 00031140, 00144502, 00144507, 00144508, 00100396, 00100396,

UNIT:

Deed Record Needed: Not reported
Deed Recording Date: Not reported
Unit No: 002
Unit Type Code: 22
Unit Type: Miscellan
Unit Status: Active
Unit Regulatory Status: Non-Hazardous Regulated
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: 141
System Type 1: Storage
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Roll off box for the collection of scrap metal prior to shipment off-site for recycling.
Dt Last Changed: 19931124
Waste Management: Not reported
Waste Management: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Waste Management: Currently Managed
Waste Management: Not reported
Waste Management: Currently Managed
Waste Management: Currently Managed
WasteID: 00144503, 00144505, 00144505, 00031139, 00031139, 00144503,

ACTIVITY:

Activity Type Involves: Not reported
Activity Desc: Not reported

OTS:

Site Name: TU Electric Power & Light
One-time Shipper ID: 05389
Location Desc: 301 SOUTH 12TH STREET, CORSICANA
Location Address: 301 S 12th Street
Location Address 2: Not reported
Location City: Corsicana
Location Zip: 75110
Broker Name: Not reported
EPA Waste Source Code: Not reported
EPA System Type Code: Not reported
EPA Form: Not reported
EPA Waste No: Not reported
Broker Phone: Not reported
Date Processing Complete: 19931025
Date Request Sent: 19931012
Company Name: Oncor Electric Delivery Company LLC
Waste ID: CD58211H
Waste Form: 211
Waste Class: H
Waste Origin Code: 1
Shipment Request ID: TXD988025193
Waste Code Audited: No

OTS:

Site Name: TU Electric Power & Light
One-time Shipper ID: 05389
Location Desc: 301 SOUTH 12TH STREET, CORSICANA
Location Address: 301 S 12th Street
Location Address 2: Not reported
Location City: Corsicana
Location Zip: 75110
Broker Name: Not reported
EPA Waste Source Code: Not reported
EPA System Type Code: Not reported
EPA Form: Not reported
EPA Waste No: Not reported
Broker Phone: Not reported
Date Processing Complete: 19931025
Date Request Sent: 19931012
Company Name: Oncor Electric Delivery Company LLC
Waste ID: CD58211H
Waste Form: 211
Waste Class: H
Waste Origin Code: 1
Shipment Request ID: TXD988025193
Waste Code Audited: No

OTS:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Site Name: TU Electric Power & Light
One-time Shipper ID: 05389
Location Desc: 301 SOUTH 12TH STREET, CORSICANA
Location Address: 301 S 12th Street
Location Address 2: Not reported
Location City: Corsicana
Location Zip: 75110
Broker Name: Not reported
EPA Waste Source Code: Not reported
EPA System Type Code: Not reported
EPA Form: Not reported
EPA Waste No: Not reported
Broker Phone: Not reported
Date Processing Complete: 19931025
Date Request Sent: 19931012
Company Name: Oncor Electric Delivery Company LLC
Waste ID: CD58211H
Waste Form: 211
Waste Class: H
Waste Origin Code: 1
Shipment Request ID: TXD988025193
Waste Code Audited: No

RCV:

Waste Receipts Summary Form Code: Not reported
State Manifest Documentaion Number: Not reported
Generators TX Registration Number: Not reported
Generators EPA ID: Not reported
Generators Waste Code: Not reported
Generators Waste Classification: Not reported
Generators Waste Form Code: Not reported
Generators Waste Form: Not reported
Quantity Shipped: Not reported
Units: Not reported
How Waste Handled by Receivers: Not reported
Receivers Date: Not reported
Transporters Registration Number: Not reported
Shipment Comment: Not reported
EPA Haz Waste: Not reported
EPA Haz Waste: Not reported
EPA Haz Waste: Not reported
EPA Haz Waste: Not reported
Receiver Name: Not reported
Reporting method: Not reported
No Shipmnts Recvd In Rept Period: Not reported
Record Creation Date: Not reported
Record Contains Error: Not reported
Record ID: Not reported
Co. Submitting Report: Not reported
Authorized Agent Submitting Report: Not reported
Authorized Agent Title: Not reported

WASTE:

Waste ID: 00031127
Waste Desc Yr: 2010
Waste Descrptn: Capacitors, PCB- Generated by the removal from service of oil filled capacitorscontaining >= 500 ppm PCB. 12\20\83
Desc of Waste: PCB CAPACITORPCB CAPACITORPCB CAPACITORPCB CAPACITORPCB CAPACITORPCB

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

CAPACITORPCB CAPACITORPCB CAPACITOR

Texas Waste Code: 173880
Texas Waste Code 2: 18312981
Waste Code Status: Active
Waste Form Code: 298
Waste Form: Non-haz o
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00031128
Waste Desc Yr: 2010
Waste Description: Insulating oil < 50 ppm PCB- Generated by the removal from service of
insulatingoil containing <50 ppm PCB. 12\20\83
Desc of Waste: PCB TRANSFORMER OIL (<50 PPM)PCB TRANSFORMER OIL (<50 PPM)PCB TRANSFORMER OIL
(<50 PPM)PCB TRANSFORMER OIL (<50 PPM)PCB TRANSFORMER OIL (<50 PPM)PCB
TRANSFORMER OIL (<50 PPM)PCB TRANSFORMER OIL (<50 PPM)PCB TRANSFORMER OIL (<50
PPM)

Texas Waste Code: 113720
Texas Waste Code 2: 18102061
Waste Code Status: Active
Waste Form Code: 206
Waste Form: Waste oil
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00031129
Waste Desc Yr: 2010
Waste Descriptn: Insulating Oil >- 50 ppm but < 500 ppm -Generated by the removal from
service of insulating oil containing >= 50 ppm but < 500 ppm PCB.
12\\20\\83
Desc of Waste: PCB TRANSFORMER OIL: 50-500PPMPCB TRANSFORMER OIL: 50-500PPMPCB TRANSFORMER
OIL: 50-500PPMPCB TRANSFORMER OIL: 50-500PPMPCB TRANSFORMER OIL: 50-500PPMPCB
TRANSFORMER OIL: 50-500PPMPCB TRANSFORMER OIL: 50-500PPMPCB TRANSFORMER OIL:
50-500PPM
Texas Waste Code: 113730
Texas Waste Code 2: 18112971
Waste Code Status: Active
Waste Form Code: 297
Waste Form: Non-haz o
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00031130
Waste Desc Yr: 2001
Waste Descriptn: Not reported
Desc of Waste: PCB WASTE (>500 PPM)PCB WASTE (>500 PPM)PCB WASTE (>500 PPM)PCB WASTE (>500
PPM)PCB WASTE (>500 PPM)PCB WASTE (>500 PPM)PCB WASTE (>500 PPM)PCB WASTE (>500
PPM)
Texas Waste Code: 118270
Texas Waste Code 2: Not reported
Waste Code Status: Inactive
Waste Form Code: Not reported
Waste Form: Not reported
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: Not reported
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported

U001271739

Primary Source:	Not reported
Primary Measurement Point Code:	Not reported
Primary Measurement Point:	Not reported
Primary Origin Code:	Not reported
Primary Origin:	Not reported
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	Not reported
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported
Reason Waste Form No Longer Gen.:	Unknown
EPA Haz Waste:	Not reported

WASTE:

Waste ID:	00031131
Waste Desc Yr:	2010
Waste Descriptn:	Capacitors, Non-PCB- Generated by the removal from service of oil filled capacitors containing < 50 ppm PCB 12\\20\\83
Desc of Waste:	CAPACITORS, NON-PCBCAPACITORS, NON-PCBCAPACITORS, NON-PCBCAPACITORS, NON-PCBCAPACITORS, NON-PCBCAPACITORS, NON-PCBCAPACITORS, NON-PCBCAPACITORS, NON-PCB
Texas Waste Code:	115770
Texas Waste Code 2:	18302191
Waste Code Status:	Active
Waste Form Code:	219
Waste Form:	Other org
Waste Classification:	1
Waste is Radioactive:	Not reported
Waste Treated Off Site:	0
Primary Standard Industrial Code:	Not reported
Standard Industrial Classification:	Not reported
Primary Source:	Not reported
Primary Source:	Not reported
Primary Measurement Point Code:	Not reported
Primary Measurement Point:	Not reported
Primary Origin Code:	1
Primary Origin:	Gen. on-s
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	Not reported
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported
Reason Waste Form No Longer Gen.:	Not reported
EPA Haz Waste:	Not reported

WASTE:

Waste ID:	00031132
Waste Desc Yr:	2010
Waste Descriptn:	Drained Electrical Equipment >=500 ppm PCB -Generated from the disposal of drained electrical equipment contaminated with >= 500 ppm PCB. 12\\20\\83
Desc of Waste:	PCB TRANSFORMERPCB TRANSFORMERPCB TRANSFORMERPCB TRANSFORMERPCB TRANSFORMERPCB TRANSFORMERPCB TRANSFORMERPCB TRANSFORMER
Texas Waste Code:	178160

U001271739

Texas Waste Code 2:	17323971
Waste Code Status:	Active
Waste Form Code:	397
Waste Form:	Nonhazard
Waste Classification:	1
Waste is Radioactive:	Not reported
Waste Treated Off Site:	0
Primary Standard Industrial Code:	Not reported
Standard Industrial Classification:	Not reported
Primary Source:	Not reported
Primary Source:	Not reported
Primary Measurement Point Code:	Not reported
Primary Measurement Point:	Not reported
Primary Origin Code:	1
Primary Origin:	Gen. on-s
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	Not reported
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported
Reason Waste Form No Longer Gen.:	Not reported
EPA Haz Waste:	Not reported

WASTE:

[illegible]

Texas Waste Code:	177650
Texas Waste Code 2:	15014891
Waste Code Status:	Inactive
Waste Form Code:	489
Waste Form:	Petroleum
Waste Classification:	1
Waste is Radioactive:	0
Waste Treated Off Site:	0
Primary Standard Industrial Code:	Not reported
Standard Industrial Classification:	Not reported
Primary Source:	Not reported
Primary Source:	Not reported
Primary Measurement Point Code:	Not reported
Primary Measurement Point:	Not reported
Primary Origin Code:	1
Primary Origin:	Gen. on-s
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	0
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported

U001271739

Reason Waste Form No Longer Gen.:	Reclassified
EPA Haz Waste:	Not reported

WASTE:

Waste ID:	00031134
Waste Desc Yr:	2010
Waste Descriptn:	Debris, contaminated with >= 50 ppm but < 500 ppm PCB- Generated from the contamination of various materials with insulating oil containing >= 50 ppm but < 500ppm PCB.
Desc of Waste:	PCB CONTAMINATED SOLIDS 50-500 PPMPCB CONTAMINATED SOLIDS 50-500 PPMPCB CONTAMINATED SOLIDS 50-500 PPMPCB CONTAMINATED SOLIDS 50-500 PPMPCB CONTAMINATED SOLIDS 50-500 PPMPCB CONTAMINATED SOLIDS 50-500 PPMPCB CONTAMINATED SOLIDS 50-500 PPMPCB CONTAMINATED SOLIDS 50-500 PPM

Texas Waste Code:	177640
Texas Waste Code 2:	15024941
Waste Code Status:	Active
Waste Form Code:	494
Waste Form:	Organ sol
Waste Classification:	1
Waste is Radioactive:	0
Waste Treated Off Site:	0
Primary Standard Industrial Code:	Not reported
Standard Industrial Classification:	Not reported
Primary Source:	Not reported
Primary Source:	Not reported
Primary Measurement Point Code:	Not reported
Primary Measurement Point:	Not reported
Primary Origin Code:	1
Primary Origin:	Gen. on-s
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	0
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported
Reason Waste Form No Longer Gen.:	Not reported
EPA Haz Waste:	Not reported

WASTE:

Waste ID:	00031135
Waste Desc Yr:	2010
Waste Descriptn:	Debris, contaminated with >= 500 ppm PCB - Generated from the contamination of various materials with insulating oil containing >= 500 ppm PCB.
Desc of Waste:	PCB CONTAMINATED SOLIDSPCB CONTAMINATED SOLIDSPCB CONTAMINATED SOLIDSPCB CONTAMINATED SOLIDSPCB CONTAMINATED SOLIDSPCB CONTAMINATED SOLIDSPCB CONTAMINATED SOLIDSPCB CONTAMINATED SOLIDS

Texas Waste Code:	179430
Texas Waste Code 2:	15034951
Waste Code Status:	Active
Waste Form Code:	495
Waste Form:	Organic s
Waste Classification:	1
Waste is Radioactive:	0
Waste Treated Off Site:	0
Primary Standard Industrial Code:	Not reported
Standard Industrial Classification:	Not reported

CORSICANA SERVICE CENTER (Continued)

U001271739

Primary Source:	Not reported
Primary Source:	Not reported
Primary Measurement Point Code:	Not reported
Primary Measurement Point:	Not reported
Primary Origin Code:	1
Primary Origin:	Gen. on-s
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	0
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported
Reason Waste Form No Longer Gen.:	Not reported
EPA Haz Waste:	Not reported

WASTE:

Waste ID:	00031136
Waste Desc Yr:	2001
Waste Descriptn:	Not reported
Desc of Waste:	MINERAL OIL CONTAMINATED MATERIALMINERAL OIL CONTAMINATED MATERIALMINERAL OIL CONTAMINATED MATERIALMINERAL OIL CONTAMINATED MATERIALMINERAL OIL CONTAMINATED MATERIALMINERAL OIL CONTAMINATED MATERIALMINERAL OIL CONTAMINATED MATERIALMINERAL OIL CONTAMINATED MATERIAL

Texas Waste Code:	277330
Texas Waste Code 2:	Not reported
Waste Code Status:	Inactive
Waste Form Code:	Not reported
Waste Form:	Not reported
Waste Classification:	2
Waste is Radioactive:	Not reported
Waste Treated Off Site:	1
Primary Standard Industrial Code:	Not reported
Standard Industrial Classification:	Not reported
Primary Source:	Not reported
Primary Source:	Not reported
Primary Measurement Point Code:	Not reported
Primary Measurement Point:	Not reported
Primary Origin Code:	Not reported
Primary Origin:	Not reported
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	Not reported
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported
Reason Waste Form No Longer Gen.:	Unknown
EPA Haz Waste:	Not reported

WASTE:

[illegible]

CORSICANA SERVICE CENTER (Continued)

U001271739

Texas Waste Code 2:	18122981
Waste Code Status:	Active
Waste Form Code:	298
Waste Form:	Non-haz o
Waste Classification:	1
Waste is Radioactive:	Not reported
Waste Treated Off Site:	0
Primary Standard Industrial Code:	Not reported
Standard Industrial Classification:	Not reported
Primary Source:	Not reported
Primary Source:	Not reported
Primary Measurement Point Code:	Not reported
Primary Measurement Point:	Not reported
Primary Origin Code:	1
Primary Origin:	Gen. on-s
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	Not reported
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported
Reason Waste Form No Longer Gen.:	Not reported
EPA Haz Waste:	Not reported

WASTE:

[illegible]

Texas Waste Code:	178570
Texas Waste Code 2:	15123941
Waste Code Status:	Active
Waste Form Code:	394
Waste Form:	Non-haz i
Waste Classification:	1
Waste is Radioactive:	Not reported
Waste Treated Off Site:	0
Primary Standard Industrial Code:	Not reported
Standard Industrial Classification:	Not reported
Primary Source:	Not reported
Primary Source:	Not reported
Primary Measurement Point Code:	Not reported
Primary Measurement Point:	Not reported
Primary Origin Code:	1
Primary Origin:	Gen. on-s
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	Not reported
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported
Reason Waste Form No Longer Gen.:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

EPA Haz Waste: Not reported

WASTE:

Waste ID: 00031139

Waste Desc Yr: 2010

Waste Descriptn: Scrap Metal- Metal scrap generated from the installation, removal and maintenance of electric power lines and related equipment . 12\20\83

Desc of Waste: METAL SCRAPMETAL SCRAPMETAL SCRAPMETAL SCRAPMETAL SCRAPMETAL SCRAPMETAL SCRAPMETAL SCRAP

Texas Waste Code: 270350

Texas Waste Code 2: 17103072

Waste Code Status: Active

Waste Form Code: 307

Waste Form: Metal sca

Waste Classification: 2

Waste is Radioactive: Not reported

Waste Treated Off Site: 0

Primary Standard Industrial Code: Not reported

Standard Industrial Classification: Not reported

Primary Source: Not reported

Primary Source: Not reported

Primary Measurement Point Code: Not reported

Primary Measurement Point: Not reported

Primary Origin Code: 1

Primary Origin: Gen. on-s

Primary System Type Code: Not reported

Primary System Type: Not reported

New Chemical Substance: Not reported

Audit Performed: 0

Company Waste ID: Not reported

Primary NAICS Code: Not reported

EPA Waste Form Code: Not reported

Reason Waste Form No Longer Gen.: Not reported

EPA Haz Waste: Not reported

WASTE:

Waste ID: 00031140

Waste Desc Yr: 2010

Waste Descriptn: Plant refuse- General refuse containing paper, cardboard, linings, wrappings, paper or wood packaging materials, food wastes, glass, aluminum foil, plastics, styrofoam, food packaging, and miscellaneous wastes- Does not include oils or lubricants of

Desc of Waste: PLANT REFUSE, GENERAL MISC.PLANT REFUSE, GENERAL MISC.PLANT REFUSE, GENERAL MISC.PLANT REFUSE, GENERAL MISC.PLANT REFUSE, GENERAL MISC.PLANT REFUSE, GENERAL MISC.

Texas Waste Code: 279760

Texas Waste Code 2: 19029032

Waste Code Status: Inactive

Waste Form Code: 903

Waste Form: Plant Off

Waste Classification: 2

Waste is Radioactive: 0

Waste Treated Off Site: 0

Primary Standard Industrial Code: Not reported

Standard Industrial Classification: Not reported

Primary Source: Not reported

Primary Source: Not reported

Primary Measurement Point Code: Not reported

U001271739

Primary Measurement Point:	Not reported
Primary Origin Code:	1
Primary Origin:	Gen. on-s
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	0
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported
Reason Waste Form No Longer Gen.:	Unknown
EPA Haz Waste:	Not reported

WASTE:

Waste ID:	00031142
Waste Desc Yr:	2010
Waste Descriptn:	Used lubricating oil- Generated by the removal of various lubricants from fleetvehicles and equipment during routine maintenance
Desc of Waste:	OIL, WASTE OIL, WASTEOIL, WASTEOIL, WASTEOIL, WASTEOIL, WASTEOIL, WASTE
Texas Waste Code:	110450
Texas Waste Code 2:	18012061
Waste Code Status:	Active
Waste Form Code:	206
Waste Form:	Waste oil
Waste Classification:	1
Waste is Radioactive:	Not reported
Waste Treated Off Site:	0
Primary Standard Industrial Code:	Not reported
Standard Industrial Classification:	Not reported
Primary Source:	Not reported
Primary Source:	Not reported
Primary Measurement Point Code:	Not reported
Primary Measurement Point:	Not reported
Primary Origin Code:	1
Primary Origin:	Gen. on-s
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	Not reported
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	Not reported
EPA Waste Form Code:	Not reported
Reason Waste Form No Longer Gen.:	Not reported
EPA Haz Waste:	Not reported

WASTE:

Waste ID:	00031143
Waste Desc Yr:	2010
Waste Descriptn:	Used Ethylene Glycol- Generated by the removal of ethylene glycol from fleet vehicles and equipment during routine maintenance. 12\20\83
Desc of Waste:	ANTIFREEZEANTIFREEZEANTIFREEZEANTIFREEZEANTIFREEZEANTIFREEZEANTIFREEZEANTIFREEZE
Texas Waste Code:	108320
Texas Waste Code 2:	18002961
Waste Code Status:	Active
Waste Form Code:	296
Waste Form:	Ethylene
Waste Classification:	1
Waste is Radioactive:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00031144
Waste Desc Yr: 2010
Waste Descriptn: Asbestos- generated by the removal of asbestos containing materials
such as fire-proofing material. 12\20\83
Desc of Waste: ASBESTOSASBESTOSASBESTOSASBESTOSASBESTOSASBESTOSASBESTOSASBESTOS
Texas Waste Code: 170750
Texas Waste Code 2: 17133111
Waste Code Status: Active
Waste Form Code: 311
Waste Form: Asbestos
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00031145
Waste Desc Yr: 2010
Waste Descriptn: Solvents, Non-Halogenated- Generated from cleaning of parts and
material. 12\20\83
Desc of Waste: SOLVENTS, NON-HALOGENATEDSOLVENTS, NON-HALOGENATEDSOLVENTS,
NON-HALOGENATEDSOLVENTS, NON-HALOGENATEDSOLVENTS, NON-HALOGENATEDSOLVENTS,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

NON-HALOGENATED SOLVENTS, NON-HALOGENATED SOLVENTS, NON-HALOGENATED

Texas Waste Code: 913860
Texas Waste Code 2: 1821203H
Waste Code Status: Active
Waste Form Code: 203
Waste Form: Non-halog
Waste Classification: H
Waste is Radioactive: 0
Waste Treated Off Site: 0
Primary Standard Industrial Code: 49110
Standard Industrial Classification: Electric
Primary Source: G09
Primary Source: Not reported
Primary Measurement Point Code: 2
Primary Measurement Point: After mix
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: 221122
EPA Waste Form Code: W203
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075347
Waste Desc Yr: 2010
Waste Description: Used oil filters- generated by the removal of oil filters from fleet vehicles and equipment during routine maintenance. 12\20\83
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 17003101
Waste Code Status: Active
Waste Form Code: 310
Waste Form: Spent sol
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

WASTE:

Waste ID: 00075349
Waste Desc Yr: 2010
Waste Descriptn: Drained Electrical Equipment < 50 ppm PCB - generated from the disposal of drained electrical equipment contaminated with < 50 ppm PCB(>1500 ppm TPH) 12\20\83
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 17303191
Waste Code Status: Active
Waste Form Code: 319
Waste Form: Other was
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075351
Waste Desc Yr: 2010
Waste Descriptn: Drained Electrical Equipment >= 50 ppm but < 500 ppm PCB -generated from the disposal of drained electrical equipment contaminated with >=50 ppm but < 500 ppm PCB. 12\20\83
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 17313961
Waste Code Status: Active
Waste Form Code: 396
Waste Form: Nonhazard
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075357
Waste Desc Yr: 2010
Waste Descriptn: Contaminated containers generated from the disposal of empty containers which have held a hazardous waste, a Class 1 waste or a material which would be classified as a hazardous or Class 1 waste if disposed.
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 15073081
Waste Code Status: Active
Waste Form Code: 308
Waste Form: Empty or
Waste Classification: 1
Waste is Radioactive: 0
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075358
Waste Desc Yr: 2010
Waste Descriptn: Debris contaminated with 1500 ppm TPH generated from the contamination of various materials with petroleum products > 1500 ppm TPH (non-insulating oil).
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 15044891
Waste Code Status: Active
Waste Form Code: 489
Waste Form: Petroleum
Waste Classification: 1
Waste is Radioactive: 0
Waste Treated Off Site: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075360
Waste Desc Yr: 2010
Waste Descriptn: Scrap lead/copper /paper/cable contaminated with > 1500ppm TPH generated by theremoval & installation of lead sheathed electric cable containing a copper conductor & oil impregnated paper insulation > 1500 ppm TPH (nON-insulating oil).

Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 15083071
Waste Code Status: Active
Waste Form Code: 307
Waste Form: Metal sca
Waste Classification: 1
Waste is Radioactive: 0
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075361
Waste Desc Yr: 2010
Waste Descriptn: Used filter Press Filters contaminated with < 50 ppm PCB - Generated by the filtering of insulating oil containing < 50 ppm PCB (> 1500ppm TPH).

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 15093101
Waste Code Status: Active
Waste Form Code: 310
Waste Form: Spent sol
Waste Classification: 1
Waste is Radioactive: 0
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075362
Waste Desc Yr: 2010
Waste Descriptn: Used filter press filters contaminated with >=50 ppm but < 500 ppm PCB
generated by the filtering of insulating oil containing >= 50 ppm but
< 500ppm PCB.

Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 15103941
Waste Code Status: Active
Waste Form Code: 394
Waste Form: Non-haz i
Waste Classification: 1
Waste is Radioactive: 0
Waste Treated Off Site: 1
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075363
Waste Desc Yr: 2010
Waste Descriptn: Used filter press filters, contaminated with >= 500ppm PCB - Generated
by the filtering of insulating oil containing >= 500 ppm PCB. 12\20\83
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 15113951
Waste Code Status: Active
Waste Form Code: 395
Waste Form: Non-haz i
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075364
Waste Desc Yr: 2010
Waste Descriptn: Containers, Contaminated with >= 500 ppm PCB- Generated by the
disposal of empty containers contaminated with >= 500 ppm PCB
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 15133951
Waste Code Status: Active
Waste Form Code: 395
Waste Form: Non-haz i
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075365
Waste Desc Yr: 2010
Waste Descriptn: Used Basting oil- Generated during process of splicing lead sheathed
copper cable. 12\20\83
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 18132061
Waste Code Status: Active
Waste Form Code: 206
Waste Form: Waste oil
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075366
Waste Desc Yr: 2010
Waste Descriptn: Lighting Ballasts, PCB- Generated by the removal from service of
compound filled lighting ballasts containing >= 500 ppm PCB. 12\20\83
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 18322981
Waste Code Status: Active
Waste Form Code: 298
Waste Form: Non-haz o
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075367
Waste Desc Yr: 2010
Waste Descriptn: Non-Drained Electrical Equipment, PCB - Generated by the removal from
service of oil filled electrical equipment containing >= 500 ppm PCB.
12\20\83
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 18332981
Waste Code Status: Active
Waste Form Code: 298
Waste Form: Non-haz o
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075368
Waste Desc Yr: 2010
Waste Descriptn: Water, contaminated with < 50 ppm PCB - Generated from the
contamination of water with insulating oil containing < 50 ppm PCB (>
1500 ppm TPH) 12\20\83
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 16002051
Waste Code Status: Active
Waste Form Code: 205

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Waste Form: Oil-water
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075369
Waste Desc Yr: 2010
Waste Descriptn: Water, contaminated with >= 50 ppm but < 500 ppm PCB- Generated from the contamination of water with insulating oil containing >=50 ppm but < 500 ppm PCB. 12\20\83
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 16012971
Waste Code Status: Active
Waste Form Code: 297
Waste Form: Non-haz o
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075370
Waste Desc Yr: 2010

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Waste Descriptn: Water, contaminated with >=500 ppm PCB - Generated from the contamination of water with insulating oil containing >= 500 ppm PCB.

12\20\83

Desc of Waste: Not reported

Texas Waste Code: Not reported
Texas Waste Code 2: 16022981
Waste Code Status: Active
Waste Form Code: 298
Waste Form: Non-haz o
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075371

Waste Desc Yr: 2010

Waste Descriptn: Water, contaminated with Petroleum Products > 1500 ppm TPH- Generated from the contamination of water with various petroleum products containing > 1500 ppm TPH(Non-Insulating Oil). 12\20\83

Desc of Waste: Not reported

Texas Waste Code: Not reported
Texas Waste Code 2: 16032051
Waste Code Status: Active
Waste Form Code: 205
Waste Form: Oil-water
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: 0
Company Waste ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00075375
Waste Desc Yr: 2010
Waste Descriptn: Solvents, Flammable- Generated from cleaning of parts and material.
12\\20\\83
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 1822203H
Waste Code Status: Active
Waste Form Code: 203
Waste Form: Non-halog
Waste Classification: H
Waste is Radioactive: 0
Waste Treated Off Site: 0
Primary Standard Industrial Code: 49110
Standard Industrial Classification: Electric
Primary Source: G09
Primary Source: Not reported
Primary Measurement Point Code: 2
Primary Measurement Point: After mix
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: 221122
EPA Waste Form Code: W203
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00100395
Waste Desc Yr: 2010
Waste Descriptn: Batteries, Wet Cell - Generated by the removal of spent lead acid
batteries from fleet vehicles and equipment during routine maintenance;
12/83(Sent off-site for recycling)
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 1702309H
Waste Code Status: Active
Waste Form Code: 309
Waste Form: Batteries
Waste Classification: H
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: 49110
Standard Industrial Classification: Electric
Primary Source: G16
Primary Source: Not reported
Primary Measurement Point Code: 1
Primary Measurement Point: Before mi

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: 221122
EPA Waste Form Code: W309
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00100396
Waste Desc Yr: 2010
Waste Descriptn: Poles & Crossarms - Generated by the removal from service of damaged
or deteriorated wood poles and crossarms; 12/83
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 17144882
Waste Code Status: Active
Waste Form Code: 488
Waste Form: Wood debr
Waste Classification: 2
Waste is Radioactive: 0
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00144502
Waste Desc Yr: 2010
Waste Descriptn: Wooden Debris - Various Wooden debris consisting primarily of wire
spools or pallets. Initial Date of Generation - 12/20/83.
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 17114882
Waste Code Status: Active
Waste Form Code: 488
Waste Form: Wood debr
Waste Classification: 2
Waste is Radioactive: Not reported
Waste Treated Off Site: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00144503
Waste Desc Yr: 2010
Waste Description: Scrap Metal (Class 1) - Metal scrap generated from various activities.
InitialDate of Generation: 12/20/83.

Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 17153071
Waste Code Status: Active
Waste Form Code: 307
Waste Form: Metal sca
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00144505
Waste Desc Yr: 2010
Waste Description: Hazardous Scrap Metal - Metal scrap generated from various activities.
InitialDate of Generation - 12/20/83.
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 1716307H

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Waste Code Status: Active
Waste Form Code: 307
Waste Form: Metal sca
Waste Classification: H
Waste is Radioactive: 0
Waste Treated Off Site: 0
Primary Standard Industrial Code: 49110
Standard Industrial Classification: Electric
Primary Source: G15
Primary Source: Not reported
Primary Measurement Point Code: 1
Primary Measurement Point: Before mi
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: 221122
EPA Waste Form Code: W307
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00144506
Waste Desc Yr: 2010
Waste Descriptn: Solvent, Non-Hazardous - Petroleum based solvents having a flashpoint
> 140 F, used for various parts cleaning. Initial Date of generation -
12/20/83.

Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 18262031
Waste Code Status: Active
Waste Form Code: 203
Waste Form: Non-halog
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Waste ID: 00144507
Waste Desc Yr: 2010
Waste Descriptn: Plant Trash - General refuse from office and producton areas - does not include oils, lubricants of any kind, oil filters, contaminated soils, sludges or wastewaters. Initial Date of generation - 12/20/83.
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 19009992
Waste Code Status: Active
Waste Form Code: 999
Waste Form: Plant Ref
Waste Classification: 2
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00144508
Waste Desc Yr: 2010
Waste Descriptn: Supplemental Plant Production Refuse - Class 2 wastes from production, manufacturing, or laboratory operations not included in plant refuse and not having a unique waste code. Initial Date of generation - 12/20/83.
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 19019022
Waste Code Status: Active
Waste Form Code: 902
Waste Form: Supplemen
Waste Classification: 2
Waste is Radioactive: 0
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

New Chemical Substance: 0
Audit Performed: 1
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00148996
Waste Desc Yr: 2010
Waste Descriptn: non-friable asbestos generated from the removal of category I and II
non-friable asbestos initial generation 5-31-96
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 17173112
Waste Code Status: Active
Waste Form Code: 311
Waste Form: Asbestos
Waste Classification: 2
Waste is Radioactive: Not reported
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00157169
Waste Desc Yr: 2010
Waste Descriptn: Batteries, dry cell - various sizes & types from assorted equipment
such as flashlights, radios, cameras, etc.
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 1718309H
Waste Code Status: Active
Waste Form Code: 309
Waste Form: Batteries
Waste Classification: H
Waste is Radioactive: 0
Waste Treated Off Site: 0
Primary Standard Industrial Code: 49110
Standard Industrial Classification: Electric
Primary Source: G16
Primary Source: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

U001271739

Primary Measurement Point Code: 2
Primary Measurement Point: After mix
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: 221122
EPA Waste Form Code: W309
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00158687
Waste Desc Yr: 2010
Waste Descriptn: Debris contaminated with miner oil (insulating oil) containing <50ppm
PCB & >=1500ppm TPH per waste analysis file no. 409-V
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 15004892
Waste Code Status: Active
Waste Form Code: 489
Waste Form: Petroleum
Waste Classification: 2
Waste is Radioactive: 0
Waste Treated Off Site: 0
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 2
Primary Origin: Result of
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 1
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

[Click this hyperlink](#) while viewing on your computer to access
additional TX IHW: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

F19
SSW
1/8-1/4
0.200 mi.
1058 ft.

CORSICANA SERVICE CENTER
301 S 12TH STREET
CORSICANA, TX 75110

Site 2 of 4 in cluster F

RCRA-CESQG
FINDS

1000470504
TXD988025193

Relative:
Equal

RCRA-CESQG:

Date form received by agency: 06/01/2009

Facility name: ONCOR ELECTRIC DELIVERY COMPANY LLC

Facility address: 301 S 12TH STREET
CORSICANA, TX 75110

EPA ID: TXD988025193

Mailing address: PO BOX 132280
DALLAS, TX 75313

Contact: DEBORAH A BOYLE

Contact address: PO BOX 132280
DALLAS, TX 75313

Contact country: US

Contact telephone: 214-812-8410

Contact email: Not reported

EPA Region: 06

Classification: Conditionally Exempt Small Quantity Generator

Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name: ONCOR ELECTRIC DELIVERY COMPANY LLC

Owner/operator address: BRYAN ST
DALLAS, TX 75201

Owner/operator country: US

Owner/operator telephone: 214-812-8410

Legal status: Private

Owner/Operator Type: Operator

Owner/Op start date: 06/01/2009

Owner/Op end date: Not reported

Owner/operator name: ONCOR ELECTRIC DELIVERY COMPANY LLC

Owner/operator address: PO BOX 132280
DALLAS, TX 75313

Owner/operator country: US

Owner/operator telephone: 214-486-2022

Legal status: Private

Owner/Operator Type: Owner

Owner/Op start date: 06/01/2009

Owner/Op end date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

1000470504

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No
Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 09/22/2008
Facility name: ONCOR ELECTRIC DELIVERY COMPANY LLC
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 07/25/2007
Facility name: ONCOR ELECTRIC DELIVERY COMPANY LLC
Site name: ONCOR ELECTRIC DELIVERY COMPANY
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 03/26/2007
Facility name: ONCOR ELECTRIC DELIVERY COMPANY LLC
Site name: TU ELECTRIC
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 11/29/2005
Facility name: ONCOR ELECTRIC DELIVERY COMPANY LLC
Site name: TU ELECTRIC
Classification: Conditionally Exempt Small Quantity Generator

Date form received by agency: 03/13/2002
Facility name: ONCOR ELECTRIC DELIVERY COMPANY LLC
Site name: TU ELECTRIC
Classification: Small Quantity Generator

Date form received by agency: 07/15/1997
Facility name: ONCOR ELECTRIC DELIVERY COMPANY LLC
Site name: TU ELECTRIC CORSICANA SVC CTR
Classification: Small Quantity Generator

Hazardous Waste Summary:

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSLEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

1000470504

WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code:	D002
Waste name:	A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
Waste code:	D003
Waste name:	A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.
Waste code:	D006
Waste name:	CADMIUM
Waste code:	D007
Waste name:	CHROMIUM
Waste code:	D008
Waste name:	LEAD
Waste code:	D009
Waste name:	MERCURY
Waste code:	D011
Waste name:	SILVER
Waste code:	F003
Waste name:	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste code:	F005
Waste name:	THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Violation Status:	No violations found
FINDS:	

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA SERVICE CENTER (Continued)

1000470504

Registry ID: 110005127638

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Texas Commission on Environmental Quality - Agency Central Registry (TX-TCEQ ACR) is a computer application that allows the Texas Commission on Environmental Quality (TCEQ) to use a single, centralized area to record common information, such as the company names, addresses, and telephone numbers of those the TCEQ regulates. It also contains additional IDs (permits, registrations, authorizations, etc) and their status.

F20
SSW
1/8-1/4
0.202 mi.
1068 ft.

AVENUE FUEL DIST
301 W 7TH AVE
CORSICANA, TX 75110

UST **U001247537**
N/A

Site 3 of 4 in cluster F

Relative:
Higher

UST:

Actual:
425 ft.

Facility ID:	0011630
Facility Type:	Retail
Name of Facility Manager:	R J DILL
Title of Facility Manager:	PRES
Facility Manager Phone:	214-874-4756
Facility Rural Box:	Not reported
Facility in Ozone non-attainment area:	Not reported
TCEQ Num:	088762
Owner ID:	33552
Disputed Owner:	Not reported
Date Registration Form Received:	050886
Region Number:	04
Number of USTs:	5
Sign Name on Registration Form:	R J DILL
Title of Signer of Registration Form:	PRES
Date of Signature on Registration Form:	042886
Owner Effective Begin Date:	090187
Owner ID:	33552
In Care Of:	Not reported
Owner Name:	MIDDLETON
Owner Address:	Not reported
Owner PO Box:	PO BOX 388
Owner City,St,Zip:	CORSICANA, TX 75151
Owner Contact Name:	Not reported
Contact Telephone:	Not reported
Owner Type:	Individual
Mail Undeliverable:	Not reported
Bankruptcy is in effect:	Not reported
Owner Amendment Reason Code:	Owner Name Changed
Owner Amendment Date:	101001
Number of Facilities reported by Owner:	0001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVENUE FUEL DIST (Continued)

U001247537

Of Underground Storage Tanks: 0005
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported
Operator Name: Not reported
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: Not reported
Operator City, St, Zip: Not reported
Operator Contact Name: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported

Tank ID: 1
Unit ID: 00030590
Tank Status: Removed from the Ground
Tank Regulatory Status: Fully Regulated
Status Date: 08311990
Installation Date: 01011971
Tank Registration Date: 05081986
Capacity: 0004000
Tank Emptied: No
Tank Construction and Containment: Not reported
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Not reported
Pipe Construction and Containment II: Not reported
Piping Design and Ext. Containment 3: Not reported
Piping Design and Ext. Containment 4: Not reported
Type of Piping: Not reported
Internal Tank Lining Date: 00000000
Tank Material of Construction: Steel
Other Materials of Construction: Not reported
Pipe Material of Construction: FRP (fiberglass-reinforced plastic)
Other Construction and Containment: Not reported
Pipe Connectors and Valves 1: Not reported
Pipe Connectors and Valves 2: Not reported
Pipe Connectors and Valves 3: Not reported
Tank Corrosion Protection: Not reported
Tank Corrosion Protection II: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVENUE FUEL DIST (Continued)

U001247537

Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Cathodic Protection
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00030592
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	08311990
Installation Date:	01011971
Tank Registration Date:	05081986
Capacity:	0004000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVENUE FUEL DIST (Continued)

U001247537

Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Cathodic Protection
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	3
Unit ID:	00030591
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	08311990
Installation Date:	01011971

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVENUE FUEL DIST (Continued)

U001247537

Tank Registration Date:	05081986
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Cathodic Protection
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Diesel
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVENUE FUEL DIST (Continued)

U001247537

Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	4
Unit ID:	00030593
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	08311990
Installation Date:	01011971
Tank Registration Date:	05081986
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Cathodic Protection
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVENUE FUEL DIST (Continued)

U001247537

Compartment Other Substance:	Empty
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	5
Unit ID:	00030594
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	08311990
Installation Date:	01011971
Tank Registration Date:	05081986
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Cathodic Protection
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AVENUE FUEL DIST (Continued)

U001247537

Contractor Registration Number: Not reported
Tank Tested: Tested
Installer License Number: Not reported
Tank Installer: Not reported

Self-Certification Date: Not reported
Compartment: Not reported

Compartment Letter: A
Compartment Capacity: 0000000
Compartment Substance Stored: Gasoline
Compartment Other Substance: Not reported
Tank Release Method Detection I: Not reported
Tank Release Method Detection II: Not reported
Tank Release Method Detection III: Not reported
Other Tank Release Method Detection: Not reported
Tank Release Detection Variance: No Variance
Pipe Release Detection Method: Not reported
Pipe Release Detection Method II: Not reported
Pipe Release Detection Method III: Not reported
Other Pipe Release Detection Method: None
Pipe Release Detection Variance: No Variance
Spill and Overfill Protection: Not reported
Spill and Overfill Protection II: Not reported
Spill and Overfill Protection III: Not reported
Spill Overfill Prevention Variation: No Variance

Operator History:
Operator ID: Not reported
Operator Name or Business Name: Not reported
Operator Effective Begin Date: Not reported
Operator Effective End Date: Not reported
Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:
Facility ID: Not reported
Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F21
SSW
1/8-1/4
0.212 mi.
1119 ft.
KILMARNOCK & BROWN
319 W 7TH AVE
CORSICANA, TX 75110
Site 4 of 4 in cluster F

UST **U003113487**
N/A

Relative:
Higher

UST:

Actual:
425 ft.

Facility ID:	0068926
Facility Type:	Not reported
Name of Facility Manager:	Monte Cain
Title of Facility Manager:	Not reported
Facility Manager Phone:	903-874-4725
Facility Rural Box:	Not reported
Facility in Ozone non-attainment area:	Not reported
TCEQ Num:	104399
Owner ID:	49043
Disputed Owner:	Not reported
Date Registration Form Received:	092496
Region Number:	04
Number of USTs:	2
Sign Name on Registration Form:	Monte Cain
Title of Signer of Registration Form:	Representative
Date of Signature on Registration Form:	092096
Owner Effective Begin Date:	083187
Owner ID:	49043
In Care Of:	Not reported
Owner Name:	BROWN
Owner Address:	319 W 7TH Ave
Owner PO Box:	Not reported
Owner City,St,Zip:	CORSICANA, TX 75110
Owner Contact Name:	Monte Cain
Contact Telephone:	903-874-4725
Owner Type:	Individual
Mail Undeliverable:	Not reported
Bankruptcy is in effect:	Not reported
Owner Amendment Reason Code:	Unknown, Migrated Data
Owner Amendment Date:	011202
Number of Facilities reported by Owner:	0001
# Of Underground Storage Tanks:	0002
# Of Aboveground Storage Tanks:	0000
Self-Certification Date:	Not reported
Signature Name:	Not reported
Signature Title Name:	Not reported
Signature Type Text:	Not reported
Certification Submitted Type:	Not reported
Registration Self-Certification Flag:	Not reported
Fees Self-Certification Flag:	Not reported
Financial Assurance Self-Certification flag:	Not reported
Technical standards Self-Certification flag:	Not reported
UST Delivery Certificate Expiration Date:	Not reported
Operator ID:	Not reported
Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KILMARNOCK & BROWN (Continued)

U003113487

Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City,St,Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	1
Unit ID:	00181430
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Exempt Non-use since 1974
Status Date:	08231996
Installation Date:	08311987
Tank Registration Date:	09241996
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KILMARNOCK & BROWN (Continued)

U003113487

Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00181431
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Exempt Non-use since 1974
Status Date:	08231996
Installation Date:	08311987
Tank Registration Date:	09241996
Capacity:	0003000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KILMARNOCK & BROWN (Continued)

U003113487

Stage 2 Vapor Recry Equipment Status: Not Reported
Stage 2 Equipment Installed Date: Not reported
Equipment Installer: Not reported
Contractor Registration Number: Not reported
Tank Tested: Not reported
Installer License Number: Not reported
Tank Installer: Not reported

Self-Certification Date: Not reported
Compartment: Not reported

Compartment Letter: A
Compartment Capacity: 0000000
Compartment Substance Stored: Not reported
Compartment Other Substance: Unknown
Tank Release Method Detection I: Not reported
Tank Release Method Detection II: Not reported
Tank Release Method Detection III: Not reported
Other Tank Release Method Detection: Not reported
Tank Release Detection Variance: No Variance
Pipe Release Detection Method: Not reported
Pipe Release Detection Method II: Not reported
Pipe Release Detection Method III: Not reported
Other Pipe Release Detection Method: None
Pipe Release Detection Variance: No Variance
Spill and Overfill Protection: Not reported
Spill and Overfill Protection II: Not reported
Spill and Overfill Protection III: Not reported
Spill Overfill Prevention Variation: No Variance

Operator History:
Operator ID: Not reported
Operator Name or Business Name: Not reported
Operator Effective Begin Date: Not reported
Operator Effective End Date: Not reported
Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:
Facility ID: Not reported
Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KILMARNOCK & BROWN (Continued)

U003113487

Owner Zip extension:

Not reported

22
ESE
1/8-1/4
0.213 mi.
1126 ft.

COCA COLA BOTTLING CO OF N TX
409 S 9TH ST
CORSICANA, TX 75110

UST **U001238394**
N/A

Relative:
Lower

UST:

Actual:
418 ft.

Facility ID: 0001187
Facility Type: Not reported
Name of Facility Manager: BILLY WALKER
Title of Facility Manager: ROUTE MANAGER
Facility Manager Phone: 2148743401
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 038282
Owner ID: 00292
Disputed Owner: Not reported
Date Registration Form Received: 050886
Region Number: 04
Number of USTs: 1
Sign Name on Registration Form: O D POOLE
Title of Signer of Registration Form: DIR OF QUAL CNTRL
Date of Signature on Registration Form: 031286
Owner Effective Begin Date: 050886

Owner ID: 00292
In Care Of: DIV OF COCA COLA E
Owner Name: COCA-COLA BOTTLING COMPANY OF NORTH TEXAS
Owner Address: 6011 LEMMON AVE
Owner PO Box: Not reported
Owner City,St,Zip: DALLAS, TX 75221
Owner Contact Name: Ronnie Moore
Contact Telephone: 214-257-1781
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Contact Changed
Owner Amendment Date: 092208
Number of Facilities reported by Owner: 0018
Of Underground Storage Tanks: 0049
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID:

Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COCA COLA BOTTLING CO OF N TX (Continued)

U001238394

Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City,St,Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	1
Unit ID:	00003027
Tank Status:	Permanently Filled In-Place
Tank Regulatory Status:	Fully Regulated
Status Date:	01011987
Installation Date:	01011956
Tank Registration Date:	05081986
Capacity:	0000600
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COCA COLA BOTTLING CO OF N TX (Continued)

U001238394

Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Operator History:	
Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported
Owner History:	
Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

G23
NE
1/8-1/4
0.221 mi.
1167 ft.

THE PIT STOP
124 N 7TH ST
CORSICANA, TX 75110

Site 1 of 3 in cluster G

LPST
UST

U001293200
N/A

Relative:
Lower

LPST:

Facility ID: 64259
Facility Location: 104 N 7TH ST
Region City ID: 4
Region City: ARLINGTON
LPST Id: 92986
Reported Date: 1989-04-12 00:00:00
Entered Date: 1989-05-18 00:00:00
Priority Description: A designated major or minor groundwater aquifer is affected or immediately threatened.

Status: **FINAL CONCURRENCE ISSUED, CASE CLOSED**

RPR Coordinator: DWH
Responsible Party Name: REYNOLDS CHARLES
Responsible Party Contact: CHARLES REYNOLDS
Responsible Party Address: 910 HIDEAWAY HARBOR
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: 903/872-4611

UST:

Facility ID: 0064259
Facility Type: Retail
Name of Facility Manager: CHARLES REYNOLDS
Title of Facility Manager: Not reported
Facility Manager Phone: 903-874-6126
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 095352
Owner ID: 40125
Disputed Owner: Not reported
Date Registration Form Received: 021893
Region Number: 04
Number of USTs: 3
Sign Name on Registration Form: CHARLES REYNOLDS
Title of Signer of Registration Form: SEC/TRES
Date of Signature on Registration Form: 021293
Owner Effective Begin Date: 021893

Owner ID: 40125
In Care Of: CHARLES REYNOLDS
Owner Name: GOLDEN CIRCLE INVESTMENT INC
Owner Address: 910 HIDEAWAY HARBOR
Owner PO Box: Not reported
Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: CHARLES REYNOLDS
Contact Telephone: 903-874-6126
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Name Changed
Owner Amendment Date: 101101
Number of Facilities reported by Owner: 0001
Of Underground Storage Tanks: 0003
Of Aboveground Storage Tanks: 0000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE PIT STOP (Continued)

U001293200

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported
Operator Name: Not reported
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: Not reported
Operator City, St, Zip: Not reported
Operator Contact Name: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported

Tank ID: 1
Unit ID: 00147793
Tank Status: **Removed from the Ground**
Tank Regulatory Status: Exempt Non-use since 1974
Status Date: 07151998
Installation Date: 08311987
Tank Registration Date: 02181993
Capacity: 0003000
Tank Emptied: No
Tank Construction and Containment: Not reported
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Not reported
Pipe Construction and Containment II: Not reported
Piping Design and Ext. Containment 3: Not reported
Piping Design and Ext. Containment 4: Not reported
Type of Piping: Not reported
Internal Tank Lining Date: 00000000
Tank Material of Construction: Steel
Other Materials of Construction: Not reported
Pipe Material of Construction: Not reported
Other Construction and Containment: Not reported
Pipe Connectors and Valves 1: Not reported
Pipe Connectors and Valves 2: Not reported
Pipe Connectors and Valves 3: Not reported
Tank Corrosion Protection: Not reported
Tank Corrosion Protection II: Not reported
Tank Corrosion Protection III: Not reported
Other Tank Corrosion Protection Text: None
Tank Corrosion Protection Variance: No Variance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE PIT STOP (Continued)

U001293200

Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00147792
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Exempt Non-use since 1974
Status Date:	07151998
Installation Date:	08311987
Tank Registration Date:	02181993
Capacity:	0006000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE PIT STOP (Continued)

U001293200

Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported

Self-Certification Date:	Not reported
Compartment:	Not reported

Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Tank ID:	3
Unit ID:	00147791
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Exempt Non-use since 1974
Status Date:	07151998
Installation Date:	08311987
Tank Registration Date:	02181993
Capacity:	0006000
Tank Emptied:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE PIT STOP (Continued)

U001293200

Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE PIT STOP (Continued)

U001293200

Spill Overfill Prevention Variation: No Variance

Operator History:

Operator ID: Not reported
Operator Name or Business Name: Not reported
Operator Effective Begin Date: Not reported
Operator Effective End Date: Not reported
Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:

Facility ID: Not reported
Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

24
WSW
1/8-1/4
0.230 mi.
1212 ft.

872 CO TREMONT
212 W 13TH ST
CORSICANA, TX 75110

UST **U001276377**
FINANCIAL ASSURANCE **N/A**

Relative:
Higher

UST:

Actual:
430 ft.

Facility ID: 0044644
Facility Type: Not reported
Name of Facility Manager: NTWK OPRS
Title of Facility Manager: Dist Mgr
Facility Manager Phone: 866-492-6836
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 076723
Owner ID: 22573
Disputed Owner: Not reported
Date Registration Form Received: 031187
Region Number: 04
Number of USTs: 1
Sign Name on Registration Form: GRETCHEN BEAN
Title of Signer of Registration Form: ASST. STF. SUPV.
Date of Signature on Registration Form: 030387
Owner Effective Begin Date: 090188

Owner ID: 22573

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

872 CO TREMONT (Continued)

U001276377

In Care Of: Not reported
Owner Name: SOUTHWESTERN BELL TELEPHONE LP
Owner Address: 308 S AKARD ST
Owner PO Box: Not reported
Owner City,St,Zip: DALLAS, TX 75202
Owner Contact Name: MGR
Contact Telephone: 800-566-9347
Owner Type: Corporation
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Contact Changed
Owner Amendment Date: 092910
Number of Facilities reported by Owner: 0609
Of Underground Storage Tanks: 0772
Of Aboveground Storage Tanks: 0176

Self-Certification Date: 033010
Signature Name: Tameka Jackson
Signature Title Name: Manager-EH&S
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 201103

Self-Certification Date: 030909
Signature Name: Mark E Dinubila
Signature Title Name: Environmental Mgr
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 201003

Self-Certification Date: 052208
Signature Name: MARK DINUBILA
Signature Title Name: MANAGER EHS
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200903

Self-Certification Date: 032207
Signature Name: Robert D Taylor
Signature Title Name: Environmental Manage
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

872 CO TREMONT (Continued)

U001276377

Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200803

Self-Certification Date: 022406
Signature Name: CHERYL ALLEN
Signature Title Name: ENVIRONMENTAL MGR
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200703

Self-Certification Date: 020205
Signature Name: HARRY C HIXON
Signature Title Name: Not reported
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200603

Self-Certification Date: 012204
Signature Name: HARRY C HIXSON
Signature Title Name: SR ENVIRO MGR
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200503

Self-Certification Date: 022603
Signature Name: HARRY C HIXSON
Signature Title Name: SR ENVIR MGR
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200403

Self-Certification Date: 030602
Signature Name: HARRY C HIXSON
Signature Title Name: SEN ENVIRO MGR
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Initial
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200303

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

872 CO TREMONT (Continued)

U001276377

Operator ID: 055916
Operator Effective Date: 090188
Operator Type: Corporation
Operator First Name: Not reported
Operator Name: SOUTHWESTERN BELL TELEPHONE LP
Operator Building Loc: ROOM 1700
Operator Telephone: Not reported
Operator Address: 308 S AKARD ST
Operator PO Box: Not reported
Operator City, St, Zip: DALLAS, TX 75202 5399
Operator Contact Name: MGR MGR
Operator Contact Title: MGR EHS
Operator Contact Phone: 800-566-9347

Tank ID: 1
Unit ID: 00116968
Tank Status: In Use
Tank Regulatory Status: Emerg. Power Generator
Status Date: Not reported
Installation Date: 01011987
Tank Registration Date: 03111987
Capacity: 0002000
Tank Emptied: No
Tank Construction and Containment: Single Wall
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Single Wall
Pipe Construction and Containment II: Not reported
Piping Design and Ext. Containment 3: Not reported
Piping Design and Ext. Containment 4: Not reported
Type of Piping: Suction
Internal Tank Lining Date: 00000000
Tank Material of Construction: FRP (fiberglass-reinforced plastic)
Other Materials of Construction: Not reported
Pipe Material of Construction: Steel
Other Construction and Containment: Not reported
Pipe Connectors and Valves 1: Not reported
Pipe Connectors and Valves 2: Not reported
Pipe Connectors and Valves 3: Not reported
Tank Corrosion Protection: FRP tank or piping (noncorrodible)
Tank Corrosion Protection II: Not reported
Tank Corrosion Protection III: Not reported
Other Tank Corrosion Protection Text: Not reported
Tank Corrosion Protection Variance: No Variance
Pipe Corrosion Protection: Cathodic Protection - Field Installation
Pipe Corrosion Protection II: Cathodic Protection - Factory Installation
Pipe Corrosion Protection 3: Not reported
Other Corrosion Protection: Not reported
Pipe Corrosion Protection Variance: No Variance
Stage 1 Vapor Recovery Equipment Status: Not Reported
Stage 1 Equipment Installed Date: Not reported
Stage 2 Vapor Recry Equipment Status: Not Reported
Stage 2 Equipment Installed Date: Not reported
Equipment Installer: Not reported
Contractor Registration Number: Not reported
Tank Tested: Tested

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

872 CO TREMONT (Continued)

U001276377

Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	033010
Compartment:	A
Self-Certification Date:	030909
Compartment:	A
Self-Certification Date:	052208
Compartment:	A
Self-Certification Date:	032207
Compartment:	A
Self-Certification Date:	030602
Compartment:	A
Self-Certification Date:	020205
Compartment:	A
Self-Certification Date:	012204
Compartment:	A
Self-Certification Date:	022603
Compartment:	A
Self-Certification Date:	022406
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Diesel
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Monthly Tank Gauging (for Emer. Generator Tanks)
Tank Release Method Detection II:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Triennial Tightness Test (for suction/gravity piping)
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Delivery Shut-off Valve
Spill and Overfill Protection II:	Factory-Built Spill Container/Bucket/Sump
Spill and Overfill Protection III:	1
Spill Overfill Prevention Variation:	No Variance
Operator History:	
Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported
Owner History:	
Facility ID:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

872 CO TREMONT (Continued)

U001276377

Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

H25 **DILL & NELSON OIL CO**
ENE **222 S 7TH ST**
1/8-1/4 **CORSICANA, TX 75110**
0.230 mi.
1213 ft. **Site 1 of 2 in cluster H**

LPST **U001247540**
UST **N/A**

Relative:
Lower

LPST:

Actual:
416 ft.

Facility ID: 11633
Facility Location: 222 S 7TH ST
Region City ID: 4
Region City: ARLINGTON
LPST Id: 92984
Reported Date: 1989-04-07 00:00:00
Entered Date: 1989-05-18 00:00:00
Priority Description: Not reported
Status: FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator: RD2
Responsible Party Name: CORSICANA NATIONAL BANK
Responsible Party Contact: TERRY JACOBSON
Responsible Party Address: 733 W SECOND AVE
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: 903/874-7117

UST:

Facility ID: 0011633
Facility Type: Retail
Name of Facility Manager: RANDY DILL
Title of Facility Manager: Not reported
Facility Manager Phone: 9038741926
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 096994
Owner ID: 53706
Disputed Owner: Not reported
Date Registration Form Received: 050886
Region Number: 04
Number of USTs: 3
Sign Name on Registration Form: R J DILL
Title of Signer of Registration Form: PRES
Date of Signature on Registration Form: 042886
Owner Effective Begin Date: 091097

Owner ID: 53706

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DILL & NELSON OIL CO (Continued)

U001247540

In Care Of: Not reported
Owner Name: COMMUNITY SERVICES INC
Owner Address: Not reported
Owner PO Box: PO BOX 612
Owner City,St,Zip: CORSICANA, TX 75151
Owner Contact Name: Not reported
Contact Telephone: Not reported
Owner Type: Corporation
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Unknown, Migrated Data
Owner Amendment Date: 011202
Number of Facilities reported by Owner: 0001
Of Underground Storage Tanks: 0003
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported
Operator Name: Not reported
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: Not reported
Operator City,St,Zip: Not reported
Operator Contact Name: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported

Tank ID: 1
Unit ID: 00030604
Tank Status: Temporarily Out of Use
Tank Regulatory Status: Fully Regulated
Status Date: 12011998
Installation Date: 01011971
Tank Registration Date: 05081986
Capacity: 0005000
Tank Emptied: Yes
Tank Construction and Containment: Not reported
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Not reported
Pipe Construction and Containment II: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DILL & NELSON OIL CO (Continued)

U001247540

Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported

Self-Certification Date:	Not reported
Compartment:	Not reported

Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	EMPTY
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Tank ID:	2
Unit ID:	00030603
Tank Status:	Temporarily Out of Use
Tank Regulatory Status:	Fully Regulated

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DILL & NELSON OIL CO (Continued)

U001247540

Status Date:	12011998
Installation Date:	01011971
Tank Registration Date:	05081986
Capacity:	0005000
Tank Emptied:	Yes
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	EMPTY
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DILL & NELSON OIL CO (Continued)

U001247540

Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	3
Unit ID:	00030605
Tank Status:	Temporarily Out of Use
Tank Regulatory Status:	Fully Regulated
Status Date:	12011998
Installation Date:	01011971
Tank Registration Date:	05081986
Capacity:	0004000
Tank Emptied:	Yes
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DILL & NELSON OIL CO (Continued)

U001247540

Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	EMPTY
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:

Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:

Facility ID:	096994
Facility Number:	0011633
Customer Number:	41556
Individual Name or Business Name:	CORSICANA NATIONAL BANK
Owner Effective Begin Date:	031293
Owner Effective End Date:	091097
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	PO BOX 624
Owner City:	CORSICANA
Owner State:	TX
Owner Zip:	75151
Owner Zip extension:	Not reported

Facility ID:	096994
Facility Number:	0011633
Customer Number:	05382
Individual Name or Business Name:	DILL & NELSON OIL CO
Owner Effective Begin Date:	042871
Owner Effective End Date:	031293
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	PO BOX 1236
Owner City:	CORSICANA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DILL & NELSON OIL CO (Continued)

U001247540

Owner State: TX
Owner Zip: 75110
Owner Zip extension: Not reported

**I26
NNW
1/8-1/4
0.231 mi.
1218 ft.**

**CHUCKS PAINT & BODY
416 N BEATON
CORSICANA, TX 75110**

**RCRA-CESQG
FINDS**

**1001203681
TXR000003517**

Site 1 of 2 in cluster I

**Relative:
Higher**

RCRA-CESQG:

Date form received by agency: 04/11/1995

Facility name: CHUCKS PAINT & BODY

Facility address: 416 N BEATON
CORSICANA, TX 75110

EPA ID: TXR000003517

Mailing address: N BEATON
CORSICANA, TX 75110

Contact: CHUCK RASH

Contact address: 416 N BEATON
CORSICANA, TX 75110

Contact country: US

Contact telephone: (903) 872-6080

Contact email: Not reported

EPA Region: 06

Land type: Private

Classification: Conditionally Exempt Small Quantity Generator

Description: Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste

Owner/Operator Summary:

Owner/operator name: CHUCK RASH

Owner/operator address: 416 N BEATON
CORSICANA, TX 75110

Owner/operator country: Not reported

Owner/operator telephone: (903) 872-5080

Legal status: Private

Owner/Operator Type: Owner

Owner/Op start date: Not reported

Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No

Mixed waste (haz. and radioactive): Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CHUCKS PAINT & BODY (Continued)

1001203681

Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No
Off-site waste receiver:	Verified to be non-commercial

Hazardous Waste Summary:

Waste code: D001

Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: F001

Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE, AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F002

Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F003

Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CHUCKS PAINT & BODY (Continued)

1001203681

Waste code: F005
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Facility Has Received Notices of Violations:

Regulation violated: SR - 26.121
Area of violation: State Statute or Regulation
Date violation determined: 07/17/1997
Date achieved compliance: Not reported
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 08/01/1997
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 07/17/1997
Evaluation: FOCUSED COMPLIANCE INSPECTION
Area of violation: State Statute or Regulation
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110005164883

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

I27
NNW
1/8-1/4
0.233 mi.
1231 ft.

CUSTOM PAINT & BODY SHOP
420 N BEATON ST
CORSICANA, TX 75110

Site 2 of 2 in cluster I

Relative:
Higher

RCRA-NonGen:
Date form received by agency: 08/23/2001
Facility name: CUSTOM PAINT & BODY SHOP
Facility address: 420 N BEATON ST
CORSICANA, TX 75110
EPA ID: TXD981152051
Mailing address: N BEATON ST

Actual:
426 ft.

RCRA-NonGen **1000415854**
FINDS **TXD981152051**
Ind. Haz Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUSTOM PAINT & BODY SHOP (Continued)

1000415854

Contact: CORSICANA, TX 75110
Contact address: BILL CUNNINGHAM
N BEATON ST
CORSICANA, TX 75110
Contact country: US
Contact telephone: 214-872-7690
Contact email: Not reported
EPA Region: 06
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: CUSTOM PAINT & BODY SHOP
Owner/operator address: N BEATON ST
CORSICANA, TX 75110
Owner/operator country: US
Owner/operator telephone: 214-872-7690
Legal status: Not reported
Owner/Operator Type: Operator
Owner/Op start date: 08/23/2001
Owner/Op end date: Not reported

Owner/operator name: CUSTOM PAINT & BODY SHOP
Owner/operator address: N BEATON ST
CORSICANA, TX 75110
Owner/operator country: US
Owner/operator telephone: 214-872-7690
Legal status: Not reported
Owner/Operator Type: Owner
Owner/Op start date: 08/23/2001
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: Not reported
Mixed waste (haz. and radioactive): Not reported
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: Not reported
Underground injection activity: Not reported
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: Not reported
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: Not reported
Used oil transporter: Not reported
Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 02/04/1986
Facility name: CUSTOM PAINT & BODY SHOP
Classification: Small Quantity Generator

Violation Status: No violations found

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUSTOM PAINT & BODY SHOP (Continued)

1000415854

FINDS:

Registry ID: 110005087734

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Texas Commission on Environmental Quality - Agency Central Registry (TX-TCEQ ACR) is a computer application that allows the Texas Commission on Environmental Quality (TCEQ) to use a single, centralized area to record common information, such as the company names, addresses, and telephone numbers of those the TCEQ regulates. It also contains additional IDs (permits, registrations, authorizations, etc) and their status.

Ind. Haz Waste:

Transporters Registration Number: 69484
Registration Initial Notification Date: 19860307
Registration Last Amendment Date: 20010823
EPA Identification: TXD981152051
Primary NAICS Code: 999999
Status Change Date: 20010823
Land Type: Not reported
Description of Facility Site Location: 420 N Beaton St, Corsicana, TX
Site Primary Standard Industrial Code: 99990
Site Primary SIC Description: Nonclassi
Registration is Generator of Waste: Yes
Registration is Receivers of Waste: No
Registration is Transporter of Waste: No
Registration is Transfer Facility: No
Facility is STEERS Reporter: No
Required to Submit Annual Waste Summary: No
Facility Involved In Recycling: No
Revcr Has Monthly Reporting Requirement: 0
Mexican Facility: Does not represent a Maquiladora (Mexican Facility)
Facility Status: Inactive
Type of Generator: Non-industrial and/or municipal, CESQG
TNRCC Region: Not reported
Company Name: Custom Paint & Body Shop
Contact Name: Bill Cunningham
Contact Telephone Number: 214-872-7690
Mailing Address: 420 N Beaton St
Mailing Address2: Not reported
Mailing City,St,Zip: Corsicana, TX 75110 4659
Mailing County: USA
Facility County: Not reported
Facility Country: USA
TNRCC Facility ID: 024360
Site Owner Tax ID: Not reported
Site Location Latitude: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUSTOM PAINT & BODY SHOP (Continued)

1000415854

Site Location Longitude: Not reported
Last Update to NOR Data: 20100624
Ind. waste permit Number: Not reported
Mun waste permit Number: Not reported
Non Notifier: No
Year: 2010

OWNER:

Owner Mailing Address: 420 N Beaton St
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: Corsicana, TX 75110 4659
Owner Country: USA
Owner Phone Number: 214-872-7690
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Unknown
Owner Tax Id: Not reported
Owner Bankruptcy Code: 0

OWNER:

Owner Mailing Address: 420 N Beaton St
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: Corsicana, TX 75110 4659
Owner Country: USA
Owner Phone Number: 214-872-7690
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Unknown
Owner Tax Id: Not reported
Owner Bankruptcy Code: 0

OWNER:

Owner Mailing Address: 420 N Beaton St
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: Corsicana, TX 75110 4659
Owner Country: USA
Owner Phone Number: 214-872-7690
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Unknown
Owner Tax Id: Not reported
Owner Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Custom Paint & Body Shop
Operator First Name: Not reported
Operator Name: Custom Paint & Body Shop
Operator Mailing Address: 420 N Beaton St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75110 4659
Operator Country: USA
Operator Phone: 214-872-7690
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Unknown
Operator Tax Id: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUSTOM PAINT & BODY SHOP (Continued)

1000415854

Operator Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Custom Paint & Body Shop
Operator First Name: Not reported
Operator Name: Custom Paint & Body Shop
Operator Mailing Address: 420 N Beaton St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75110 4659
Operator Country: USA
Operator Phone: 214-872-7690
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Unknown
Operator Tax Id: Not reported
Operator Bankruptcy Code: 0

OPERATOR:

Operator Last Name: Custom Paint & Body Shop
Operator First Name: Not reported
Operator Name: Custom Paint & Body Shop
Operator Mailing Address: 420 N Beaton St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75110 4659
Operator Country: USA
Operator Phone: 214-872-7690
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Unknown
Operator Tax Id: Not reported
Operator Bankruptcy Code: 0

CONTACT:

Contact Name: Bill Cunningham
Contact Title: Environmental Manager
Contact Role: Primary Contact
Contact Address: 420 N Beaton St
Contact Address2: Not reported
Contact City,St,Zip: Corsicana, TX 75110 4659
Contact Phone: 214-872-7690
Contact Fax: Not reported
Contact Email: Not reported

CONTACT:

Contact Name: Bill Cunningham
Contact Title: Environmental Manager
Contact Role: Primary Contact
Contact Address: 420 N Beaton St
Contact Address2: Not reported
Contact City,St,Zip: Corsicana, TX 75110 4659
Contact Phone: 214-872-7690
Contact Fax: Not reported
Contact Email: Not reported

CONTACT:

Contact Name: Bill Cunningham
Contact Title: Environmental Manager
Contact Role: Primary Contact
Contact Address: 420 N Beaton St
Contact Address2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUSTOM PAINT & BODY SHOP (Continued)

1000415854

Contact City,St,Zip: Corsicana, TX 75110 4659
Contact Phone: 214-872-7690
Contact Fax: Not reported
Contact Email: Not reported
Business Desc: Not reported

UNIT:

Deed Record Needed: Not reported
Deed Recording Date: Not reported
Unit No: Not reported
Unit Type Code: Not reported
Unit Type: Not reported
Unit Status: Not reported
Unit Regulatory Status: Not reported
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurement: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrial Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: Not reported
System Type 1: Not reported
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Not reported
Dt Last Changed: Not reported
Waste Management: Not reported
WasteID: ,

ACTIVITY:

Activity Type Involves: Not reported
Activity Desc: Not reported

OTS:

Site Name: Not reported
One-time Shipper ID: Not reported
Location Desc: Not reported
Location Address: Not reported
Location Address 2: Not reported
Location City: Not reported
Location Zip: Not reported
Broker Name: Not reported
EPA Waste Source Code: Not reported
EPA System Type Code: Not reported
EPA Form: Not reported
EPA Waste No: Not reported
Broker Phone: Not reported
Date Processing Complete: Not reported
Date Request Sent: Not reported
Company Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUSTOM PAINT & BODY SHOP (Continued)

1000415854

Waste ID: Not reported
Waste Form: Not reported
Waste Class: Not reported
Waste Origin Code: Not reported
Shipment Request ID: Not reported
Waste Code Audited: Not reported

RCV:

Waste Receipts Summary Form Code: Not reported
State Manifest Documentaion Number: Not reported
Generators TX Registration Number: Not reported
Generators EPA ID: Not reported
Generators Waste Code: Not reported
Generators Waste Classification: Not reported
Generators Waste Form Code: Not reported
Generators Waste Form: Not reported
Quantity Shipped: Not reported
Units: Not reported
How Waste Handled by Receivers: Not reported
Receivers Date: Not reported
Transporters Registration Number: Not reported
Shipment Comment: Not reported
EPA Haz Waste: Not reported
EPA Haz Waste: Not reported
EPA Haz Waste: Not reported
EPA Haz Waste: Not reported
Receiver Name: Not reported
Reporting method: Not reported
No Shipmnts Recvd In Rept Period: Not reported
Record Creation Date: Not reported
Record Contains Error: Not reported
Record ID: Not reported
Co. Submitting Report: Not reported
Authorized Agent Submitting Report: Not reported
Authorized Agent Title: Not reported

WASTE:

Waste ID: Not reported
Waste Desc Yr: Not reported
Waste Descrptn: Not reported
Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: Not reported
Waste Code Status: Not reported
Waste Form Code: Not reported
Waste Form: Not reported
Waste Classification: Not reported
Waste is Radioactive: Not reported
Waste Treated Off Site: Not reported
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: Not reported
Primary Origin: Not reported
Primary System Type Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUSTOM PAINT & BODY SHOP (Continued)

1000415854

Primary System Type: Not reported
New Chemical Substance: Not reported
Audit Performed: Not reported
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Not reported
EPA Haz Waste: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional TX IHW: detail in the EDR Site Report.

**28
NW
1/8-1/4
0.234 mi.
1237 ft.**

**CORSICANA FORD INC
400 N MAIN ST
CORSICANA, TX 75110**

**RCRA-NonGen
FINDS
1000382016
TXD026184671**

**Relative:
Higher**

RCRA-NonGen:

**Actual:
433 ft.**

Date form received by agency: 08/23/2001
Facility name: CORSICANA FORD INC
Facility address: 400 N MAIN ST
CORSICANA, TX 75110
EPA ID: TXD026184671
Mailing address: N MAIN ST
CORSICANA, TX 75110
Contact: ROBERT W LEWIS
Contact address: N MAIN ST
CORSICANA, TX 75110
Contact country: US
Contact telephone: 214-874-5631
Contact email: Not reported
EPA Region: 06
Land type: Private
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: CORSICANA FORD INC
Owner/operator address: N MAIN ST
CORSICANA, TX 75110
Owner/operator country: US
Owner/operator telephone: 214-874-5631
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 08/23/2001
Owner/Op end date: Not reported

Owner/operator name: CORSICANA FORD INC
Owner/operator address: N MAIN ST
CORSICANA, TX 75110
Owner/operator country: US
Owner/operator telephone: 214-874-5631
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 08/23/2001
Owner/Op end date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA FORD INC (Continued)

1000382016

Handler Activities Summary:

U.S. importer of hazardous waste: Not reported
Mixed waste (haz. and radioactive): Not reported
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: Not reported
Underground injection activity: Not reported
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: Not reported
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: Not reported
Used oil transporter: Not reported
Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 06/20/1988
Facility name: CORSICANA FORD INC
Classification: Small Quantity Generator

Hazardous Waste Summary:

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: F001
Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE, AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste code: F002
Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Facility Has Received Notices of Violations:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA FORD INC (Continued)

1000382016

Regulation violated: SR - 335.9A2/3
Area of violation: State Statute or Regulation
Date violation determined: 07/25/1991
Date achieved compliance: Not reported
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 07/25/1991
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 07/25/1991
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: State Statute or Regulation
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110005042015

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

G29
ENE
1/8-1/4
0.236 mi.
1245 ft.
ABC AG CENTER INC
103 N 7TH
CORSICANA, TX 75110
Site 2 of 3 in cluster G

LPST **U001287020**
UST **N/A**

Relative:
Lower

LPST:

Facility ID: 57041
Facility Location: 103 N 7TH ST
Region City ID: 4
Region City: ARLINGTON
LPST Id: 92985
Reported Date: 1989-04-12 00:00:00
Entered Date: 1989-05-18 00:00:00
Priority Description: A designated major or minor groundwater aquifer is affected or immediately threatened.

Status: **FINAL CONCURRENCE ISSUED, CASE CLOSED**

RPR Coordinator: SLR

Responsible Party Name: DYESS BILL
Responsible Party Contact: BILL DYESS
Responsible Party Address: 103 N 7TH ST
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: 214/872-2110

Actual:
416 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ABC AG CENTER INC (Continued)

U001287020

UST:

Facility ID:	0057041
Facility Type:	Not reported
Name of Facility Manager:	BILL DYESS
Title of Facility Manager:	PRESIDENT
Facility Manager Phone:	903-872-2110
Facility Rural Box:	Not reported
Facility in Ozone non-attainment area:	Not reported
TCEQ Num:	086749
Owner ID:	31503
Disputed Owner:	Not reported
Date Registration Form Received:	112790
Region Number:	04
Number of USTs:	1
Sign Name on Registration Form:	BILL DYESS
Title of Signer of Registration Form:	PRES
Date of Signature on Registration Form:	111590
Owner Effective Begin Date:	112790
Owner ID:	31503
In Care Of:	Not reported
Owner Name:	ABC AG CENTER INC
Owner Address:	103 N 7TH
Owner PO Box:	Not reported
Owner City,St,Zip:	CORSICANA, TX 75110
Owner Contact Name:	BILL DYESS
Contact Telephone:	9038722110
Owner Type:	Private or Corporate
Mail Undeliverable:	Not reported
Bankruptcy is in effect:	Not reported
Owner Amendment Reason Code:	No Amendment
Owner Amendment Date:	Not reported
Number of Facilities reported by Owner:	0001
# Of Underground Storage Tanks:	0001
# Of Aboveground Storage Tanks:	0000
Self-Certification Date:	Not reported
Signature Name:	Not reported
Signature Title Name:	Not reported
Signature Type Text:	Not reported
Certification Submitted Type:	Not reported
Registration Self-Certification Flag:	Not reported
Fees Self-Certification Flag:	Not reported
Financial Assurance Self-Certification flag:	Not reported
Technical standards Self-Certification flag:	Not reported
UST Delivery Certificate Expiration Date:	Not reported
Operator ID:	Not reported
Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ABC AG CENTER INC (Continued)

U001287020

Operator City,St,Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	1
Unit ID:	00137270
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	08131991
Installation Date:	01011960
Tank Registration Date:	11271990
Capacity:	0000550
Tank Emptied:	Yes
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ABC AG CENTER INC (Continued)

U001287020

Compartment Other Substance:	Empty
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:

Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:

Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

G30
NE
1/8-1/4
0.236 mi.
1245 ft.

GRAVES OIL CO
123 N 7TH ST
CORSICANA, TX 75110
Site 3 of 3 in cluster G

LPST
UST

U001263078
N/A

Relative:
Lower

LPST:
Facility ID: 29518
Facility Location: 123 N 7TH
Region City ID: 4
Region City: ARLINGTON
LPST Id: 103765

Actual:
416 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Reported Date: 1992-07-07 00:00:00
Entered Date: 1992-07-13 00:00:00
Priority Description: Not reported
Status: FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator: SLR
Responsible Party Name: GRAVES BILLY
Responsible Party Contact: BILLY GRAVES
Responsible Party Address: 123 N 7TH
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: 903/874-4232

UST:

Facility ID: 0029518
Facility Type: Fleet Refueling
Name of Facility Manager: B W GRAVES
Title of Facility Manager: OWNER
Facility Manager Phone: 903-874-4232
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 064219
Owner ID: 13885
Disputed Owner: Not reported
Date Registration Form Received: 051586
Region Number: 04
Number of USTs: 10
Sign Name on Registration Form: B W GRAVES
Title of Signer of Registration Form: OWNER
Date of Signature on Registration Form: 051586
Owner Effective Begin Date: 051586

Owner ID: 13885
In Care Of: Not reported
Owner Name: GRAVES OIL CO
Owner Address: 123 N 7TH ST
Owner PO Box: Not reported
Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: B W Graves
Contact Telephone: 903-874-4232
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Contact Changed
Owner Amendment Date: 030107
Number of Facilities reported by Owner: 0001
Of Underground Storage Tanks: 0010
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Operator ID:	Not reported
Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City, St, Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	1
Unit ID:	00077926
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	01011971
Tank Registration Date:	05151986
Capacity:	0002000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	11
Unit ID:	00178969
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	12151998
Installation Date:	08311987
Tank Registration Date:	01021996
Capacity:	0002000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00077925
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	01011971
Tank Registration Date:	05151986
Capacity:	0002000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	3
Unit ID:	00077927
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	Not reported
Tank Registration Date:	05151986
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Tank ID:	4
Unit ID:	00077929
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	Not reported
Tank Registration Date:	05151986
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	5
Unit ID:	00077928
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	Not reported
Tank Registration Date:	05151986
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	6
Unit ID:	00077933
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	Not reported
Tank Registration Date:	05151986
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	7
Unit ID:	00077932
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	Not reported
Tank Registration Date:	05151986
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	8
Unit ID:	00077931
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	Not reported
Tank Registration Date:	05151986
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	9
Unit ID:	00077930

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	Not reported
Tank Registration Date:	05151986
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAVES OIL CO (Continued)

U001263078

Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:

Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:

Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

31
NNW
1/8-1/4
0.237 mi.
1253 ft.

GOODMAN SERVICE STATION
417 N COMMERCE ST
CORSICANA, TX 75110

LPST **U001241906**
UST **N/A**

Relative:
Lower

LPST:

Actual:
421 ft.

Facility ID:	5305
Facility Location:	417 N COMMERCE ST
Region City ID:	4
Region City:	ARLINGTON
LPST Id:	112621
Reported Date:	Not reported
Entered Date:	1997-09-15 00:00:00
Priority Description:	A designated major or minor groundwater aquifer is affected or immediately threatened.
Status:	FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator:	SLW
Responsible Party Name:	GOODMAN SS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOODMAN SERVICE STATION (Continued)

U001241906

Responsible Party Contact: J E FARMER
Responsible Party Address: 3449 W 2ND AVE
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: 903/874-7127

UST:

Facility ID: 0005305
Facility Type: Retail
Name of Facility Manager: GOODMAN SERV STATION
Title of Facility Manager: BUSINESS
Facility Manager Phone: 2148744862
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 043793
Owner ID: 03368
Disputed Owner: Not reported
Date Registration Form Received: 050886
Region Number: 04
Number of USTs: 1
Sign Name on Registration Form: DALE FARMER
Title of Signer of Registration Form: ASST MANAGER
Date of Signature on Registration Form: 042486
Owner Effective Begin Date: 050886

Owner ID: 03368
In Care Of: Delorise Farmer
Owner Name: GOODMAN SERVICE STATION
Owner Address: 3449 W 2ND AVE
Owner PO Box: Not reported
Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: Not reported
Contact Telephone: 2148744862
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Billing Address Changed
Owner Amendment Date: 052203
Number of Facilities reported by Owner: 0001
Of Underground Storage Tanks: 0001
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOODMAN SERVICE STATION (Continued)

U001241906

Operator Name:	Not reported
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City,St,Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	1
Unit ID:	00013258
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	09081997
Installation Date:	08311987
Tank Registration Date:	05081986
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOODMAN SERVICE STATION (Continued)

U001241906

Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Operator History:	
Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported
Owner History:	
Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

32
ENE
1/8-1/4
0.242 mi.
1276 ft.

CORSICANA PAPER & RAG CO
518 E COLLINS
CORSICANA, TX 75110

UST **U001259512**
N/A

Relative:
Lower

UST:

Actual:
415 ft.

Facility ID:	0025435
Facility Type:	Fleet Refueling
Name of Facility Manager:	GUS GAPPELBERG
Title of Facility Manager:	OWNER
Facility Manager Phone:	214-874-4681
Facility Rural Box:	Not reported
Facility in Ozone non-attainment area:	Not reported
TCEQ Num:	062055
Owner ID:	45474
Disputed Owner:	Not reported
Date Registration Form Received:	050886
Region Number:	04
Number of USTs:	1
Sign Name on Registration Form:	GUS GAPPELBERG
Title of Signer of Registration Form:	OWNER
Date of Signature on Registration Form:	041586
Owner Effective Begin Date:	083190
Owner ID:	45474
In Care Of:	MR MICHAEL H SAKS
Owner Name:	G&B RECYCLING INC
Owner Address:	140 E RIO GRANDE ST
Owner PO Box:	Not reported
Owner City,St,Zip:	EAGLE PASS, TX 78852
Owner Contact Name:	Not reported
Contact Telephone:	Not reported
Owner Type:	Corporation
Mail Undeliverable:	Not reported
Bankruptcy is in effect:	Not reported
Owner Amendment Reason Code:	Owner Address Deliverable
Owner Amendment Date:	062007
Number of Facilities reported by Owner:	0001
# Of Underground Storage Tanks:	0001
# Of Aboveground Storage Tanks:	0000
Self-Certification Date:	Not reported
Signature Name:	Not reported
Signature Title Name:	Not reported
Signature Type Text:	Not reported
Certification Submitted Type:	Not reported
Registration Self-Certification Flag:	Not reported
Fees Self-Certification Flag:	Not reported
Financial Assurance Self-Certification flag:	Not reported
Technical standards Self-Certification flag:	Not reported
UST Delivery Certificate Expiration Date:	Not reported
Operator ID:	Not reported
Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA PAPER & RAG CO (Continued)

U001259512

Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City,St,Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	1
Unit ID:	00065348
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07152001
Installation Date:	01011976
Tank Registration Date:	05081986
Capacity:	0000500
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORSICANA PAPER & RAG CO (Continued)

U001259512

Compartment Letter: A
Compartment Capacity: 0000000
Compartment Substance Stored: Gasoline
Compartment Other Substance: Not reported
Tank Release Method Detection I: Not reported
Tank Release Method Detection II: Not reported
Tank Release Method Detection III: Not reported
Other Tank Release Method Detection: Not reported
Tank Release Detection Variance: No Variance
Pipe Release Detection Method: Not reported
Pipe Release Detection Method II: Not reported
Pipe Release Detection Method III: Not reported
Other Pipe Release Detection Method: Not reported
Pipe Release Detection Variance: No Variance
Spill and Overfill Protection: Not reported
Spill and Overfill Protection II: Not reported
Spill and Overfill Protection III: Not reported
Spill Overfill Prevention Variation: No Variance

Operator History:

Operator ID: Not reported
Operator Name or Business Name: Not reported
Operator Effective Begin Date: Not reported
Operator Effective End Date: Not reported
Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:

Facility ID: 062055
Facility Number: 0025435
Customer Number: 12836
Individual Name or Business Name: CORSICANA PAPER & RAG CO
Owner Effective Begin Date: 050886
Owner Effective End Date: 083190
Owner Address: 518 E COLLINS
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: CORSICANA
Owner State: TX
Owner Zip: 75110
Owner Zip extension: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

33
NE
1/8-1/4
0.243 mi.
1283 ft.

FKI LOGISTEX INC
211 N 7TH ST
CORSICANA, TX 75110

RCRA-NonGen
FINDS
Ind. Haz Waste

1001128442
TXR000019562

Relative:
Lower

RCRA-NonGen:

Actual:
417 ft.

Date form received by agency: 12/14/2006
Facility name: FKI LOGISTEX INC
Facility address: 211 N 7TH ST
CORSICANA, TX 75110
EPA ID: TXR000019562
Mailing address: N 7TH ST
CORSICANA, TX 75110
Contact: JIM WARRINGTON
Contact address: N 7TH ST
CORSICANA, TX 75110
Contact country: US
Contact telephone: 903-874-3757
Contact email: Not reported
EPA Region: 06
Land type: Private
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: FKI LOGISTEX INC
Owner/operator address: N 7TH ST
CORSICANA, TX 75110
Owner/operator country: US
Owner/operator telephone: 903-874-3757
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 12/13/2006
Owner/Op end date: Not reported

Owner/operator name: FKI LOGISTEX INC
Owner/operator address: N 7TH ST
CORSICANA, TX 75110
Owner/operator country: US
Owner/operator telephone: 903-874-3757
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 12/13/2006
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FKI LOGISTEX INC (Continued)

1001128442

Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No
Off-site waste receiver: Commercial status unknown

Historical Generators:

Date form received by agency: 03/15/2005
Facility name: FKI LOGISTEX INC
Classification: Small Quantity Generator

Date form received by agency: 02/25/2000
Facility name: FKI LOGISTEX INC
Site name: ALVEY INC
Classification: Small Quantity Generator

Date form received by agency: 02/03/1997
Facility name: FKI LOGISTEX INC
Site name: ALVEY INC
Classification: Small Quantity Generator

Hazardous Waste Summary:

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Waste code: D006
Waste name: CADMIUM

Waste code: D008
Waste name: LEAD

Waste code: D018
Waste name: BENZENE

Waste code: D027
Waste name: 1,4-DICHLOROBENZENE

Waste code: D035
Waste name: METHYL ETHYL KETONE

Waste code: D039
Waste name: TETRACHLOROETHYLENE

Waste code: D040
Waste name: TRICHLOROETHYLENE

Waste code: F003
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FKI LOGISTEX INC (Continued)

1001128442

MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Facility Has Received Notices of Violations:

Regulation violated: FR - 335.62/262.11
Area of violation: Generators - General
Date violation determined: 07/16/1997
Date achieved compliance: 09/30/1997
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 08/22/1997
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: SR - 335.6c
Area of violation: State Statute or Regulation
Date violation determined: 07/16/1997
Date achieved compliance: 09/30/1997
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 08/22/1997
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 335.431c/268.7b4
Area of violation: LDR - General
Date violation determined: 07/16/1997
Date achieved compliance: 09/30/1997
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 08/22/1997
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 335.69f/262.34d
Area of violation: Generators - General
Date violation determined: 07/16/1997
Date achieved compliance: 09/30/1997
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FKI LOGISTEX INC (Continued)

1001128442

Enforcement action date: 08/22/1997
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 09/29/1997
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: State Statute or Regulation
Date achieved compliance: 09/30/1997
Evaluation lead agency: State

Evaluation date: 09/29/1997
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: LDR - General
Date achieved compliance: 09/30/1997
Evaluation lead agency: State

Evaluation date: 09/29/1997
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Generators - General
Date achieved compliance: 09/30/1997
Evaluation lead agency: State

Evaluation date: 07/16/1997
Evaluation: FOCUSED COMPLIANCE INSPECTION
Area of violation: LDR - General
Date achieved compliance: 09/30/1997
Evaluation lead agency: State

Evaluation date: 07/16/1997
Evaluation: FOCUSED COMPLIANCE INSPECTION
Area of violation: State Statute or Regulation
Date achieved compliance: 09/30/1997
Evaluation lead agency: State

Evaluation date: 07/16/1997
Evaluation: FOCUSED COMPLIANCE INSPECTION
Area of violation: Generators - General
Date achieved compliance: 09/30/1997
Evaluation lead agency: State

FINDS:

Registry ID: 110005176228

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FKI LOGISTEX INC (Continued)

1001128442

Texas Commission on Environmental Quality - Agency Central Registry (TX-TCEQ ACR) is a computer application that allows the Texas Commission on Environmental Quality (TCEQ) to use a single, centralized area to record common information, such as the company names, addresses, and telephone numbers of those the TCEQ regulates. It also contains additional IDs (permits, registrations, authorizations, etc) and their status.

Ind. Haz Waste:

Transporters Registration Number: 84945
Registration Initial Notification Date: 19970117
Registration Last Amendment Date: 20061213
EPA Identification: TXR000019562
Primary NAICS Code: 333993
Status Change Date: 20061213
Land Type: Not reported
Description of Facility Site Location: 211 N 7th St, Corsicana, TX
Site Primary Standard Industrial Code: 35650
Site Primary SIC Description: Packaging
Registration is Generator of Waste: Yes
Registration is Receivers of Waste: No
Registration is Transporter of Waste: No
Registration is Transfer Facility: No
Facility is STEERS Reporter: No
Required to Submit Annual Waste Summary: No
Facility Involved In Recycling: No
Revcr Has Monthly Reporting Requirement: 0
Mexican Facility: Does not represent a Maquiladora (Mexican Facility)
Facility Status: Inactive
Type of Generator: Non-industrial and/or municipal, SQG
TNRCC Region: Not reported
Company Name: FKI Logistex Inc
Contact Name: Jim Warrington
Contact Telephone Number: 903-874-3757
Mailing Address: 211 N 7th St
Mailing Address2: Not reported
Mailing City,St,Zip: Corsicana, TX 75110 4640
Mailing County: USA
Facility County: Not reported
Facility Country: USA
TNRCC Facility ID: 105079
Site Owner Tax ID: 14301572104
Site Location Latitude: Not reported
Site Location Longitude: Not reported
Last Update to NOR Data: 20061214
Ind. waste permit Number: Not reported
Mun waste permit Number: Not reported
Non Notifier: No
Year: 2010

OWNER:

Owner Mailing Address: 211 N 7th St
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: Corsicana, TX 75110 4640
Owner Country: USA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FKI LOGISTEX INC (Continued)

1001128442

Owner Phone Number: 903-874-3757
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Corporation
Owner Tax Id: 14301572104
Owner Bankruptcy Code: 0

OWNER:

Owner Mailing Address: 211 N 7th St
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: Corsicana, TX 75110 4640
Owner Country: USA
Owner Phone Number: 903-874-3757
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Corporation
Owner Tax Id: 14301572104
Owner Bankruptcy Code: 0

OWNER:

Owner Mailing Address: 211 N 7th St
Owner Mailing Address2: Not reported
Owner Mailing Address3: Not reported
Owner City,St,Zip: Corsicana, TX 75110 4640
Owner Country: USA
Owner Phone Number: 903-874-3757
Owner Fax Number: Not reported
Owner Email Address: Not reported
Owner Business Type: Corporation
Owner Tax Id: 14301572104
Owner Bankruptcy Code: 0

OPERATOR:

Operator Last Name: FKI Logistex Inc
Operator First Name: Not reported
Operator Name: FKI Logistex Inc
Operator Mailing Address: 211 N 7th St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75110 4640
Operator Country: USA
Operator Phone: 903-874-3757
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Corporation
Operator Tax Id: 14301572104
Operator Bankruptcy Code: 0

OPERATOR:

Operator Last Name: FKI Logistex Inc
Operator First Name: Not reported
Operator Name: FKI Logistex Inc
Operator Mailing Address: 211 N 7th St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75110 4640
Operator Country: USA
Operator Phone: 903-874-3757
Operator Fax: Not reported
Operator Email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FKI LOGISTEX INC (Continued)

1001128442

Operator Business Type: Corporation
Operator Tax Id: 14301572104
Operator Bankruptcy Code: 0

OPERATOR:

Operator Last Name: FKI Logistex Inc
Operator First Name: Not reported
Operator Name: FKI Logistex Inc
Operator Mailing Address: 211 N 7th St
Operator Mailing Address 2: Not reported
Operator Mailing City,St,Zip: Corsicana, TX 75110 4640
Operator Country: USA
Operator Phone: 903-874-3757
Operator Fax: Not reported
Operator Email: Not reported
Operator Business Type: Corporation
Operator Tax Id: 14301572104
Operator Bankruptcy Code: 0

CONTACT:

Contact Name: Jim Warrington
Contact Title: Materials Coordinator
Contact Role: Primary Contact
Contact Address: 211 N 7th St
Contact Address2: Not reported
Contact City,St,Zip: Corsicana, TX 75110 4640
Contact Phone: 903-874-3757
Contact Fax: Not reported
Contact Email: Not reported

CONTACT:

Contact Name: Jim Warrington
Contact Title: Materials Coordinator
Contact Role: Primary Contact
Contact Address: 211 N 7th St
Contact Address2: Not reported
Contact City,St,Zip: Corsicana, TX 75110 4640
Contact Phone: 903-874-3757
Contact Fax: Not reported
Contact Email: Not reported

CONTACT:

Contact Name: Jim Warrington
Contact Title: Materials Coordinator
Contact Role: Primary Contact
Contact Address: 211 N 7th St
Contact Address2: Not reported
Contact City,St,Zip: Corsicana, TX 75110 4640
Contact Phone: 903-874-3757
Contact Fax: Not reported
Contact Email: Not reported
Business Desc: Rebuild PalletizersRebuild PalletizersRebuild Palletizers

UNIT:

Deed Record Needed: Not reported
Deed Recording Date: Not reported
Unit No: Not reported
Unit Type Code: Not reported
Unit Type: Not reported
Unit Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FKI LOGISTEX INC (Continued)

1001128442

Unit Regulatory Status: Not reported
UIC Permit Number: Not reported
Capacity: Not reported
Capacity Measurment: Not reported
Off Site Hazardous Waste: No
Off Site Class 1 Waste: Not reported
Off Site Class 2 Waste: Not reported
Off Site Class 3 Waste: Not reported
Off Site Non Indstrl Sld Wst: Not reported
System Type Code: Not reported
System Type: Not reported
System Type Code 1: Not reported
System Type 1: Not reported
System Type Code 2: Not reported
System Type 2: Not reported
System Type Code 3: Not reported
System Type 3: Not reported
System Type Code 4: Not reported
System Type 4: Not reported
Permit Seq #: Not reported
Unit Description: Not reported
Dt Last Changed: Not reported
Waste Management: Not reported
WasteID: ,

ACTIVITY:

Activity Type Involves: Not reported
Activity Desc: Not reported

OTS:

Site Name: Not reported
One-time Shipper ID: Not reported
Location Desc: Not reported
Location Address: Not reported
Location Address 2: Not reported
Location City: Not reported
Location Zip: Not reported
Broker Name: Not reported
EPA Waste Source Code: Not reported
EPA System Type Code: Not reported
EPA Form: Not reported
EPA Waste No: Not reported
Broker Phone: Not reported
Date Processing Complete: Not reported
Date Request Sent: Not reported
Company Name: Not reported
Waste ID: Not reported
Waste Form: Not reported
Waste Class: Not reported
Waste Origin Code: Not reported
Shipment Request ID: Not reported
Waste Code Audited: Not reported

RCV:

Waste Receipts Summary Form Code: Not reported
State Manifest Documentaion Number: Not reported
Generators TX Registration Number: Not reported
Generators EPA ID: Not reported
Generators Waste Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FKI LOGISTEX INC (Continued)

1001128442

Generators Waste Classification:	Not reported
Generators Waste Form Code:	Not reported
Generators Waste Form:	Not reported
Quantity Shipped:	Not reported
Units:	Not reported
How Waste Handled by Receivers:	Not reported
Receivers Date:	Not reported
Transporters Registration Number:	Not reported
Shipment Comment:	Not reported
EPA Haz Waste:	Not reported
EPA Haz Waste:	Not reported
EPA Haz Waste:	Not reported
EPA Haz Waste:	Not reported
Receiver Name:	Not reported
Reporting method:	Not reported
No Shipmnts Recvd In Rept Period:	Not reported
Record Creation Date:	Not reported
Record Contains Error:	Not reported
Record ID:	Not reported
Co. Submitting Report:	Not reported
Authorized Agent Submitting Report:	Not reported
Authorized Agent Title:	Not reported

WASTE:

Waste ID:	00156727
Waste Desc Yr:	2010
Waste Descrptn:	Petroleum Naptha/ cleaning parts/ Date of generation 9/96
Desc of Waste:	Not reported
Texas Waste Code:	Not reported
Texas Waste Code 2:	4321203H
Waste Code Status:	Inactive
Waste Form Code:	203
Waste Form:	Non-halog
Waste Classification:	H
Waste is Radioactive:	0
Waste Treated Off Site:	1
Primary Standard Industrial Code:	35650
Standard Industrial Classification:	Packaging
Primary Source:	G09
Primary Source:	Not reported
Primary Measurement Point Code:	1
Primary Measurement Point:	Before mi
Primary Origin Code:	1
Primary Origin:	Gen. on-s
Primary System Type Code:	Not reported
Primary System Type:	Not reported
New Chemical Substance:	0
Audit Performed:	0
Company Waste ID:	Not reported
Primary NAICS Code:	333993
EPA Waste Form Code:	W203
Reason Waste Form No Longer Gen.:	Unknown
EPA Haz Waste:	Not reported

WASTE:

Waste ID:	00162282
Waste Desc Yr:	2010
Waste Descrptn:	Waste xylenes/ generating process - painting/ Date of initial

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FKI LOGISTEX INC (Continued)

1001128442

generation August 1996.

Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 0002209H
Waste Code Status: Inactive
Waste Form Code: 209
Waste Form: Organic p
Waste Classification: H
Waste is Radioactive: 0
Waste Treated Off Site: 1
Primary Standard Industrial Code: 35650
Standard Industrial Classification: Packaging
Primary Source: G06
Primary Source: Not reported
Primary Measurement Point Code: 1
Primary Measurement Point: Before mi
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: 333993
EPA Waste Form Code: W209
Reason Waste Form No Longer Gen.: Unknown
EPA Haz Waste: Not reported

WASTE:

Waste ID: 00162283
Waste Desc Yr: 2010
Waste Descriptn: Paint booth filters/ generating process- painting/ Date of initial generation August 1996.

Desc of Waste: Not reported
Texas Waste Code: Not reported
Texas Waste Code 2: 00014091
Waste Code Status: Inactive
Waste Form Code: 409
Waste Form: Other non
Waste Classification: 1
Waste is Radioactive: Not reported
Waste Treated Off Site: 1
Primary Standard Industrial Code: Not reported
Standard Industrial Classification: Not reported
Primary Source: Not reported
Primary Source: Not reported
Primary Measurement Point Code: Not reported
Primary Measurement Point: Not reported
Primary Origin Code: 1
Primary Origin: Gen. on-s
Primary System Type Code: Not reported
Primary System Type: Not reported
New Chemical Substance: 0
Audit Performed: 0
Company Waste ID: Not reported
Primary NAICS Code: Not reported
EPA Waste Form Code: Not reported
Reason Waste Form No Longer Gen.: Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FKI LOGISTEX INC (Continued)

1001128442

EPA Haz Waste: Not reported

[Click this hyperlink](#) while viewing on your computer to access additional TX IHW: detail in the EDR Site Report.

34
East
1/8-1/4
0.247 mi.
1303 ft.

ONE STOP CITGO
300 S 7TH ST
CORSICANA, TX 75110

LPST
UST
FINANCIAL ASSURANCE

U001263160
N/A

Relative:
Lower

LPST:

Actual:
415 ft.

Facility ID: 29612
Facility Location: 300 S 7TH ST
Region City ID: 4
Region City: ARLINGTON
LPST Id: 93097
Reported Date: 1989-05-01 00:00:00
Entered Date: 1989-06-13 00:00:00
Priority Description: Groundwater is affected.
Status: FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator: DMR
Responsible Party Name: WINTERS OIL CO
Responsible Party Contact: WILLIAM H WINTERS
Responsible Party Address: 1940 E 7TH AVE
Responsible Party City,St,Zip: CORSICANA, TX 75110 6902
Responsible Party Telephone: 903/872-4166

UST:

Facility ID: 0029612
Facility Type: Retail
Name of Facility Manager: PHIL JUDSON
Title of Facility Manager: PARTNER
Facility Manager Phone: 903-872-4166
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 064298
Owner ID: 13949
Disputed Owner: Not reported
Date Registration Form Received: 051286
Region Number: 04
Number of USTs: 3
Sign Name on Registration Form: W H WINTERS
Title of Signer of Registration Form: OWNER
Date of Signature on Registration Form: 050886
Owner Effective Begin Date: 051286

Owner ID: 13949
In Care Of: W H WINTERS
Owner Name: WINTERS OIL PARTNERS LP
Owner Address: Not reported
Owner PO Box: PO BOX 1637
Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: PHIL JUDSON
Contact Telephone: 903-872-4166
Owner Type: Private or Corporate
Mail Undeliverable: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ONE STOP CITGO (Continued)

U001263160

Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Billing Address Changed
Owner Amendment Date: 090104
Number of Facilities reported by Owner: 0015
Of Underground Storage Tanks: 0057
Of Aboveground Storage Tanks: 0004

Self-Certification Date: 080210
Signature Name: PHIL JUDSON
Signature Title Name: PRES
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 201109

Self-Certification Date: 080609
Signature Name: PHIL JUDSON
Signature Title Name: PARTNER
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 201009

Self-Certification Date: 080408
Signature Name: PHIL JUDSON
Signature Title Name: PARTNER
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200909

Self-Certification Date: 072607
Signature Name: PHIL JUDSON
Signature Title Name: PARTNER
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200809

Self-Certification Date: 081406
Signature Name: PHIL JUDSON
Signature Title Name: PARTNER
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ONE STOP CITGO (Continued)

U001263160

Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200709
Self-Certification Date:	090705
Signature Name:	PHIL JUDSON
Signature Title Name:	PARTNER
Signature Type Text:	Owner
Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200609
Self-Certification Date:	072904
Signature Name:	PHIL JACKSON
Signature Title Name:	PARTNER
Signature Type Text:	Owner
Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200509
Self-Certification Date:	082703
Signature Name:	W H WINTERS
Signature Title Name:	Not reported
Signature Type Text:	Owner
Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200409
Self-Certification Date:	091702
Signature Name:	W H WINTERS
Signature Title Name:	Not reported
Signature Type Text:	Owner
Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200309
Self-Certification Date:	121100
Signature Name:	W H WINTERS
Signature Title Name:	PRESIDENT
Signature Type Text:	Owner
Certification Submitted Type:	Initial
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ONE STOP CITGO (Continued)

U001263160

Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200209

Operator ID: 050038
Operator Effective Date: 103086
Operator Type: Private or Corporate
Operator First Name: Not reported
Operator Name: WINTERS OIL PARTNERS LP
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: PO BOX 1637
Operator City,St,Zip: CORSICANA, TX 75110 1637
Operator Contact Name: PHIL JUDSON
Operator Contact Title: PARTNER
Operator Contact Phone: 903-872-4166

Tank ID: 1
Unit ID: 00078152
Tank Status: **In Use**
Tank Regulatory Status: Fully Regulated
Status Date: Not reported
Installation Date: 01011977
Tank Registration Date: 05121986
Capacity: 0010000
Tank Emptied: No
Tank Construction and Containment: Single Wall
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Single Wall
Pipe Construction and Containment II: Not reported
Piping Design and Ext. Containment 3: Not reported
Piping Design and Ext. Containment 4: Not reported
Type of Piping: Pressurized
Internal Tank Lining Date: 00000000
Tank Material of Construction: FRP (fiberglass-reinforced plastic)
Other Materials of Construction: Not reported
Pipe Material of Construction: FRP (fiberglass-reinforced plastic)
Other Construction and Containment: Not reported
Pipe Connectors and Valves 1: 3
Pipe Connectors and Valves 2: 1
Pipe Connectors and Valves 3: Not reported
Tank Corrosion Protection: FRP tank or piping (noncorrodible)
Tank Corrosion Protection II: Not reported
Tank Corrosion Protection III: Not reported
Other Tank Corrosion Protection Text: Not reported
Tank Corrosion Protection Variance: No Variance
Pipe Corrosion Protection: FRP tank or piping (noncorrodible)
Pipe Corrosion Protection II: Not reported
Pipe Corrosion Protection 3: Not reported
Other Corrosion Protection: Not reported
Pipe Corrosion Protection Variance: No Variance
Stage 1 Vapor Recovery Equipment Status: Not Reported
Stage 1 Equipment Installed Date: Not reported
Stage 2 Vapor Recry Equipment Status: Not Reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ONE STOP CITGO (Continued)

U001263160

Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	080210
Compartment:	A
Self-Certification Date:	080609
Compartment:	A
Self-Certification Date:	080408
Compartment:	A
Self-Certification Date:	072607
Compartment:	A
Self-Certification Date:	121100
Compartment:	A
Self-Certification Date:	090705
Compartment:	A
Self-Certification Date:	072904
Compartment:	A
Self-Certification Date:	082703
Compartment:	A
Self-Certification Date:	091702
Compartment:	A
Self-Certification Date:	081406
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection II:	Groundwater Monitoring
Tank Release Method Detection III:	SIR (Stat. Inventory Reconciliation) and Inventory Cntr
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Groundwater Monitoring
Pipe Release Detection Method II:	Auto. Line Leak Detector (3.0 gph for pressure piping)
Pipe Release Detection Method III:	Monthly Piping Tightness Test (@0.2 gph)
Other Pipe Release Detection Method:	SIR & inv. control
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Flow Restrictor Valve
Spill and Overfill Protection II:	Factory-Built Spill Container/Bucket/Sump
Spill and Overfill Protection III:	1
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00078153
Tank Status:	In Use
Tank Regulatory Status:	Fully Regulated
Status Date:	Not reported
Installation Date:	01011977
Tank Registration Date:	05121986
Capacity:	0006000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ONE STOP CITGO (Continued)

U001263160

Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Pressurized
Internal Tank Lining Date:	00000000
Tank Material of Construction:	FRP (fiberglass-reinforced plastic
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	3
Pipe Connectors and Valves 2:	1
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	FRP tank or piping (noncorrodible)
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	FRP tank or piping (noncorrodible)
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	080210
Compartment:	A
Self-Certification Date:	080609
Compartment:	A
Self-Certification Date:	080408
Compartment:	A
Self-Certification Date:	072607
Compartment:	A
Self-Certification Date:	121100
Compartment:	A
Self-Certification Date:	090705
Compartment:	A
Self-Certification Date:	072904
Compartment:	A
Self-Certification Date:	082703
Compartment:	A
Self-Certification Date:	091702
Compartment:	A
Self-Certification Date:	081406
Compartment:	A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ONE STOP CITGO (Continued)

U001263160

Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection II:	Groundwater Monitoring
Tank Release Method Detection III:	SIR (Stat. Inventory Reconciliation) and Inventory Cntr
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Groundwater Monitoring
Pipe Release Detection Method II:	Auto. Line Leak Detector (3.0 gph for pressure piping)
Pipe Release Detection Method III:	Monthly Piping Tightness Test (@0.2 gph)
Other Pipe Release Detection Method:	SIR & inv. control
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Flow Restrictor Valve
Spill and Overfill Protection II:	Factory-Built Spill Container/Bucket/Sump
Spill and Overfill Protection III:	1
Spill Overfill Prevention Variation:	No Variance
Tank ID:	3
Unit ID:	00078151
Tank Status:	In Use
Tank Regulatory Status:	Fully Regulated
Status Date:	Not reported
Installation Date:	01011977
Tank Registration Date:	05121986
Capacity:	0004000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Pressurized
Internal Tank Lining Date:	00000000
Tank Material of Construction:	FRP (fiberglass-reinforced plastic
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	3
Pipe Connectors and Valves 2:	1
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	FRP tank or piping (noncorrodible)
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	FRP tank or piping (noncorrodible)
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ONE STOP CITGO (Continued)

U001263160

Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	080210
Compartment:	A
Self-Certification Date:	080609
Compartment:	A
Self-Certification Date:	080408
Compartment:	A
Self-Certification Date:	072607
Compartment:	A
Self-Certification Date:	121100
Compartment:	A
Self-Certification Date:	090705
Compartment:	A
Self-Certification Date:	072904
Compartment:	A
Self-Certification Date:	082703
Compartment:	A
Self-Certification Date:	091702
Compartment:	A
Self-Certification Date:	081406
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection II:	Groundwater Monitoring
Tank Release Method Detection III:	SIR (Stat. Inventory Reconciliation) and Inventory Cntrl
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Groundwater Monitoring
Pipe Release Detection Method II:	Auto. Line Leak Detector (3.0 gph for pressure piping)
Pipe Release Detection Method III:	Monthly Piping Tightness Test (@0.2 gph)
Other Pipe Release Detection Method:	SIR & inv. control
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Flow Restrictor Valve
Spill and Overfill Protection II:	Factory-Built Spill Container/Bucket/Sump
Spill and Overfill Protection III:	1
Spill Overfill Prevention Variation:	No Variance
Operator History:	
Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ONE STOP CITGO (Continued)

U001263160

Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:

Facility ID: Not reported
Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

H35
ENE
1/8-1/4
0.247 mi.
1304 ft.

SUMMERALL SERVICE STATION
221 S 7TH ST
CORSICANA, TX 75110

LPST **U001241914**
UST **N/A**

Site 2 of 2 in cluster H

Relative:
Lower

LPST:

Facility ID: 5315
Facility Location: S 7TH ST
Region City ID: 4
Region City: ARLINGTON
LPST Id: 99670
Reported Date: 1991-07-30 00:00:00
Entered Date: 1991-09-16 00:00:00
Priority Description: Groundwater is affected.

Status: FINAL CONCURRENCE PENDING DOCUMENTATION OF WELL PLUGGING

RPR Coordinator: RD2
Responsible Party Name: SUMMERALL S R MS
Responsible Party Contact: S R SUMMERALL
Responsible Party Address: 1701 WOODCREST
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: 903/874-9031

Actual:
414 ft.

UST:

Facility ID: 0005315
Facility Type: Retail
Name of Facility Manager: S R SUMMERALL
Title of Facility Manager: OWNER
Facility Manager Phone: 2148744031
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 043802
Owner ID: 03378
Disputed Owner: Not reported
Date Registration Form Received: 050886
Region Number: 04
Number of USTs: 6

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUMMERALL SERVICE STATION (Continued)

U001241914

Sign Name on Registration Form:	S R SUMMERALL
Title of Signer of Registration Form:	OWNER
Date of Signature on Registration Form:	042386
Owner Effective Begin Date:	050886
Owner ID:	03378
In Care Of:	Not reported
Owner Name:	SUMMERALL SERVICE STATION
Owner Address:	1701 WOODCREST
Owner PO Box:	Not reported
Owner City,St,Zip:	CORSICANA, TX 75110
Owner Contact Name:	Not reported
Contact Telephone:	2148744031
Owner Type:	Private or Corporate
Mail Undeliverable:	Not reported
Bankruptcy is in effect:	Not reported
Owner Amendment Reason Code:	Unknown, Migrated Data
Owner Amendment Date:	032693
Number of Facilities reported by Owner:	0001
# Of Underground Storage Tanks:	0006
# Of Aboveground Storage Tanks:	0000
Self-Certification Date:	Not reported
Signature Name:	Not reported
Signature Title Name:	Not reported
Signature Type Text:	Not reported
Certification Submitted Type:	Not reported
Registration Self-Certification Flag:	Not reported
Fees Self-Certification Flag:	Not reported
Financial Assurance Self-Certification flag:	Not reported
Technical standards Self-Certification flag:	Not reported
UST Delivery Certificate Expiration Date:	Not reported
Operator ID:	Not reported
Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City,St,Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	5
Unit ID:	00013283
Tank Status:	Permanently Filled In-Place
Tank Regulatory Status:	Fully Regulated
Status Date:	12311983
Installation Date:	01011966
Tank Registration Date:	05081986
Capacity:	0001000
Tank Emptied:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUMMERALL SERVICE STATION (Continued)

U001241914

Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Unknown
Tank Release Method Detection I:	Vapor Monitoring
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUMMERALL SERVICE STATION (Continued)

U001241914

Spill Overfill Prevention Variation:	No Variance
Tank ID:	1
Unit ID:	00013287
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07191991
Installation Date:	01011966
Tank Registration Date:	05081986
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Suction
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUMMERALL SERVICE STATION (Continued)

U001241914

Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00013286
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07191991
Installation Date:	01011966
Tank Registration Date:	05081986
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Suction
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUMMERALL SERVICE STATION (Continued)

U001241914

Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	3
Unit ID:	00013285
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07191991
Installation Date:	01011966
Tank Registration Date:	05081986
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Suction
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUMMERALL SERVICE STATION (Continued)

U001241914

Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Diesel
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	4
Unit ID:	00013284
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07191991
Installation Date:	01011966
Tank Registration Date:	05081986
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Suction
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUMMERALL SERVICE STATION (Continued)

U001241914

Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	6
Unit ID:	00013282
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07191991
Installation Date:	Not reported
Tank Registration Date:	05081986
Capacity:	0000250
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUMMERALL SERVICE STATION (Continued)

U001241914

Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Used Oil
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUMMERALL SERVICE STATION (Continued)

U001241914

Operator History:

Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:

Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

36
North
1/8-1/4
0.250 mi.
1318 ft.

FORMER WHITESELLE LUMBER CO
301 E 3RD AVE
CORSICANA, TX 75110

UST U003732973
N/A

Relative:
Lower

UST:

Facility ID:	0073213
Facility Type:	Fleet Refueling
Name of Facility Manager:	Billy Butler
Title of Facility Manager:	Not reported
Facility Manager Phone:	903-695-2732
Facility Rural Box:	Not reported
Facility in Ozone non-attainment area:	Not reported
TCEQ Num:	111532
Owner ID:	55911
Disputed Owner:	Not reported
Date Registration Form Received:	052700
Region Number:	04
Number of USTs:	1
Sign Name on Registration Form:	Sam Bacon
Title of Signer of Registration Form:	Consultant
Date of Signature on Registration Form:	051700
Owner Effective Begin Date:	083187
Owner ID:	55911
In Care Of:	Not reported
Owner Name:	BUTLER BILLY

Actual:
417 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER WHITESELLE LUMBER CO (Continued)

U003732973

Owner Address: 301 E 3RD AVE
Owner PO Box: Not reported
Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: Billy Butler
Contact Telephone: 903-695-2732
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Billing Address Changed
Owner Amendment Date: 121602
Number of Facilities reported by Owner: 0001
Of Underground Storage Tanks: 0001
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported
Operator Name: Not reported
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: Not reported
Operator City,St,Zip: Not reported
Operator Contact Name: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported

Tank ID: 1
Unit ID: 00194307
Tank Status: **Removed from the Ground**
Tank Regulatory Status: Exempt Remv'd w/i 60 days
Status Date: 05162000
Installation Date: 08311987
Tank Registration Date: 05272000
Capacity: 0002000
Tank Emptied: No
Tank Construction and Containment: Single Wall
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Single Wall
Pipe Construction and Containment II: Not reported
Piping Design and Ext. Containment 3: Not reported
Piping Design and Ext. Containment 4: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER WHITESELLE LUMBER CO (Continued)

U003732973

Type of Piping:	Suction
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported

Self-Certification Date:	Not reported
Compartment:	Not reported

Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:	
Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FORMER WHITESELLE LUMBER CO (Continued)

U003732973

Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:

Facility ID: Not reported
Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

37
NNE
1/4-1/2
0.272 mi.
1437 ft.

NATIONAL INCINERATOR
305 NORTH 7TH STREET
CORSICANA, TX 75110

VCP S108273192
N/A

Relative:
Lower

VCP TCEQ:

Actual:
418 ft.

Region: 4
Facility ID: 2004
Facility Type: Steel Production Plant
VCP Received: 11/27/2006
PCA Number: 34201
Project Number: Ciampi
Type Lead: Owner
Phase: Completed
Lat/Long: Not reported
Lat/Long (DD): 35.05563999999997 / -96.27434999999998
Acres at Site: 5.774
Contaminant Categories: Metals
Media Affected: Soils
Applicant: Halax Properties, LLC
Applicant Contact Title: Vice President
Applicant Address: 6020 Osborn
Applicant City,St,Zip: Houston, TX 77033
Applicant Phone: 713-645-2858
Applicant Fax: 713-645-1756
Consultant/Attorney: W&M Environmental Group, Inc.
Consultant/Attorney Name: Andy Adams
Consultant/Attorney Contact Title: Consultant
Consultant/Attorney Address: 906 East 18th Street, Suite 100
Consultant/Attorney City,St,Zip: Plano, TX 75074
Consultant/Attorney Phone: 972-516-0300
Consultant/Attorney Fax: 972-516-4145
TNRCC Solid Waste Registration: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL INCINERATOR (Continued)

S108273192

EPA Texas ID/CERCLIS Registration: Not reported
EPA Registration: Not reported
Application Signed By Applicant: 2/5/2007
Standards: A
TX Risk Reduction Prgm: 2
Institutional Controls: Not reported
Certificate of Completion: 3/13/2008
Remedy Type: Not reported
Risk Reduction or Petroleum Storage Tank: TRRP
Leaking Petroleum Storage Registration Tank: Not reported

38
WNW
1/4-1/2
0.326 mi.
1720 ft.

NAVARRO COUNTY SHERIFFS OFFICE
300 W 2ND AVE
CORSICANA, TX 75110

LPST U001278429
UST N/A

Relative:
Higher

LPST:

Actual:
442 ft.

Facility ID: 47074
Facility Location: 300 W 2ND AVE
Region City ID: 4
Region City: ARLINGTON
LPST Id: 112322
Reported Date: Not reported
Entered Date: 1997-05-19 00:00:00
Priority Description: Groundwater is affected.
Status: FINAL CONCURRENCE PENDING DOCUMENTATION OF WELL PLUGGING
RPR Coordinator: ML2
Responsible Party Name: NAVARRO COUNTY
Responsible Party Contact: PAULA TUELOS
Responsible Party Address: 300 W 3RD ST
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: 903/654-3097

UST:

Facility ID: 0047074
Facility Type: Not reported
Name of Facility Manager: JIM HODGE
Title of Facility Manager: SHERIFF
Facility Manager Phone: 2146543002
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 078358
Owner ID: 23754
Disputed Owner: Not reported
Date Registration Form Received: 010189
Region Number: 04
Number of USTs: 2
Sign Name on Registration Form: SAME
Title of Signer of Registration Form: NA
Date of Signature on Registration Form: 122788
Owner Effective Begin Date: 010189

Owner ID: 23754
In Care Of: SHERIFF
Owner Name: NAVARRO COUNTY
Owner Address: 312 W 2ND

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NAVARRO COUNTY SHERIFFS OFFICE (Continued)

U001278429

Owner PO Box: Not reported
Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: Not reported
Contact Telephone: 214-654-3002
Owner Type: Local Government
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Name Changed
Owner Amendment Date: 021203
Number of Facilities reported by Owner: 0001
Of Underground Storage Tanks: 0002
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported
Operator Name: Not reported
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: Not reported
Operator City,St,Zip: Not reported
Operator Contact Name: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported

Tank ID: 1
Unit ID: 00122958
Tank Status: **Removed from the Ground**
Tank Regulatory Status: Fully Regulated
Status Date: 05011997
Installation Date: 01011989
Tank Registration Date: 01011989
Capacity: 0006000
Tank Emptied: No
Tank Construction and Containment: Not reported
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Not reported
Pipe Construction and Containment II: Not reported
Piping Design and Ext. Containment 3: Not reported
Piping Design and Ext. Containment 4: Not reported
Type of Piping: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NAVARRO COUNTY SHERIFFS OFFICE (Continued)

U001278429

Internal Tank Lining Date:	00000000
Tank Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	FRP tank or piping (noncorrodible)
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported

Self-Certification Date:	Not reported
Compartment:	Not reported

Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Tank ID:	2
Unit ID:	00122957
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	05011997
Installation Date:	01011989
Tank Registration Date:	01011989

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NAVARRO COUNTY SHERIFFS OFFICE (Continued)

U001278429

Capacity:	0000500
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	COATED BLACK IRON
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	FRP tank or piping (noncorrodible)
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Cathodic Protection
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Cathodic Protection
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Diesel
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NAVARRO COUNTY SHERIFFS OFFICE (Continued)

U001278429

Spill and Overfill Protection II: Not reported
Spill and Overfill Protection III: Not reported
Spill Overfill Prevention Variation: No Variance

Operator History:

Operator ID: Not reported
Operator Name or Business Name: Not reported
Operator Effective Begin Date: Not reported
Operator Effective End Date: Not reported
Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:

Facility ID: Not reported
Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

39
ESE
1/4-1/2
0.330 mi.
1744 ft.

VACANT LOT
521 S 7TH ST
CORSICANA, TX 75110

LPST **U001246728**
UST **N/A**

Relative:
Lower

LPST:

Actual:
416 ft.

Facility ID: 10701
Facility Location: 521 S 7TH ST
Region City ID: 4
Region City: ARLINGTON
LPST Id: 93217
Reported Date: 1989-06-15 00:00:00
Entered Date: 1989-07-06 00:00:00
Priority Description: Groundwater is affected.
Status: FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator: HJM
Responsible Party Name: HARMAN NELL & OTHERS
Responsible Party Contact: SALLY R KELLY
Responsible Party Address: 606 SALERNO
Responsible Party City,St,Zip: SUGARLAND, TX 77478
Responsible Party Telephone: 713/494-2691

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VACANT LOT (Continued)

U001246728

UST:

Facility ID:	0010701
Facility Type:	Other
Name of Facility Manager:	\$
Title of Facility Manager:	Not reported
Facility Manager Phone:	2148742242
Facility Rural Box:	Not reported
Facility in Ozone non-attainment area:	Not reported
TCEQ Num:	087391
Owner ID:	32008
Disputed Owner:	Not reported
Date Registration Form Received:	050886
Region Number:	04
Number of USTs:	1
Sign Name on Registration Form:	G ST CLAIR
Title of Signer of Registration Form:	CAR SALESMAN
Date of Signature on Registration Form:	041686
Owner Effective Begin Date:	050886
Owner ID:	32008
In Care Of:	Not reported
Owner Name:	W A HARMAN SALLY KELLY & OTHER
Owner Address:	Not reported
Owner PO Box:	PO BOX 395
Owner City,St,Zip:	SUGAR LAND, TX 77487
Owner Contact Name:	MRS W A HARMAN
Contact Telephone:	Not reported
Owner Type:	Private or Corporate
Mail Undeliverable:	Not reported
Bankruptcy is in effect:	Not reported
Owner Amendment Reason Code:	Owner Name Changed
Owner Amendment Date:	101001
Number of Facilities reported by Owner:	0001
# Of Underground Storage Tanks:	0001
# Of Aboveground Storage Tanks:	0000
Self-Certification Date:	Not reported
Signature Name:	Not reported
Signature Title Name:	Not reported
Signature Type Text:	Not reported
Certification Submitted Type:	Not reported
Registration Self-Certification Flag:	Not reported
Fees Self-Certification Flag:	Not reported
Financial Assurance Self-Certification flag:	Not reported
Technical standards Self-Certification flag:	Not reported
UST Delivery Certificate Expiration Date:	Not reported
Operator ID:	Not reported
Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VACANT LOT (Continued)

U001246728

Operator City,St,Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	1
Unit ID:	00028145
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	09051991
Installation Date:	01011981
Tank Registration Date:	05081986
Capacity:	0000500
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Not reported
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

VACANT LOT (Continued)

U001246728

Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:

Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:

Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

J40
ESE
1/4-1/2
0.362 mi.
1910 ft.

RALPH RICHARDS
601 S 7TH
CORSICANA, TX 75110

Site 1 of 2 in cluster J

LPST **U001274124**
UST **N/A**

Relative: **LPST:**
Lower Facility ID: 41795
Facility Location: 601 7TH ST
Region City ID: 4
Region City: ARLINGTON
LPST Id: 93096

Actual:
416 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RALPH RICHARDS (Continued)

U001274124

Reported Date: 1989-05-12 00:00:00
Entered Date: 1989-06-12 00:00:00
Priority Description: Not reported
Status: FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator: ANNE MILLER
Responsible Party Name: RICHARDS RALPH
Responsible Party Contact: RALPH RICHARDS
Responsible Party Address: PO BOX 294
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: /-

UST:

Facility ID: 0041795
Facility Type: Retail
Name of Facility Manager: RALPH RICHARDS
Title of Facility Manager: OWNER
Facility Manager Phone: 2148748521
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 071226
Owner ID: 19307
Disputed Owner: Not reported
Date Registration Form Received: 050886
Region Number: 04
Number of USTs: 5
Sign Name on Registration Form: RALPH RICHARDS
Title of Signer of Registration Form: OWNER
Date of Signature on Registration Form: 043086
Owner Effective Begin Date: 050886

Owner ID: 19307
In Care Of: Not reported
Owner Name: RICHARDS
Owner Address: Not reported
Owner PO Box: PO BOX 294
Owner City,St,Zip: CORSICANA, TX 75151
Owner Contact Name: Not reported
Contact Telephone: 214-874-8521
Owner Type: Individual
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Unknown, Migrated Data
Owner Amendment Date: 011202
Number of Facilities reported by Owner: 0001
Of Underground Storage Tanks: 0005
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RALPH RICHARDS (Continued)

U001274124

Operator ID:	Not reported
Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City, St, Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	5
Unit ID:	00110685
Tank Status:	Permanently Filled In-Place
Tank Regulatory Status:	Fully Regulated
Status Date:	01311968
Installation Date:	01011954
Tank Registration Date:	05081986
Capacity:	0000500
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RALPH RICHARDS (Continued)

U001274124

Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Used Oil
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	1
Unit ID:	00110684
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	03301990
Installation Date:	01011971
Tank Registration Date:	05081986
Capacity:	0003000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RALPH RICHARDS (Continued)

U001274124

Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00110683
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	03301990
Installation Date:	01011971
Tank Registration Date:	05081986
Capacity:	0003000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RALPH RICHARDS (Continued)

U001274124

Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	3
Unit ID:	00110687
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	03301990
Installation Date:	01011971
Tank Registration Date:	05081986
Capacity:	0002000
Tank Emptied:	No
Tank Construction and Containment:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RALPH RICHARDS (Continued)

U001274124

Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RALPH RICHARDS (Continued)

U001274124

Tank ID:	4
Unit ID:	00110686
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	03301990
Installation Date:	01011974
Tank Registration Date:	05081986
Capacity:	0000500
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Used Oil
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RALPH RICHARDS (Continued)

U001274124

Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:

Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:

Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

J41
ESE
1/4-1/2
0.363 mi.
1918 ft.

THE FRIENDLY STORE
628 S 7TH
CORSICANA, TX 75110

Site 2 of 2 in cluster J

LPST **U001286481**
UST **N/A**

Relative:
Lower

LPST:

Actual:
416 ft.

Facility ID:	56426
Facility Location:	628 S 7TH ST
Region City ID:	4
Region City:	ARLINGTON
LPST Id:	96710
Reported Date:	1990-09-17 00:00:00
Entered Date:	1990-09-17 00:00:00
Priority Description:	Groundwater is affected.
Status:	FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator:	RWD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE FRIENDLY STORE (Continued)

U001286481

Responsible Party Name: THOMAS JACK
Responsible Party Contact: JACK THOMAS
Responsible Party Address: PO BOX 88
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: 903/872-4950

UST:

Facility ID: 0056426
Facility Type: Retail
Name of Facility Manager: JACKIE THOMAS
Title of Facility Manager: Not reported
Facility Manager Phone: 903-872-4950
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 086225
Owner ID: 30972
Disputed Owner: Not reported
Date Registration Form Received: 101890
Region Number: 04
Number of USTs: 3
Sign Name on Registration Form: JACKIE THOMAS
Title of Signer of Registration Form: OWNER
Date of Signature on Registration Form: 101290
Owner Effective Begin Date: 101890

Owner ID: 30972
In Care Of: Not reported
Owner Name: THOMAS JACKIE
Owner Address: Not reported
Owner PO Box: PO BOX 88
Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: JACKIE THOMAS
Contact Telephone: 903-872-4950
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Name Changed
Owner Amendment Date: 100801
Number of Facilities reported by Owner: 0001
Of Underground Storage Tanks: 0003
Of Aboveground Storage Tanks: 0000

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE FRIENDLY STORE (Continued)

U001286481

Operator First Name:	Not reported
Operator Name:	Not reported
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City, St, Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	1
Unit ID:	00136343
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	09111996
Installation Date:	01011983
Tank Registration Date:	10181990
Capacity:	0006000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Non Corrodible Material
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE FRIENDLY STORE (Continued)

U001286481

Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Groundwater Monitoring
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00136341
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	09111996
Installation Date:	01011983
Tank Registration Date:	10181990
Capacity:	0006000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Non Corrodible Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE FRIENDLY STORE (Continued)

U001286481

Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Groundwater Monitoring
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	3
Unit ID:	00136342
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	09111996
Installation Date:	01011983
Tank Registration Date:	10181990
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Not reported
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE FRIENDLY STORE (Continued)

U001286481

Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Non Corrodible Material
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Groundwater Monitoring
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Operator History:	
Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE FRIENDLY STORE (Continued)

U001286481

Owner History:

Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

42
NNW
1/4-1/2
0.364 mi.
1924 ft.

STEWART MOTOR
600 N BEATON
CORSICANA, TX 75110

LPST **S105121886**
N/A

Relative:
Lower

LPST:

Actual:
423 ft.

Facility ID:	Not reported
Facility Location:	N BEATON
Region City ID:	4
Region City:	ARLINGTON
LPST Id:	95414
Reported Date:	1990-03-29 00:00:00
Entered Date:	1990-05-09 00:00:00
Priority Description:	Groundwater is affected.
Status:	FINAL CONCURRENCE PENDING DOCUMENTATION OF WELL PLUGGING
RPR Coordinator:	ELM
Responsible Party Name:	WINTERS OIL CO
Responsible Party Contact:	WILLIAM H WINTERS
Responsible Party Address:	1940 E 7TH AVE
Responsible Party City,St,Zip:	CORSICANA, TX 75110 6902
Responsible Party Telephone:	903/872-4166

K43
South
1/4-1/2
0.371 mi.
1960 ft.

CITY OF CORSICANA
620 S 12TH ST
CORSICANA, TX 75110

LPST **U001269642**
UST **N/A**
FINANCIAL ASSURANCE

Site 1 of 2 in cluster K

Relative:
Lower

LPST:

Actual:
420 ft.

Facility ID:	36805
Facility Location:	600 S 12TH ST
Region City ID:	4
Region City:	ARLINGTON
LPST Id:	92584
Reported Date:	1989-01-19 00:00:00
Entered Date:	1989-02-09 00:00:00
Priority Description:	Not reported
Status:	FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator:	RPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Responsible Party Name: CITY OF CORSICANA
Responsible Party Contact: CRAIG LONON
Responsible Party Address: PO BOX 626
Responsible Party City,St,Zip: CORSICANA, TX 75116
Responsible Party Telephone: 903/872-4811

UST:

Facility ID: 0036805
Facility Type: Fleet Refueling
Name of Facility Manager: JARRETT SOUTHARD
Title of Facility Manager: SUPERVISOR
Facility Manager Phone: 903-654-4893
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 048844
Owner ID: 04258
Disputed Owner: Not reported
Date Registration Form Received: 050886
Region Number: 04
Number of USTs: 7
Sign Name on Registration Form: LARRY DEMOSS
Title of Signer of Registration Form: DIR PUBLIC WORKS
Date of Signature on Registration Form: 042286
Owner Effective Begin Date: 050886

Owner ID: 04258
In Care Of: Not reported
Owner Name: CITY OF CORSICANA
Owner Address: 200 N 12TH ST
Owner PO Box: Not reported
Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: JARRETT SOUTHARD
Contact Telephone: 903-654-4893
Owner Type: Local Government
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Billing Address Changed
Owner Amendment Date: 082207
Number of Facilities reported by Owner: 0002
Of Underground Storage Tanks: 0009
Of Aboveground Storage Tanks: 0001

Self-Certification Date: 062309
Signature Name: RON LYNCH
Signature Title Name: DIR PUB WKS
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 201008

Self-Certification Date: 071708
Signature Name: RON LYNCH
Signature Title Name: DIR OF PUBLIC WORKS
Signature Type Text: Owner

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200908

Self-Certification Date: 080207
Signature Name: RON LYNCH
Signature Title Name: DIR OF PUBLIC WORKS
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200808

Self-Certification Date: 062506
Signature Name: RON LYNCH
Signature Title Name: DIR PUBLIC WORKS
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200708

Self-Certification Date: 062405
Signature Name: JERRY D SCRUGGS
Signature Title Name: SUPERVISOR
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200608

Self-Certification Date: 062304
Signature Name: JERRY D SCRUGGS
Signature Title Name: SUPERVISOR
Signature Type Text: Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes
Fees Self-Certification Flag: Yes
Financial Assurance Self-Certification flag: Yes
Technical standards Self-Certification flag: Yes
UST Delivery Certificate Expiration Date: 200508

Self-Certification Date: 063003
Signature Name: JERRY D SCRUGGS
Signature Title Name: SUPER
Signature Type Text: Legally-Authorized Rep of Owner
Certification Submitted Type: Annual renewal
Registration Self-Certification Flag: Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200408
Self-Certification Date:	071802
Signature Name:	RON LYNCH
Signature Title Name:	Not reported
Signature Type Text:	Legally-Authorized Rep of Owner
Certification Submitted Type:	Annual renewal
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200308
Self-Certification Date:	092100
Signature Name:	JERRY D SCRUGGS
Signature Title Name:	DIV MGR
Signature Type Text:	Legally-Authorized Rep of Owner
Certification Submitted Type:	Initial
Registration Self-Certification Flag:	Yes
Fees Self-Certification Flag:	Yes
Financial Assurance Self-Certification flag:	Yes
Technical standards Self-Certification flag:	Yes
UST Delivery Certificate Expiration Date:	200208
Operator ID:	042357
Operator Effective Date:	122986
Operator Type:	Local Government
Operator First Name:	Not reported
Operator Name:	CITY OF CORSICANA
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	200 N 12TH ST
Operator PO Box:	Not reported
Operator City,St,Zip:	CORSICANA, TX 75110
Operator Contact Name:	JARRETT SOUTHARD
Operator Contact Title:	SUP
Operator Contact Phone:	903-654-4893
Tank ID:	1
Unit ID:	00097361
Tank Status:	In Use
Tank Regulatory Status:	Fully Regulated
Status Date:	Not reported
Installation Date:	07011989
Tank Registration Date:	05081986
Capacity:	0012000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Pressurized
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Composite (steel w/external FRP cladding)
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	3
Pipe Connectors and Valves 2:	1
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Cathodic Protection - Field Installation
Tank Corrosion Protection II:	External nonmetallic jacket
Tank Corrosion Protection III:	Composite Tank (steel w/FRP external laminate)
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	FRP tank or piping (noncorrodible)
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	062309
Compartment:	A
Self-Certification Date:	071708
Compartment:	A
Self-Certification Date:	080207
Compartment:	A
Self-Certification Date:	062506
Compartment:	A
Self-Certification Date:	092100
Compartment:	A
Self-Certification Date:	062304
Compartment:	A
Self-Certification Date:	063003
Compartment:	A
Self-Certification Date:	071802
Compartment:	A
Self-Certification Date:	062405
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Annual Piping Tightness Test (@0.1 gph)
Pipe Release Detection Method II:	Auto. Line Leak Detector (3.0 gph for pressure piping)
Pipe Release Detection Method III:	Monthly Piping Tightness Test (@0.2 gph)
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Delivery Shut-off Valve
Spill and Overfill Protection II:	Factory-Built Spill Container/Bucket/Sump
Spill and Overfill Protection III:	1
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00097360
Tank Status:	In Use
Tank Regulatory Status:	Fully Regulated
Status Date:	Not reported
Installation Date:	05011990
Tank Registration Date:	05081986
Capacity:	0006000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Pressurized
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Composite (steel w/external FRP cladding)
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	3
Pipe Connectors and Valves 2:	1
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Isolated in Open Area
Tank Corrosion Protection II:	Cathodic Protection - Field Installation
Tank Corrosion Protection III:	Composite Tank (steel w/FRP external laminate)
Other Tank Corrosion Protection Text:	External Nonmetallic Jacket
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Isolated in Open Area
Pipe Corrosion Protection II:	FRP tank or piping (noncorrodible)
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Self-Certification Date:	062309
Compartment:	A
Self-Certification Date:	071708
Compartment:	A
Self-Certification Date:	080207
Compartment:	A
Self-Certification Date:	062506
Compartment:	A
Self-Certification Date:	092100
Compartment:	A
Self-Certification Date:	062304
Compartment:	A
Self-Certification Date:	063003
Compartment:	A
Self-Certification Date:	071802
Compartment:	A
Self-Certification Date:	062405
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Diesel
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Automatic Tank Gauge Test and Inventory Cntrl
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Annual Piping Tightness Test (@0.1 gph)
Pipe Release Detection Method II:	Auto. Line Leak Detector (3.0 gph for pressure piping)
Pipe Release Detection Method III:	Monthly Piping Tightness Test (@0.2 gph)
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Auto. Delivery Shut-off Valve
Spill and Overfill Protection II:	Factory-Built Spill Container/Bucket/Sump
Spill and Overfill Protection III:	1
Spill Overfill Prevention Variation:	No Variance
Tank ID:	4
Unit ID:	00097359
Tank Status:	Permanently Filled In-Place
Tank Regulatory Status:	Fully Regulated
Status Date:	01011979
Installation Date:	01011961
Tank Registration Date:	05081986
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Empty
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	5
Unit ID:	00097358
Tank Status:	Permanently Filled In-Place
Tank Regulatory Status:	Fully Regulated
Status Date:	01011979
Installation Date:	01011961
Tank Registration Date:	05081986
Capacity:	0000600

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Empty
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	1
Unit ID:	00097355
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07011989
Installation Date:	01011973
Tank Registration Date:	05081986
Capacity:	0010000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	062309
Compartment:	A
Self-Certification Date:	071708
Compartment:	A
Self-Certification Date:	080207
Compartment:	A
Self-Certification Date:	062506
Compartment:	A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Self-Certification Date:	092100
Compartment:	A
Self-Certification Date:	062304
Compartment:	A
Self-Certification Date:	063003
Compartment:	A
Self-Certification Date:	071802
Compartment:	A
Self-Certification Date:	062405
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00097357
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	07011989
Installation Date:	01011973
Tank Registration Date:	05081986
Capacity:	0010000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	FRP (fiberglass-reinforced plastic)
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	062309
Compartment:	A
Self-Certification Date:	071708
Compartment:	A
Self-Certification Date:	080207
Compartment:	A
Self-Certification Date:	062506
Compartment:	A
Self-Certification Date:	092100
Compartment:	A
Self-Certification Date:	062304
Compartment:	A
Self-Certification Date:	063003
Compartment:	A
Self-Certification Date:	071802
Compartment:	A
Self-Certification Date:	062405
Compartment:	A
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Tank ID:	3
Unit ID:	00097356
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	05011990
Installation Date:	01011980
Tank Registration Date:	05081986
Capacity:	0006000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	Not reported
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	Not reported
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Diesel
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA (Continued)

U001269642

Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	Not reported
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:

Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:

Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

K44
South
1/4-1/2
0.371 mi.
1960 ft.

CITY OF CORSICANA SERVICE CENTER
620 S 12TH ST
CORSICANA, TX 75110
Site 2 of 2 in cluster K

LPST S106619710
N/A

Relative:
Lower

LPST:

Actual:
420 ft.

Facility ID:	36805
Facility Location:	600 S 12th is incorrect according to RP
Region City ID:	4
Region City:	ARLINGTON
LPST Id:	95424
Reported Date:	1990-03-30 00:00:00
Entered Date:	1990-05-09 00:00:00
Priority Description:	The vertical extent of contamination has been defined and the assessment results document that groundwater is not affected.
Status:	FINAL CONCURRENCE PENDING DOCUMENTATION OF WELL PLUGGING

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF CORSICANA SERVICE CENTER (Continued)

S106619710

RPR Coordinator: ML2
Responsible Party Name: CITY OF CORSICANA
Responsible Party Contact: JERRY SCRUGGS
Responsible Party Address: 620 S 12TH
Responsible Party City,St,Zip: CORSICANA, TX
Responsible Party Telephone: 214/872-4811

45
SW
1/4-1/2
0.389 mi.
2056 ft.

OLD MOBIL SERVICE STATION
601 W 7TH AVE
CORSICANA, TX 75110

LPST
UST
FINANCIAL ASSURANCE

U002262743
N/A

Relative:
Higher

LPST:

Facility ID: 67218
Facility Location: 601 W 7TH
Region City ID: 4
Region City: ARLINGTON
LPST Id: 113661
Reported Date: 1998-11-16 00:00:00
Entered Date: 1998-11-17 00:00:00
Priority Description: Groundwater is affected.
Status: FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator: MAO
Responsible Party Name: STALWORTH CORP
Responsible Party Contact: JACK CULPEPPER
Responsible Party Address: 1700 E GEORGE BUSH DR STE 240
Responsible Party City,St,Zip: COLLEGE STATION, TX 77840
Responsible Party Telephone: 979/696-1444

Actual:
430 ft.

UST:

Facility ID: 0067218
Facility Type: Retail
Name of Facility Manager: Richard Parker
Title of Facility Manager: Not reported
Facility Manager Phone: 903-874-1121
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 101661
Owner ID: 46838
Disputed Owner: Not reported
Date Registration Form Received: 102595
Region Number: 04
Number of USTs: 3
Sign Name on Registration Form: Richard C Parker
Title of Signer of Registration Form: Partner
Date of Signature on Registration Form: 101995
Owner Effective Begin Date: 083187

Owner ID: 46838
In Care Of: Not reported
Owner Name: CORSICANA INVESTMENTS LTD
Owner Address: 615 W 7TH Ave
Owner PO Box: Not reported
Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: Richard Parker
Contact Telephone: 903-874-1121

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD MOBIL SERVICE STATION (Continued)

U002262743

Owner Type:	Private or Corporate
Mail Undeliverable:	Not reported
Bankruptcy is in effect:	Not reported
Owner Amendment Reason Code:	Unknown, Migrated Data
Owner Amendment Date:	011202
Number of Facilities reported by Owner:	0001
# Of Underground Storage Tanks:	0003
# Of Aboveground Storage Tanks:	0000

Self-Certification Date:	Not reported
Signature Name:	Not reported
Signature Title Name:	Not reported
Signature Type Text:	Not reported
Certification Submitted Type:	Not reported
Registration Self-Certification Flag:	Not reported
Fees Self-Certification Flag:	Not reported
Financial Assurance Self-Certification flag:	Not reported
Technical standards Self-Certification flag:	Not reported
UST Delivery Certificate Expiration Date:	Not reported

Operator ID:	Not reported
Operator Effective Date:	Not reported
Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City, St, Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported

Tank ID:	1
Unit ID:	00176074
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	08311987
Installation Date:	08311987
Tank Registration Date:	10251995
Capacity:	0001000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD MOBIL SERVICE STATION (Continued)

U002262743

Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00176075
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	08311987
Installation Date:	08311987
Tank Registration Date:	10251995
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD MOBIL SERVICE STATION (Continued)

U002262743

Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Gasoline
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD MOBIL SERVICE STATION (Continued)

U002262743

Tank ID:	3
Unit ID:	00176076
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	08311987
Installation Date:	08311987
Tank Registration Date:	10251995
Capacity:	0000000
Tank Emptied:	No
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Concrete
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Used Oil
Compartment Other Substance:	Not reported
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD MOBIL SERVICE STATION (Continued)

U002262743

Tank Release Detection Variance: No Variance
Pipe Release Detection Method: Not reported
Pipe Release Detection Method II: Not reported
Pipe Release Detection Method III: Not reported
Other Pipe Release Detection Method: None
Pipe Release Detection Variance: No Variance
Spill and Overfill Protection: Not reported
Spill and Overfill Protection II: Not reported
Spill and Overfill Protection III: Not reported
Spill Overfill Prevention Variation: No Variance

Operator History:

Operator ID: Not reported
Operator Name or Business Name: Not reported
Operator Effective Begin Date: Not reported
Operator Effective End Date: Not reported
Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:

Facility ID: Not reported
Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

46
South
1/4-1/2
0.429 mi.
2263 ft.

SPTCO PROPERTY
11TH & 12TH ST
CORSICANA, TX 75110

LPST **U001286202**
UST **N/A**

Relative:
Lower

LPST:

Actual:
420 ft.

Facility ID: 56165
Facility Location: S OF HWY 31 BETWEEN 11TH & 12TH STREETS
Region City ID: 4
Region City: ARLINGTON
LPST Id: 95510
Reported Date: 1990-05-16 00:00:00
Entered Date: 1990-05-16 00:00:00
Priority Description: The vertical extent of contamination has been defined and the assessment results document that groundwater is not affected.
Status: **FINAL CONCURRENCE ISSUED, CASE CLOSED**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPTCO PROPERTY (Continued)

U001286202

RPR Coordinator: RPR
Responsible Party Name: UNION PACIFIC RAILROAD
Responsible Party Contact: CRAIG DENNY
Responsible Party Address: 1416 DODGE ST RM 930
Responsible Party City,St,Zip: OMAHA, NE 68179
Responsible Party Telephone: 402/271-3248

UST:

Facility ID: 0056165
Facility Type: Retail
Name of Facility Manager: RICHARD COLEMAN
Title of Facility Manager: PROPERTY MANAGER
Facility Manager Phone: 2147704321
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 047353
Owner ID: 04112
Disputed Owner: Not reported
Date Registration Form Received: 072090
Region Number: 04
Number of USTs: 1
Sign Name on Registration Form: PATRICIA CURL
Title of Signer of Registration Form: SPEVS REG COORD.
Date of Signature on Registration Form: 071690
Owner Effective Begin Date: 072090

Owner ID: 04112
In Care Of: Not reported
Owner Name: SOUTHERN PACIFIC TRANSPORTATION COMPANY
Owner Address: 1416 DODGE ST
Owner PO Box: Not reported
Owner City,St,Zip: OMAHA, NE 68179
Owner Contact Name: Steve McNaughton
Contact Telephone: 402-271-2219
Owner Type: Common Carrier Railroad
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Name Changed
Owner Amendment Date: 031803
Number of Facilities reported by Owner: 0087
Of Underground Storage Tanks: 0178
Of Aboveground Storage Tanks: 0010

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPTCO PROPERTY (Continued)

U001286202

Operator Type:	Not reported
Operator First Name:	Not reported
Operator Name:	Not reported
Operator Building Loc:	Not reported
Operator Telephone:	Not reported
Operator Address:	Not reported
Operator PO Box:	Not reported
Operator City,St,Zip:	Not reported
Operator Contact Name:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Tank ID:	1
Unit ID:	00136050
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	05011990
Installation Date:	Not reported
Tank Registration Date:	07201990
Capacity:	0022000
Tank Emptied:	No
Tank Construction and Containment:	Not reported
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Not reported
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Not reported
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Tested
Installer License Number:	Not reported
Tank Installer:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPTCO PROPERTY (Continued)

U001286202

Self-Certification Date: Not reported
Compartment: Not reported

Compartment Letter: A
Compartment Capacity: 0000000
Compartment Substance Stored: Not reported
Compartment Other Substance: Empty
Tank Release Method Detection I: Not reported
Tank Release Method Detection II: Not reported
Tank Release Method Detection III: Not reported
Other Tank Release Method Detection: Not reported
Tank Release Detection Variance: No Variance
Pipe Release Detection Method: Not reported
Pipe Release Detection Method II: Not reported
Pipe Release Detection Method III: Not reported
Other Pipe Release Detection Method: None
Pipe Release Detection Variance: No Variance
Spill and Overfill Protection: Not reported
Spill and Overfill Protection II: Not reported
Spill and Overfill Protection III: Not reported
Spill Overfill Prevention Variation: No Variance

Operator History:
Operator ID: Not reported
Operator Name or Business Name: Not reported
Operator Effective Begin Date: Not reported
Operator Effective End Date: Not reported
Operator Address: Not reported
Operator Building: Not reported
Operator PO Box: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Zip extension: Not reported

Owner History:
Facility ID: Not reported
Facility Number: Not reported
Customer Number: Not reported
Individual Name or Business Name: Not reported
Owner Effective Begin Date: Not reported
Owner Effective End Date: Not reported
Owner Address: Not reported
Owner Building: Not reported
Owner PO Box: Not reported
Owner City: Not reported
Owner State: Not reported
Owner Zip: Not reported
Owner Zip extension: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

47
West
1/4-1/2
0.438 mi.
2312 ft.

WALLY'S AUTOMOTIVE
420 N 15TH ST
CORSICANA, TX 75110

LPST
UST
U001289290
N/A

Relative:
Higher

LPST:

Facility ID: 59763
Facility Location: 420 NORTH 15TH ST
Region City ID: 4
Region City: ARLINGTON
LPST Id: 104915
Reported Date: 1992-09-30 00:00:00
Entered Date: 1992-12-22 00:00:00
Priority Description: Groundwater is affected.
Status: FINAL CONCURRENCE ISSUED, CASE CLOSED
RPR Coordinator: ML2
Responsible Party Name: COOPER VICTOR ESTATE
Responsible Party Contact: DENNIS COOPER
Responsible Party Address: 524 N 13TH ST
Responsible Party City,St,Zip: CORSICANA, TX 75110
Responsible Party Telephone: 903/872-4963

Actual:
443 ft.

UST:

Facility ID: 0059763
Facility Type: Not reported
Name of Facility Manager: VICTOR COOPER
Title of Facility Manager: Not reported
Facility Manager Phone: 9038747123
Facility Rural Box: Not reported
Facility in Ozone non-attainment area: Not reported
TCEQ Num: 090163
Owner ID: 35103
Disputed Owner: Not reported
Date Registration Form Received: 090991
Region Number: 04
Number of USTs: 4
Sign Name on Registration Form: VICTOR COOPER
Title of Signer of Registration Form: OWNER
Date of Signature on Registration Form: 082891
Owner Effective Begin Date: 090991

Owner ID: 35103
In Care Of: Not reported
Owner Name: COOPER VICTOR
Owner Address: 904 DOBBINS RD
Owner PO Box: Not reported
Owner City,St,Zip: CORSICANA, TX 75110
Owner Contact Name: VICTOR COOPER
Contact Telephone: 9038748112
Owner Type: Private or Corporate
Mail Undeliverable: Not reported
Bankruptcy is in effect: Not reported
Owner Amendment Reason Code: Owner Name Changed
Owner Amendment Date: 101801
Number of Facilities reported by Owner: 0002
Of Underground Storage Tanks: 0006
Of Aboveground Storage Tanks: 0000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALLY'S AUTOMOTIVE (Continued)

U001289290

Self-Certification Date: Not reported
Signature Name: Not reported
Signature Title Name: Not reported
Signature Type Text: Not reported
Certification Submitted Type: Not reported
Registration Self-Certification Flag: Not reported
Fees Self-Certification Flag: Not reported
Financial Assurance Self-Certification flag: Not reported
Technical standards Self-Certification flag: Not reported
UST Delivery Certificate Expiration Date: Not reported

Operator ID: Not reported
Operator Effective Date: Not reported
Operator Type: Not reported
Operator First Name: Not reported
Operator Name: Not reported
Operator Building Loc: Not reported
Operator Telephone: Not reported
Operator Address: Not reported
Operator PO Box: Not reported
Operator City, St, Zip: Not reported
Operator Contact Name: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported

Tank ID: 1
Unit ID: 00140932
Tank Status: **Removed from the Ground**
Tank Regulatory Status: Fully Regulated
Status Date: 10011992
Installation Date: Not reported
Tank Registration Date: 09091991
Capacity: 0002000
Tank Emptied: Yes
Tank Construction and Containment: Single Wall
Tank Construction and Containment II: Not reported
Tank Construction and Containment III: Not reported
Tank Construction and Containment IV: Not reported
Pipe Construction and Containment: Single Wall
Pipe Construction and Containment II: Not reported
Piping Design and Ext. Containment 3: Not reported
Piping Design and Ext. Containment 4: Not reported
Type of Piping: Suction
Internal Tank Lining Date: 00000000
Tank Material of Construction: Steel
Other Materials of Construction: Not reported
Pipe Material of Construction: Steel
Other Construction and Containment: Not reported
Pipe Connectors and Valves 1: Not reported
Pipe Connectors and Valves 2: Not reported
Pipe Connectors and Valves 3: Not reported
Tank Corrosion Protection: Not reported
Tank Corrosion Protection II: Not reported
Tank Corrosion Protection III: Not reported
Other Tank Corrosion Protection Text: None
Tank Corrosion Protection Variance: No Variance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALLY'S AUTOMOTIVE (Continued)

U001289290

Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Empty
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	2
Unit ID:	00140931
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	Not reported
Tank Registration Date:	09091991
Capacity:	0002000
Tank Emptied:	Yes
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Suction
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALLY'S AUTOMOTIVE (Continued)

U001289290

Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Empty
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance
Tank ID:	3
Unit ID:	00140933
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	Not reported
Tank Registration Date:	09091991
Capacity:	0002000
Tank Emptied:	Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALLYS AUTOMOTIVE (Continued)

U001289290

Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Suction
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Empty
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported
Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALLYS AUTOMOTIVE (Continued)

U001289290

Spill Overfill Prevention Variation:	No Variance
Tank ID:	4
Unit ID:	00140934
Tank Status:	Removed from the Ground
Tank Regulatory Status:	Fully Regulated
Status Date:	10011992
Installation Date:	Not reported
Tank Registration Date:	09091991
Capacity:	0000550
Tank Emptied:	Yes
Tank Construction and Containment:	Single Wall
Tank Construction and Containment II:	Not reported
Tank Construction and Containment III:	Not reported
Tank Construction and Containment IV:	Not reported
Pipe Construction and Containment:	Single Wall
Pipe Construction and Containment II:	Not reported
Piping Design and Ext. Containment 3:	Not reported
Piping Design and Ext. Containment 4:	Not reported
Type of Piping:	Gravity
Internal Tank Lining Date:	00000000
Tank Material of Construction:	Steel
Other Materials of Construction:	Not reported
Pipe Material of Construction:	Steel
Other Construction and Containment:	Not reported
Pipe Connectors and Valves 1:	Not reported
Pipe Connectors and Valves 2:	Not reported
Pipe Connectors and Valves 3:	Not reported
Tank Corrosion Protection:	Not reported
Tank Corrosion Protection II:	Not reported
Tank Corrosion Protection III:	Not reported
Other Tank Corrosion Protection Text:	None
Tank Corrosion Protection Variance:	No Variance
Pipe Corrosion Protection:	Not reported
Pipe Corrosion Protection II:	Not reported
Pipe Corrosion Protection 3:	Not reported
Other Corrosion Protection:	None
Pipe Corrosion Protection Variance:	No Variance
Stage 1 Vapor Recovery Equipment Status:	Not Reported
Stage 1 Equipment Installed Date:	Not reported
Stage 2 Vapor Recry Equipment Status:	Not Reported
Stage 2 Equipment Installed Date:	Not reported
Equipment Installer:	Not reported
Contractor Registration Number:	Not reported
Tank Tested:	Not reported
Installer License Number:	Not reported
Tank Installer:	Not reported
Self-Certification Date:	Not reported
Compartment:	Not reported
Compartment Letter:	A
Compartment Capacity:	0000000
Compartment Substance Stored:	Not reported
Compartment Other Substance:	Empty
Tank Release Method Detection I:	Not reported
Tank Release Method Detection II:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALLY'S AUTOMOTIVE (Continued)

U001289290

Tank Release Method Detection III:	Not reported
Other Tank Release Method Detection:	Not reported
Tank Release Detection Variance:	No Variance
Pipe Release Detection Method:	Not reported
Pipe Release Detection Method II:	Not reported
Pipe Release Detection Method III:	Not reported
Other Pipe Release Detection Method:	None
Pipe Release Detection Variance:	No Variance
Spill and Overfill Protection:	Not reported
Spill and Overfill Protection II:	Not reported
Spill and Overfill Protection III:	Not reported
Spill Overfill Prevention Variation:	No Variance

Operator History:

Operator ID:	Not reported
Operator Name or Business Name:	Not reported
Operator Effective Begin Date:	Not reported
Operator Effective End Date:	Not reported
Operator Address:	Not reported
Operator Building:	Not reported
Operator PO Box:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Zip extension:	Not reported

Owner History:

Facility ID:	Not reported
Facility Number:	Not reported
Customer Number:	Not reported
Individual Name or Business Name:	Not reported
Owner Effective Begin Date:	Not reported
Owner Effective End Date:	Not reported
Owner Address:	Not reported
Owner Building:	Not reported
Owner PO Box:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Zip extension:	Not reported

48
SSE
1/2-1
0.571 mi.
3016 ft.

CORSICANA GAS AND ELECTRIC CO
909 S 12TH STREET
CORSICANA, TX 75110

Manufactured Gas Plants **1008408369**
N/A

Relative:
Lower

Manufactured Gas Plants:

Alternate Name: CORSICANA GAS AND ELECTRIC CO. No additional information available

Actual:
414 ft.

Count: 23 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
CORSICANA	1004785063	THE K WAY EQUIPMENT CO	HWY 287 S 1M N OF H-45	75110	RCRA-CESQG, FINDS
CORSICANA	S106620580	HILLOCK FOODS INC	HWY 287	75110	LPST
CORSICANA	A100326073	RATLIFF READY MIX P2	5086 HWY 287	75110	AST
CORSICANA	S105121776	BURNET PROPERTY	E 9TH	75110	LPST
CORSICANA	S108529183	3105 N. HWY 75, CORSICANA, TX	3105 N CORSICANA TX		SPILLS
CORSICANA	U003840253	CLEARVIEW MARINA	10414 S HWY 287	75110	UST, FINANCIAL ASSURANCE
CORSICANA	1004784222	PENSKE TRUCK LEASING CO LP	2201 S HWY 75	75110	RCRA-NonGen, FINDS
CORSICANA	1005765244	PENSKE TRUCK LEASING CO LP	2201 S HWY 75	75110	LPST
CORSICANA	U003913959	MURPHY USA 6948	3831 W HWY 31	75110	UST, FINANCIAL ASSURANCE
CORSICANA	U001290394	EUREKA GROCERY	S HWY 287	75110	LPST, UST
CORSICANA	S106031863	MILDRED ISD	5475 S HWY 287	75110	LPST
CORSICANA	1004787156	DANNYS PAINT & BODY	1284 N HWY 75	75110	RCRA-CESQG, FINDS
CORSICANA	1004785200	EXXON MOBIL CORPORATION	2900 S HWY 287	75110	RCRA-NonGen, FINDS
CORSICANA	1010334103	WAL-MART SUPERCENTER 565	3801 W HWY 31	75110	RCRA-SQG
CORSICANA	S104957651	MILDRED ISD	S HWY 2	75110	AST
CORSICANA	A100176913	CLEARVIEW MARINA	10414 S HWY 287	75110	AST
CORSICANA	U003979383	WAL-MART SUPERCENTER 565	3801 W HWY 31	75110	UST
CORSICANA	S107649436	BEATON LAKE ESTATES WATER SYSTEM	S I 45 EXIT15TH ST		ENF
CORSICANA	S109515095	CITY OF CORSICANA LANDFILL	2050 JESTER DR		SWF/LF
CORSICANA	S109515180	CORSICANA TRANSFER STATION	2050 JESTER DR		SWF/LF
CORSICANA	S109515352	REDDEN GLENN LANDFILL	25 MILE W OF RICHLAND CRK		SWF/LF
CORSICANA	1003875043	YORK FLYING SERVICE	5 MI SE OF INT. I-45 & HWY 287	75110	CERC-NFRAP
HEALDTON	94385712	N. HWY 76, SEC-10, R-3 WEST T-2 SOU	10 W T 2	75110	ERNS

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 12/31/2010	Source: EPA
Date Data Arrived at EDR: 01/13/2011	Telephone: N/A
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 01/13/2011
Number of Days to Update: 15	Next Scheduled EDR Contact: 04/25/2011
	Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 12/31/2010	Source: EPA
Date Data Arrived at EDR: 01/13/2011	Telephone: N/A
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 01/13/2011
Number of Days to Update: 15	Next Scheduled EDR Contact: 04/25/2011
	Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991	Source: EPA
Date Data Arrived at EDR: 02/02/1994	Telephone: 202-564-4267
Date Made Active in Reports: 03/30/1994	Last EDR Contact: 02/14/2011
Number of Days to Update: 56	Next Scheduled EDR Contact: 05/30/2011
	Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal Delisted NPL site list

DELISTED NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 12/31/2010	Source: EPA
Date Data Arrived at EDR: 01/13/2011	Telephone: N/A
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 01/13/2011
Number of Days to Update: 15	Next Scheduled EDR Contact: 04/25/2011
	Data Release Frequency: Quarterly

Federal CERCLIS list

CERCLIS: Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 11/30/2010	Source: EPA
Date Data Arrived at EDR: 12/30/2010	Telephone: 703-412-9810
Date Made Active in Reports: 02/25/2011	Last EDR Contact: 03/01/2011
Number of Days to Update: 57	Next Scheduled EDR Contact: 06/13/2011
	Data Release Frequency: Quarterly

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA's Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 12/10/2010	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/11/2011	Telephone: 703-603-8704
Date Made Active in Reports: 02/16/2011	Last EDR Contact: 01/11/2011
Number of Days to Update: 36	Next Scheduled EDR Contact: 04/25/2011
	Data Release Frequency: Varies

Federal CERCLIS NFRAP site List

CERCLIS-NFRAP: CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

Date of Government Version: 10/28/2010	Source: EPA
Date Data Arrived at EDR: 12/01/2010	Telephone: 703-412-9810
Date Made Active in Reports: 02/25/2011	Last EDR Contact: 03/01/2011
Number of Days to Update: 86	Next Scheduled EDR Contact: 06/13/2011
	Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 05/25/2010
Date Data Arrived at EDR: 06/02/2010
Date Made Active in Reports: 10/04/2010
Number of Days to Update: 124

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 02/14/2011
Next Scheduled EDR Contact: 05/30/2011
Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 02/17/2010
Date Data Arrived at EDR: 02/19/2010
Date Made Active in Reports: 05/17/2010
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: 214-665-6444
Last EDR Contact: 01/06/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 02/17/2010
Date Data Arrived at EDR: 02/19/2010
Date Made Active in Reports: 05/17/2010
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: 214-665-6444
Last EDR Contact: 01/06/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 02/17/2010
Date Data Arrived at EDR: 02/19/2010
Date Made Active in Reports: 05/17/2010
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: 214-665-6444
Last EDR Contact: 01/06/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 02/17/2010
Date Data Arrived at EDR: 02/19/2010
Date Made Active in Reports: 05/17/2010
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: 214-665-6444
Last EDR Contact: 01/06/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal institutional controls / engineering controls registries

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 01/05/2011	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/14/2011	Telephone: 703-603-0695
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 03/14/2011
Number of Days to Update: 14	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 01/05/2011	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/14/2011	Telephone: 703-603-0695
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 03/14/2011
Number of Days to Update: 14	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Varies

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/31/2010	Source: National Response Center, United States Coast Guard
Date Data Arrived at EDR: 01/07/2011	Telephone: 202-267-2180
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 01/07/2011
Number of Days to Update: 73	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Annually

State- and tribal - equivalent NPL

SHWS: State Superfund Registry

State Hazardous Waste Sites. State hazardous waste site records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. Available information varies by state.

Date of Government Version: 02/07/2011	Source: Texas Commission on Environmental Quality
Date Data Arrived at EDR: 02/18/2011	Telephone: 512-239-5680
Date Made Active in Reports: 03/17/2011	Last EDR Contact: 03/25/2011
Number of Days to Update: 27	Next Scheduled EDR Contact: 07/04/2011
	Data Release Frequency: Semi-Annually

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: Permitted Solid Waste Facilities

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 02/07/2011
Date Data Arrived at EDR: 02/09/2011
Date Made Active in Reports: 03/17/2011
Number of Days to Update: 36

Source: Texas Commission on Environmental Quality
Telephone: 512-239-6706
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Quarterly

CLI: Closed Landfill Inventory

Closed and abandoned landfills (permitted as well as unauthorized) across the state of Texas.

Date of Government Version: 08/30/1999
Date Data Arrived at EDR: 09/28/2000
Date Made Active in Reports: 10/30/2000
Number of Days to Update: 32

Source: Texas Commission on Environmental Quality
Telephone: 512-239-6016
Last EDR Contact: 01/10/2011
Next Scheduled EDR Contact: 04/25/2011
Data Release Frequency: Varies

WASTEMGT: Commercial Hazardous & Solid Waste Management Facilities

This list contains commercial recycling facilities and facilities permitted or authorized (interim status) by the Texas Natural Resource Conservation Commission.

Date of Government Version: 12/01/2006
Date Data Arrived at EDR: 02/16/2007
Date Made Active in Reports: 03/29/2007
Number of Days to Update: 41

Source: Texas Commission on Environmental Quality
Telephone: 512-239-2920
Last EDR Contact: 01/13/2011
Next Scheduled EDR Contact: 04/25/2011
Data Release Frequency: Varies

State and tribal leaking storage tank lists

LPST: Leaking Petroleum Storage Tank Database

An inventory of reported leaking petroleum storage tank incidents. Not all states maintain these records, and the information stored varies by state.

Date of Government Version: 12/10/2010
Date Data Arrived at EDR: 01/06/2011
Date Made Active in Reports: 02/03/2011
Number of Days to Update: 28

Source: Texas Commission on Environmental Quality
Telephone: 512-239-2200
Last EDR Contact: 01/06/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Quarterly

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 02/04/2011
Date Data Arrived at EDR: 02/04/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 45

Source: EPA Region 8
Telephone: 303-312-6271
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Quarterly

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 11/04/2009
Date Data Arrived at EDR: 05/04/2010
Date Made Active in Reports: 07/07/2010
Number of Days to Update: 64

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 05/04/2010
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 02/03/2011
Date Data Arrived at EDR: 02/04/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 45

Source: EPA Region 6
Telephone: 214-665-6597
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land

A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 09/01/2010	Source: EPA Region 1
Date Data Arrived at EDR: 11/05/2010	Telephone: 617-918-1313
Date Made Active in Reports: 01/28/2011	Last EDR Contact: 02/03/2011
Number of Days to Update: 84	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 02/03/2011	Source: EPA Region 10
Date Data Arrived at EDR: 02/04/2011	Telephone: 206-553-2857
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 01/31/2011
Number of Days to Update: 45	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Quarterly

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 01/31/2011	Source: Environmental Protection Agency
Date Data Arrived at EDR: 02/01/2011	Telephone: 415-972-3372
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 01/31/2011
Number of Days to Update: 48	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Quarterly

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 08/27/2010	Source: EPA Region 4
Date Data Arrived at EDR: 08/30/2010	Telephone: 404-562-8677
Date Made Active in Reports: 10/04/2010	Last EDR Contact: 02/16/2011
Number of Days to Update: 35	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Semi-Annually

State and tribal registered storage tank lists

UST: Petroleum Storage Tank Database

Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

Date of Government Version: 12/03/2010	Source: Texas Commission on Environmental Quality
Date Data Arrived at EDR: 01/06/2011	Telephone: 512-239-2160
Date Made Active in Reports: 02/07/2011	Last EDR Contact: 01/06/2011
Number of Days to Update: 32	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Quarterly

AST: Petroleum Storage Tank Database

Registered Aboveground Storage Tanks.

Date of Government Version: 12/03/2010	Source: Texas Commission on Environmental Quality
Date Data Arrived at EDR: 01/06/2011	Telephone: 512-239-2160
Date Made Active in Reports: 02/07/2011	Last EDR Contact: 01/06/2011
Number of Days to Update: 32	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Quarterly

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 02/11/2010
Date Data Arrived at EDR: 02/11/2010
Date Made Active in Reports: 04/12/2010
Number of Days to Update: 60

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Varies

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 09/01/2010
Date Data Arrived at EDR: 11/05/2010
Date Made Active in Reports: 01/28/2011
Number of Days to Update: 84

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 02/03/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 02/03/2011
Date Data Arrived at EDR: 02/04/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 45

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Quarterly

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 11/01/2010
Date Data Arrived at EDR: 12/02/2010
Date Made Active in Reports: 01/28/2011
Number of Days to Update: 57

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 02/03/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 02/04/2011
Date Data Arrived at EDR: 02/04/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 45

Source: EPA Region 8
Telephone: 303-312-6137
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Quarterly

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 01/31/2011
Date Data Arrived at EDR: 02/01/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 48

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Quarterly

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 08/27/2010
Date Data Arrived at EDR: 08/30/2010
Date Made Active in Reports: 10/04/2010
Number of Days to Update: 35

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 02/16/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Semi-Annually

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 02/03/2011
Date Data Arrived at EDR: 02/04/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 45

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Semi-Annually

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 01/01/2010
Date Data Arrived at EDR: 02/16/2010
Date Made Active in Reports: 04/12/2010
Number of Days to Update: 55

Source: FEMA
Telephone: 202-646-5797
Last EDR Contact: 01/17/2011
Next Scheduled EDR Contact: 05/02/2011
Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

AUL: Sites with Controls

Activity and use limitations include both engineering controls and institutional controls.

Date of Government Version: 01/12/2011
Date Data Arrived at EDR: 01/13/2011
Date Made Active in Reports: 01/25/2011
Number of Days to Update: 12

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5891
Last EDR Contact: 01/10/2011
Next Scheduled EDR Contact: 04/25/2011
Data Release Frequency: Varies

State and tribal voluntary cleanup sites

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 09/01/2010
Date Data Arrived at EDR: 01/05/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 75

Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 01/05/2010
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27

Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 04/20/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

VCP TCEQ: Voluntary Cleanup Program Database

The Texas Voluntary Cleanup Program was established to provide administrative, technical, and legal incentives to encourage the cleanup of contaminated sites in Texas.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 11/05/2010
Date Data Arrived at EDR: 01/13/2011
Date Made Active in Reports: 01/25/2011
Number of Days to Update: 12

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5891
Last EDR Contact: 01/13/2011
Next Scheduled EDR Contact: 04/25/2011
Data Release Frequency: Quarterly

VCP RRC: Voluntary Cleanup Program Sites

The Voluntary Cleanup Program (RRC-VCP) provides an incentive to remediate Oil & Gas related pollution by participants as long as they did not cause or contribute to the contamination. Applicants to the program receive a release of liability to the state in exchange for a successful cleanup.

Date of Government Version: 11/16/2010
Date Data Arrived at EDR: 01/13/2011
Date Made Active in Reports: 01/25/2011
Number of Days to Update: 12

Source: Railroad Commission of Texas
Telephone: 512-463-6969
Last EDR Contact: 01/13/2011
Next Scheduled EDR Contact: 04/25/2011
Data Release Frequency: Varies

State and tribal Brownfields sites

BROWNFIELDS: Brownfields Site Assessments

Brownfield site assessments that are being cleaned under EPA grant monies.

Date of Government Version: 11/05/2010
Date Data Arrived at EDR: 01/13/2011
Date Made Active in Reports: 01/25/2011
Number of Days to Update: 12

Source: TCEQ
Telephone: 512-239-5872
Last EDR Contact: 01/13/2011
Next Scheduled EDR Contact: 04/25/2011
Data Release Frequency: Semi-Annually

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities--especially those without EPA Brownfields Assessment Demonstration Pilots--minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields sites throughout the country. Targeted Brownfields Assessments supplement and work with other efforts under EPA's Brownfields Initiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients-States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients must use EPA funds provided through BCRLF cooperative agreement for specified brownfields-related cleanup activities.

Date of Government Version: 12/29/2010
Date Data Arrived at EDR: 12/30/2010
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 81

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 12/30/2010
Next Scheduled EDR Contact: 04/11/2011
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 03/28/2011
Next Scheduled EDR Contact: 07/11/2011
Data Release Frequency: No Update Planned

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 02/08/2011
Next Scheduled EDR Contact: 05/23/2011
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 12/03/2010
Date Data Arrived at EDR: 12/30/2010
Date Made Active in Reports: 02/16/2011
Number of Days to Update: 48

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 03/08/2011
Next Scheduled EDR Contact: 06/20/2011
Data Release Frequency: Quarterly

DEL SHWS: Deleted Superfund Registry Sites

Sites have been deleted from the state Superfund registry in accordance with the Act, ?361.189

Date of Government Version: 02/07/2011
Date Data Arrived at EDR: 02/18/2011
Date Made Active in Reports: 03/17/2011
Number of Days to Update: 27

Source: Texas Commission on Environmental Quality
Telephone: 512-239-0666
Last EDR Contact: 03/25/2011
Next Scheduled EDR Contact: 07/04/2011
Data Release Frequency: Quarterly

PRIORITY CLEANERS: Dry Cleaner Remediation Program Prioritization List

A listing of dry cleaner related contaminated sites.

Date of Government Version: 09/01/2010
Date Data Arrived at EDR: 09/16/2010
Date Made Active in Reports: 10/11/2010
Number of Days to Update: 25

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5658
Last EDR Contact: 03/16/2011
Next Scheduled EDR Contact: 06/27/2011
Data Release Frequency: Varies

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 09/01/2007
Date Data Arrived at EDR: 11/19/2008
Date Made Active in Reports: 03/30/2009
Number of Days to Update: 131

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 03/23/2009
Next Scheduled EDR Contact: 06/22/2009
Data Release Frequency: No Update Planned

Local Land Records

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 11/09/2010
Date Data Arrived at EDR: 11/16/2010
Date Made Active in Reports: 02/16/2011
Number of Days to Update: 92

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 01/31/2011
Next Scheduled EDR Contact: 05/16/2011
Data Release Frequency: Varies

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 12/09/2005
Date Data Arrived at EDR: 12/11/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 31

Source: Department of the Navy
Telephone: 843-820-7326
Last EDR Contact: 02/22/2011
Next Scheduled EDR Contact: 06/06/2011
Data Release Frequency: Varies

LIENS: Environmental Liens Listing

The listing covers TCEQ liens placed against either State Superfund sites or Federal Superfund sites to recover cost incurred by TCEQ.

Date of Government Version: 03/01/2011
Date Data Arrived at EDR: 03/02/2011
Date Made Active in Reports: 03/17/2011
Number of Days to Update: 15

Source: Texas Commission on Environmental Quality
Telephone: 512-239-2209
Last EDR Contact: 02/25/2011
Next Scheduled EDR Contact: 06/13/2011
Data Release Frequency: Varies

HIST LIENS: Environmental Liens Listing

This listing contains information fields that are no longer tracked in the LIENS database.

Date of Government Version: 03/23/2007
Date Data Arrived at EDR: 03/23/2007
Date Made Active in Reports: 05/02/2007
Number of Days to Update: 40

Source: Texas Commission on Environmental Quality
Telephone: 512-239-2209
Last EDR Contact: 12/17/2007
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 12/31/2010
Date Data Arrived at EDR: 01/05/2011
Date Made Active in Reports: 02/25/2011
Number of Days to Update: 51

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 01/05/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SPILLS: Spills Database

Spills reported to the Emergency Response Division.

Date of Government Version: 02/28/2011
Date Data Arrived at EDR: 03/04/2011
Date Made Active in Reports: 03/17/2011
Number of Days to Update: 13

Source: Texas Commission on Environmental Quality
Telephone: 512-239-0983
Last EDR Contact: 02/28/2011
Next Scheduled EDR Contact: 06/13/2011
Data Release Frequency: Quarterly

Other Ascertainable Records

RCRA-NonGen: RCRA - Non Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 02/17/2010
Date Data Arrived at EDR: 02/19/2010
Date Made Active in Reports: 05/17/2010
Number of Days to Update: 87

Source: Environmental Protection Agency
Telephone: 214-665-6444
Last EDR Contact: 01/06/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Varies

DOT OPS: Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 10/13/2010
Date Data Arrived at EDR: 12/10/2010
Date Made Active in Reports: 02/25/2011
Number of Days to Update: 77

Source: Department of Transportation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 02/11/2011
Next Scheduled EDR Contact: 05/23/2011
Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 11/10/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 62

Source: USGS
Telephone: 703-692-8801
Last EDR Contact: 01/21/2011
Next Scheduled EDR Contact: 05/02/2011
Data Release Frequency: Semi-Annually

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 08/12/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 112

Source: U.S. Army Corps of Engineers
Telephone: 202-528-4285
Last EDR Contact: 03/15/2011
Next Scheduled EDR Contact: 06/27/2011
Data Release Frequency: Varies

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 10/01/2010
Date Data Arrived at EDR: 10/29/2010
Date Made Active in Reports: 01/28/2011
Number of Days to Update: 91

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 01/03/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 02/25/2011
Date Data Arrived at EDR: 03/16/2011
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 5

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 03/16/2011
Next Scheduled EDR Contact: 06/27/2011
Data Release Frequency: Annually

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 09/14/2010
Date Data Arrived at EDR: 10/21/2010
Date Made Active in Reports: 01/28/2011
Number of Days to Update: 99

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 03/04/2011
Next Scheduled EDR Contact: 06/13/2011
Data Release Frequency: Varies

MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 08/04/2010
Date Data Arrived at EDR: 09/09/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 84

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 03/09/2011
Next Scheduled EDR Contact: 06/20/2011
Data Release Frequency: Semi-Annually

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 12/17/2010
Date Made Active in Reports: 03/21/2011
Number of Days to Update: 94

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 03/01/2011
Next Scheduled EDR Contact: 06/13/2011
Data Release Frequency: Annually

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2006
Date Data Arrived at EDR: 09/29/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 64

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 12/29/2010
Next Scheduled EDR Contact: 04/11/2011
Data Release Frequency: Every 4 Years

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009
Date Data Arrived at EDR: 04/16/2009
Date Made Active in Reports: 05/11/2009
Number of Days to Update: 25

Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Telephone: 202-566-1667
Last EDR Contact: 02/28/2011
Next Scheduled EDR Contact: 06/13/2011
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009	Source: EPA
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 02/28/2011
Number of Days to Update: 25	Next Scheduled EDR Contact: 06/13/2011
	Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/01/2007	Telephone: 202-564-2501
Date Made Active in Reports: 04/10/2007	Last EDR Contact: 12/17/2007
Number of Days to Update: 40	Next Scheduled EDR Contact: 03/17/2008
	Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/01/2007	Telephone: 202-564-2501
Date Made Active in Reports: 04/10/2007	Last EDR Contact: 12/17/2008
Number of Days to Update: 40	Next Scheduled EDR Contact: 03/17/2008
	Data Release Frequency: No Update Planned

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009	Source: EPA
Date Data Arrived at EDR: 12/10/2010	Telephone: 202-564-4203
Date Made Active in Reports: 02/25/2011	Last EDR Contact: 01/31/2011
Number of Days to Update: 77	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 01/07/2011	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/21/2011	Telephone: 202-564-5088
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 03/28/2011
Number of Days to Update: 59	Next Scheduled EDR Contact: 07/11/2011
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 11/01/2010	Source: EPA
Date Data Arrived at EDR: 11/10/2010	Telephone: 202-566-0500
Date Made Active in Reports: 02/16/2011	Last EDR Contact: 01/21/2011
Number of Days to Update: 98	Next Scheduled EDR Contact: 05/02/2011
	Data Release Frequency: Annually

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 03/18/2010	Source: Nuclear Regulatory Commission
Date Data Arrived at EDR: 04/06/2010	Telephone: 301-415-7169
Date Made Active in Reports: 05/27/2010	Last EDR Contact: 03/14/2011
Number of Days to Update: 51	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Quarterly

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 01/11/2011	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/13/2011	Telephone: 202-343-9775
Date Made Active in Reports: 02/16/2011	Last EDR Contact: 01/13/2011
Number of Days to Update: 34	Next Scheduled EDR Contact: 04/25/2011
	Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 04/14/2010	Source: EPA
Date Data Arrived at EDR: 04/16/2010	Telephone: (214) 665-2200
Date Made Active in Reports: 05/27/2010	Last EDR Contact: 03/14/2011
Number of Days to Update: 41	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Quarterly

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995	Source: EPA
Date Data Arrived at EDR: 07/03/1995	Telephone: 202-564-4104
Date Made Active in Reports: 08/07/1995	Last EDR Contact: 06/02/2008
Number of Days to Update: 35	Next Scheduled EDR Contact: 09/01/2008
	Data Release Frequency: No Update Planned

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 12/31/2007
Date Data Arrived at EDR: 02/25/2010
Date Made Active in Reports: 05/12/2010
Number of Days to Update: 76

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 03/01/2011
Next Scheduled EDR Contact: 06/13/2011
Data Release Frequency: Biennially

IOP: Innocent Owner/Operator Program

Contains information on all sites that are in the IOP. An IOP is an innocent owner or operator whose property is contaminated as a result of a release or migration of contaminants from a source or sources not located on the property, and they did not cause or contribute to the source or sources of contamination.

Date of Government Version: 11/05/2010
Date Data Arrived at EDR: 01/13/2011
Date Made Active in Reports: 01/25/2011
Number of Days to Update: 12

Source: Texas Commission on Environmental Quality
Telephone: 512-239-5894
Last EDR Contact: 01/13/2011
Next Scheduled EDR Contact: 04/25/2011
Data Release Frequency: Quarterly

UIC: Underground Injection Wells Database Listing

Class V injection wells regulated by the TCEQ. Class V wells are used to inject non-hazardous fluids underground. Most Class V wells are used to dispose of wastes into or above underground sources of drinking water and can pose a threat to ground water quality, if not managed properly.

Date of Government Version: 01/24/2011
Date Data Arrived at EDR: 01/26/2011
Date Made Active in Reports: 02/03/2011
Number of Days to Update: 8

Source: Texas Commission on Environmental Quality
Telephone: 512-239-6627
Last EDR Contact: 01/24/2011
Next Scheduled EDR Contact: 05/09/2011
Data Release Frequency: Varies

NPDES: NPDES Facility List

Permitted wastewater outfalls.

Date of Government Version: 11/07/2010
Date Data Arrived at EDR: 11/24/2010
Date Made Active in Reports: 01/25/2011
Number of Days to Update: 62

Source: Texas Commission on Environmental Quality
Telephone: 512-239-4591
Last EDR Contact: 02/25/2011
Next Scheduled EDR Contact: 06/06/2011
Data Release Frequency: Varies

DRYCLEANERS: Drycleaner Registration Database Listing

A listing of drycleaning facilities.

Date of Government Version: 10/18/2010
Date Data Arrived at EDR: 12/14/2010
Date Made Active in Reports: 01/31/2011
Number of Days to Update: 48

Source: Texas Commission on Environmental Quality
Telephone: 512-239-2160
Last EDR Contact: 03/16/2011
Next Scheduled EDR Contact: 06/27/2011
Data Release Frequency: Varies

ENFORCEMENT: Notice of Violations Listing

A listing of permit violations.

Date of Government Version: 12/31/2010
Date Data Arrived at EDR: 01/04/2011
Date Made Active in Reports: 01/25/2011
Number of Days to Update: 21

Source: Texas Commission on Environmental Quality
Telephone: 512-239-6012
Last EDR Contact: 03/14/2011
Next Scheduled EDR Contact: 06/27/2011
Data Release Frequency: Semi-Annually

Ind. Haz Waste: Industrial & Hazardous Waste Database

Summary reports reported by waste handlers, generators and shippers in Texas.

Date of Government Version: 12/03/2010
Date Data Arrived at EDR: 01/13/2011
Date Made Active in Reports: 02/03/2011
Number of Days to Update: 21

Source: Texas Commission on Environmental Quality
Telephone: 512-239-0985
Last EDR Contact: 01/13/2011
Next Scheduled EDR Contact: 04/25/2011
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

ED AQUIF: Edwards Aquifer Permits

A listing of permits in the Edwards Aquifer Protection Program database. The information provided is for the counties located in the Austin Region (Hays, Travis, and Williamson counties).

Date of Government Version: 01/19/2011
Date Data Arrived at EDR: 01/20/2011
Date Made Active in Reports: 01/31/2011
Number of Days to Update: 11

Source: Texas Commission on Environmental Quality, Austin Region
Telephone: 512-339-2929
Last EDR Contact: 01/17/2011
Next Scheduled EDR Contact: 04/18/2011
Data Release Frequency: Varies

AIRS: Current Emission Inventory Data

The database lists by company, along with their actual emissions, the TNRCC air accounts that emit EPA criteria pollutants.

Date of Government Version: 08/12/2009
Date Data Arrived at EDR: 09/21/2010
Date Made Active in Reports: 10/11/2010
Number of Days to Update: 20

Source: Texas Commission on Environmental Quality
Telephone: N/A
Last EDR Contact: 03/24/2011
Next Scheduled EDR Contact: 07/04/2011
Data Release Frequency: Semi-Annually

TIER 2: Tier 2 Chemical Inventory Reports

A listing of facilities which store or manufacture hazardous materials and submit a chemical inventory report.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 06/11/2010
Date Made Active in Reports: 08/17/2010
Number of Days to Update: 67

Source: Department of State Health Services
Telephone: 512-834-6603
Last EDR Contact: 02/28/2011
Next Scheduled EDR Contact: 06/13/2011
Data Release Frequency: Annually

MSD: Municipal Settings Designations Database

An MSD is an official state designation given to property within a municipality or its extraterritorial jurisdiction that certifies that designated groundwater at the property is not used as potable water, and is prohibited from future use as potable water because that groundwater is contaminated in excess of the applicable potable-water protective concentration level.

Date of Government Version: 12/30/2010
Date Data Arrived at EDR: 12/30/2010
Date Made Active in Reports: 01/31/2011
Number of Days to Update: 32

Source: Texas Commission on Environmental Quality
Telephone: 512-239-4982
Last EDR Contact: 03/28/2011
Next Scheduled EDR Contact: 07/11/2011
Data Release Frequency: Varies

RWS: Radioactive Waste Sites

Sites in the State of Texas that have been designated as Radioactive Waste sites.

Date of Government Version: 07/24/2006
Date Data Arrived at EDR: 12/14/2006
Date Made Active in Reports: 01/23/2007
Number of Days to Update: 40

Source: Texas Commission on Environmental Quality
Telephone: 512-239-0859
Last EDR Contact: 02/23/2011
Next Scheduled EDR Contact: 06/06/2011
Data Release Frequency: Semi-Annually

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2005
Date Data Arrived at EDR: 12/08/2006
Date Made Active in Reports: 01/11/2007
Number of Days to Update: 34

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 01/21/2011
Next Scheduled EDR Contact: 05/02/2011
Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 08/31/2010	Source: Environmental Protection Agency
Date Data Arrived at EDR: 09/01/2010	Telephone: 615-532-8599
Date Made Active in Reports: 12/02/2010	Last EDR Contact: 02/22/2011
Number of Days to Update: 92	Next Scheduled EDR Contact: 05/09/2011
	Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 01/01/2008	Source: Environmental Protection Agency
Date Data Arrived at EDR: 02/18/2009	Telephone: 202-566-0517
Date Made Active in Reports: 05/29/2009	Last EDR Contact: 02/04/2011
Number of Days to Update: 100	Next Scheduled EDR Contact: 05/16/2011
	Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 08/17/2010	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/03/2011	Telephone: N/A
Date Made Active in Reports: 03/21/2011	Last EDR Contact: 03/18/2011
Number of Days to Update: 77	Next Scheduled EDR Contact: 06/27/2011
	Data Release Frequency: Varies

COAL ASH DOE: Sleam-Electric Plan Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005	Source: Department of Energy
Date Data Arrived at EDR: 08/07/2009	Telephone: 202-586-8719
Date Made Active in Reports: 10/22/2009	Last EDR Contact: 01/18/2011
Number of Days to Update: 76	Next Scheduled EDR Contact: 05/02/2011
	Data Release Frequency: Varies

FINANCIAL ASSURANCE: Financial Assurance Information Listing

Financial assurance information.

Date of Government Version: 01/04/2011	Source: Texas Commission on Environmental Quality
Date Data Arrived at EDR: 01/06/2011	Telephone: 512-239-6239
Date Made Active in Reports: 01/25/2011	Last EDR Contact: 01/03/2011
Number of Days to Update: 19	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Varies

FINANCIAL ASSURANCE 2: Financial Assurance Information Listing

Financial Assurance information for underground storage tank facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay

Date of Government Version: 12/03/2010	Source: Texas Commission on Environmental Quality
Date Data Arrived at EDR: 01/06/2011	Telephone: 512-239-0986
Date Made Active in Reports: 01/25/2011	Last EDR Contact: 01/06/2011
Number of Days to Update: 19	Next Scheduled EDR Contact: 04/18/2011
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

GCC: Groundwater Contamination Cases

Texas Water Code, Section 26.406 requires the annual report to describe the current status of groundwater monitoring activities conducted or required by each agency at regulated facilities or associated with regulated activities.

The report is required to contain a description of each case of groundwater contamination documented during the previous calendar year. Also to be included, is a description of each case of contamination documented during previous periods for which voluntary clean up action was incomplete at the time the preceding report was issued.

The report is also required to indicate the status of enforcement action for each listed case.

Date of Government Version: 12/31/2009

Date Data Arrived at EDR: 12/23/2010

Date Made Active in Reports: 01/25/2011

Number of Days to Update: 33

Source: Texas Commission on Environmental Quality

Telephone: 512-239-5690

Last EDR Contact: 03/11/2011

Next Scheduled EDR Contact: 06/20/2011

Data Release Frequency: Annually

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005

Date Data Arrived at EDR: 02/06/2006

Date Made Active in Reports: 01/11/2007

Number of Days to Update: 339

Source: U.S. Geological Survey

Telephone: 888-275-8747

Last EDR Contact: 01/21/2011

Next Scheduled EDR Contact: 05/02/2011

Data Release Frequency: N/A

EDR PROPRIETARY RECORDS

EDR Proprietary Records

Manufactured Gas Plants: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A

Date Data Arrived at EDR: N/A

Date Made Active in Reports: N/A

Number of Days to Update: N/A

Source: EDR, Inc.

Telephone: N/A

Last EDR Contact: N/A

Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 12/31/2007

Date Data Arrived at EDR: 08/26/2009

Date Made Active in Reports: 09/11/2009

Number of Days to Update: 16

Source: Department of Environmental Protection

Telephone: 860-424-3375

Last EDR Contact: 02/25/2011

Next Scheduled EDR Contact: 06/06/2011

Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 07/22/2010
Date Made Active in Reports: 08/26/2010
Number of Days to Update: 35

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 01/21/2011
Next Scheduled EDR Contact: 05/02/2011
Data Release Frequency: Annually

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 12/31/2010
Date Data Arrived at EDR: 02/09/2011
Date Made Active in Reports: 03/04/2011
Number of Days to Update: 23

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 02/09/2011
Next Scheduled EDR Contact: 05/23/2011
Data Release Frequency: Annually

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2008
Date Data Arrived at EDR: 12/01/2009
Date Made Active in Reports: 12/14/2009
Number of Days to Update: 13

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 02/18/2011
Next Scheduled EDR Contact: 06/06/2011
Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 07/19/2010
Date Made Active in Reports: 08/26/2010
Number of Days to Update: 38

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 02/28/2011
Next Scheduled EDR Contact: 06/13/2011
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data

Hazardous waste manifest information.

Date of Government Version: 03/29/2010
Date Data Arrived at EDR: 05/14/2010
Date Made Active in Reports: 06/22/2010
Number of Days to Update: 39

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 01/24/2011
Next Scheduled EDR Contact: 05/09/2011
Data Release Frequency: Annually

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 07/06/2010
Date Made Active in Reports: 07/26/2010
Number of Days to Update: 20

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 03/21/2011
Next Scheduled EDR Contact: 07/04/2011
Data Release Frequency: Annually

Oil/Gas Pipelines: This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

Electric Power Transmission Line Data

Source: Rextag Strategies Corp.
Telephone: (281) 769-2247
U.S. Electric Transmission and Power Plants Systems Digital GIS Data

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Child Care Facility List

Source: Department of Protective & Regulatory Services

Telephone: 512-438-3269

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2009 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK[®] - PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

101 N. BEATON
101 N. BEATON
CORSICANA, TX 75110

TARGET PROPERTY COORDINATES

Latitude (North):	32.09360 - 32° 5' 37.0"
Longitude (West):	96.4636 - 96° 27' 49.0"
Universal Transverse Mercator:	Zone 14
UTM X (Meters):	739372.2
UTM Y (Meters):	3553438.8
Elevation:	424 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	32096-A4 CORSICANA, TX
Most Recent Revision:	1978

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General ENE

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

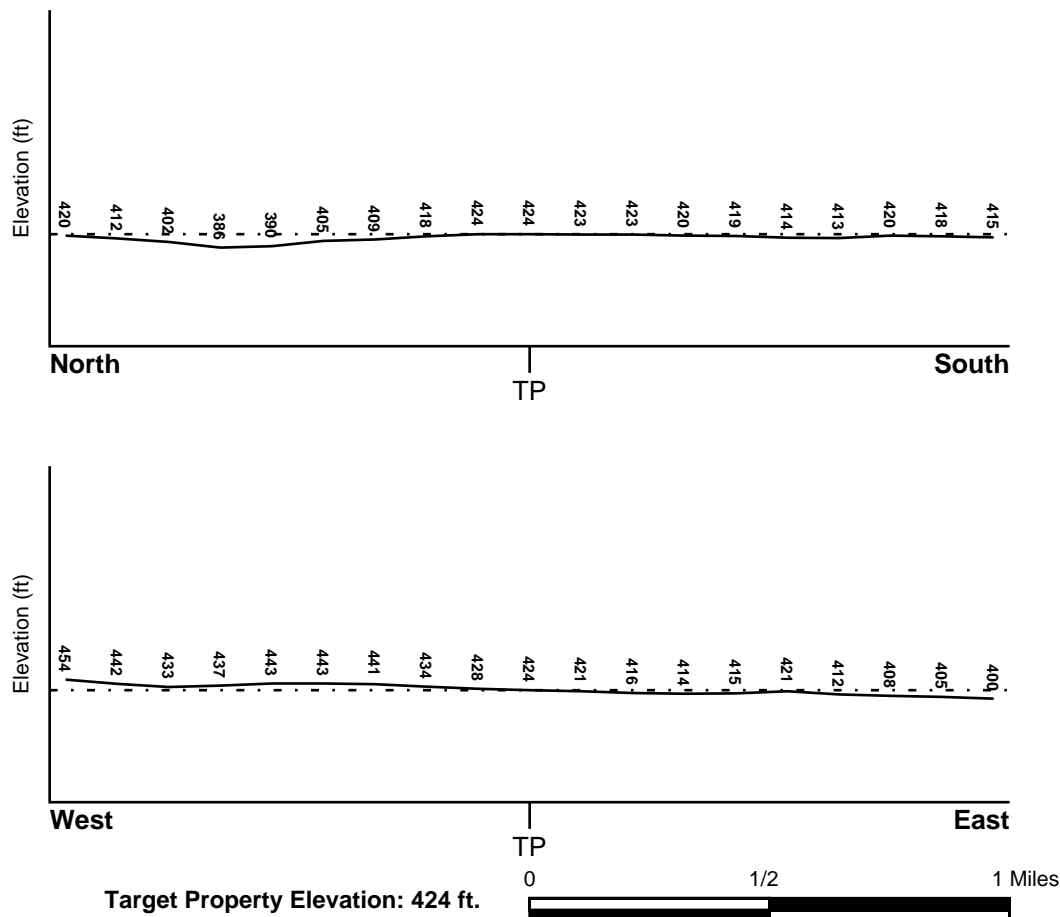

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

<u>Target Property County</u>	<u>FEMA Flood Electronic Data</u>
NAVARRO, TX	Not Available

Flood Plain Panel at Target Property: Not Reported

Additional Panels in search area: Not Reported

NATIONAL WETLAND INVENTORY

<u>NWI Quad at Target Property</u>	<u>NWI Electronic Data Coverage</u>
NOT AVAILABLE	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data:*

Search Radius:	1.25 miles
Status:	Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

<u>MAP ID</u>	<u>LOCATION FROM TP</u>	<u>GENERAL DIRECTION GROUNDWATER FLOW</u>
Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT


Era:	Mesozoic
System:	Cretaceous
Series:	Navarro Group
Code:	uK4 (<i>decoded above as Era, System & Series</i>)

GEOLOGIC AGE IDENTIFICATION

Category: Stratified Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 3025321.2s

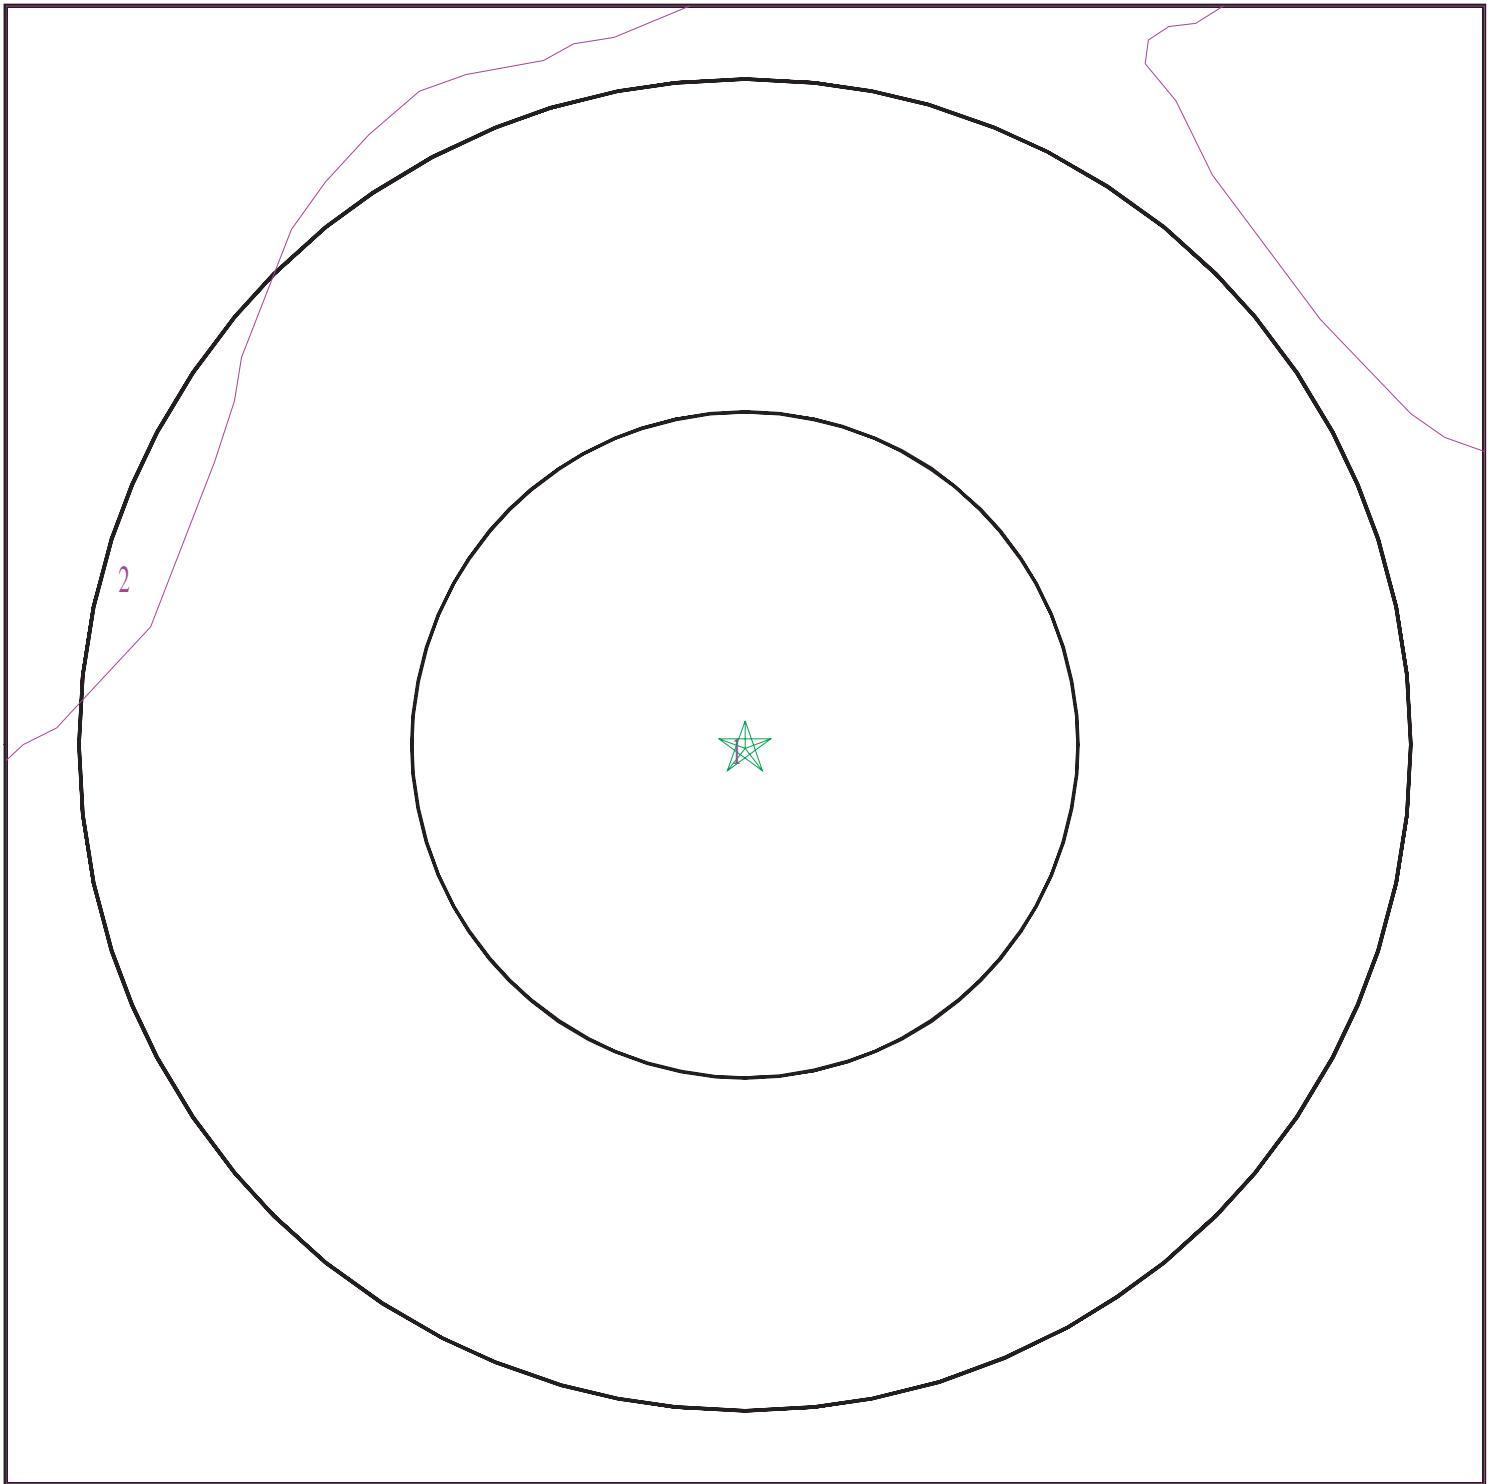

- ★ Target Property
- ∨ SSURGO Soil
- ∨ Water

0 1/16 1/8 1/4 Miles



SITE NAME: 101 N. Beaton
ADDRESS: 101 N. Beaton
Corsicana TX 75110
LAT/LONG: 32.0936 / 96.4636

CLIENT: G.E.C., Inc.
CONTACT: Jennifer Lindquist
INQUIRY #: 3025321.2s
DATE: March 28, 2011 3:13 pm

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: Wilson

Soil Surface Texture: clay loam

Hydrologic Group: Class D - Very slow infiltration rates. Soils are clayey, have a high water table, or are shallow to an impervious layer.

Soil Drainage Class: Moderately well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	7 inches	clay loam	Not reported	Not reported	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
2	7 inches	48 inches	clay	Not reported	Not reported	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6
3	48 inches	59 inches	clay	Not reported	Not reported	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.6

Soil Map ID: 2

Soil Component Name: Crockett

Soil Surface Texture: fine sandy loam

Hydrologic Group: Class D - Very slow infiltration rates. Soils are clayey, have a high water table, or are shallow to an impervious layer.

Soil Drainage Class: Moderately well drained

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	7 inches	fine sandy loam	Not reported	Not reported	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.1
2	7 inches	27 inches	clay	Not reported	Not reported	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.1
3	27 inches	68 inches	clay	Not reported	Not reported	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.1
4	68 inches	92 inches	clay	Not reported	Not reported	Max: 0.42 Min: 0.01	Max: 8.4 Min: 6.1

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No Wells Found		

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
23	TX0700071	1/4 - 1/2 Mile WNW

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
--------	---------	---------------------

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
1	TXPLU1000030534	0 - 1/8 Mile SSE
A2	TXD1025474	1/8 - 1/4 Mile WSW
A3	TXPLU1000030548	1/8 - 1/4 Mile WSW
A4	TXPLU1000030547	1/8 - 1/4 Mile WSW
A5	TXPLU1000030550	1/8 - 1/4 Mile WSW
A6	TXPLU1000030549	1/8 - 1/4 Mile WSW
A7	TXPLU1000030546	1/8 - 1/4 Mile WSW
A8	TXMON1000094703	1/8 - 1/4 Mile WSW
A9	TXPLU1000030544	1/8 - 1/4 Mile WSW
A10	TXPLU1000030545	1/8 - 1/4 Mile WSW
B11	TXPLU1000030567	1/4 - 1/2 Mile NNE
C12	TXWDB3000082383	1/4 - 1/2 Mile South
D13	TXPLU1000030568	1/4 - 1/2 Mile NNW
C14	TXWDB3000082373	1/4 - 1/2 Mile South
D15	TXMON1000094818	1/4 - 1/2 Mile North
D16	TXD1025504	1/4 - 1/2 Mile North
B17	TXPLU1000030569	1/4 - 1/2 Mile NNE
B18	TXPLU1000030570	1/4 - 1/2 Mile NNE
B19	TXPLU1000030571	1/4 - 1/2 Mile NNE
B20	TXMON1000094819	1/4 - 1/2 Mile NNE
B21	TXMON1000094820	1/4 - 1/2 Mile NNE
B22	TXMON1000094821	1/4 - 1/2 Mile NNE
E24	TXD1025439	1/4 - 1/2 Mile South
E25	TXMON1000094609	1/4 - 1/2 Mile South
F26	TXMON1000094795	1/4 - 1/2 Mile WNW
F27	TXD1025496	1/4 - 1/2 Mile WNW
28	TXPLU1000030524	1/4 - 1/2 Mile SW
G29	TXPLU1000030576	1/2 - 1 Mile ENE
G30	TXPLU1000030577	1/2 - 1 Mile ENE
G31	TXPLU1000030578	1/2 - 1 Mile ENE
G32	TXPLU1000030575	1/2 - 1 Mile ENE
G33	TXPLU1000030572	1/2 - 1 Mile ENE
G34	TXPLU1000030573	1/2 - 1 Mile ENE
G35	TXPLU1000030574	1/2 - 1 Mile ENE
H36	TXMON1000094625	1/2 - 1 Mile SE
H37	TXMON1000094624	1/2 - 1 Mile SE
H38	TXMON1000094627	1/2 - 1 Mile SE
H39	TXMON1000094626	1/2 - 1 Mile SE
40	TXMON1000094622	1/2 - 1 Mile WSW
41	TXMON1000094694	1/2 - 1 Mile West
I42	TXMON1000094721	1/2 - 1 Mile West
J43	TXMON1000094670	1/2 - 1 Mile West
I44	TXMON1000094714	1/2 - 1 Mile West
J45	TXMON1000094655	1/2 - 1 Mile WSW

OTHER STATE DATABASE INFORMATION

STATE OIL/GAS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
1	TXOG40000576995	1/8 - 1/4 Mile North

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE OIL/GAS WELL INFORMATION


MAP ID	WELL ID	LOCATION FROM TP
2	TXOG40000575575	1/8 - 1/4 Mile ESE
3	TXOG40000577220	1/8 - 1/4 Mile NNE
4	TXOG40000575081	1/8 - 1/4 Mile SE
5	TXOG40000574701	1/4 - 1/2 Mile South
6	TXOG40000576989	1/4 - 1/2 Mile WNW
A7	TXOG40000577844	1/4 - 1/2 Mile NNW
A8	TXOG40000578071	1/4 - 1/2 Mile NNW
9	TXOG40000577501	1/4 - 1/2 Mile NE
B10	TXOG40000577445	1/4 - 1/2 Mile NW
C11	TXOG40000577061	1/4 - 1/2 Mile ENE
D12	TXOG40000576240	1/4 - 1/2 Mile East
D13	TXOG40000576606	1/4 - 1/2 Mile ENE
E14	TXOG40000575353	1/4 - 1/2 Mile ESE
15	TXOG40000576734	1/4 - 1/2 Mile ENE
B16	TXOG40000577815	1/4 - 1/2 Mile NW
C17	TXOG40000577154	1/4 - 1/2 Mile ENE
D18	TXOG40000576022	1/4 - 1/2 Mile East
C19	TXOG40000577187	1/4 - 1/2 Mile ENE
E20	TXOG40000575479	1/4 - 1/2 Mile ESE
F21	TXOG40000577505	1/4 - 1/2 Mile ENE
22	TXOG40000577901	1/4 - 1/2 Mile NE
23	TXOG40000578692	1/4 - 1/2 Mile NNW
F24	TXOG40000577382	1/4 - 1/2 Mile ENE
F25	TXOG40000577866	1/4 - 1/2 Mile NE
F26	TXOG40000577396	1/4 - 1/2 Mile ENE
G27	TXOG40000578956	1/4 - 1/2 Mile NNE
H28	TXOG40000576735	1/2 - 1 Mile ENE
F29	TXOG40000577553	1/2 - 1 Mile ENE
I30	TXOG40000575024	1/2 - 1 Mile ESE
H31	TXOG40000576566	1/2 - 1 Mile East
I32	TXOG40000575108	1/2 - 1 Mile ESE
G33	TXOG40000579072	1/2 - 1 Mile NNE
H34	TXOG40000576749	1/2 - 1 Mile ENE
J35	TXOG40000575616	1/2 - 1 Mile East
36	TXOG40000578573	1/2 - 1 Mile NE
I37	TXOG40000574915	1/2 - 1 Mile ESE
K38	TXOG40000579662	1/2 - 1 Mile North
39	TXOG40000579403	1/2 - 1 Mile NNE
J40	TXOG40000575378	1/2 - 1 Mile ESE
41	TXOG40000579100	1/2 - 1 Mile NE
L42	TXOG40000579651	1/2 - 1 Mile NNW
43	TXOG40000577002	1/2 - 1 Mile ENE
44	TXOG40000577718	1/2 - 1 Mile ENE
45	TXOG40000578583	1/2 - 1 Mile NE
K46	TXOG40000579897	1/2 - 1 Mile North
M47	TXOG40000575082	1/2 - 1 Mile ESE
L48	TXOG40000579919	1/2 - 1 Mile NNW
K49	TXOG40000580097	1/2 - 1 Mile North
N50	TXOG40000580158	1/2 - 1 Mile North
M51	TXOG40000574809	1/2 - 1 Mile ESE
N52	TXOG40000580247	1/2 - 1 Mile North
O53	TXOG40000579886	1/2 - 1 Mile NNW
P54	TXOG40000578178	1/2 - 1 Mile ENE
O55	TXOG40000580075	1/2 - 1 Mile NNW
Q56	TXOG40000580187	1/2 - 1 Mile NNW
R57	TXOG40000579074	1/2 - 1 Mile NE

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

STATE OIL/GAS WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
N58	TXOG40000580450	1/2 - 1 Mile North
R59	TXOG40000579493	1/2 - 1 Mile NE
60	TXOG40000575031	1/2 - 1 Mile ESE
S61	TXOG40000576748	1/2 - 1 Mile East
P62	TXOG40000578239	1/2 - 1 Mile ENE
R63	TXOG40000579230	1/2 - 1 Mile NE
64	TXOG40000574412	1/2 - 1 Mile ESE
R65	TXOG40000579419	1/2 - 1 Mile NE
66	TXOG40000579872	1/2 - 1 Mile NW
T67	TXOG40000580538	1/2 - 1 Mile NNE
O68	TXOG40000580241	1/2 - 1 Mile NNW
S69	TXOG40000576283	1/2 - 1 Mile East
Q70	TXOG40000580609	1/2 - 1 Mile NNW
P71	TXOG40000578337	1/2 - 1 Mile ENE
72	TXOG40000580882	1/2 - 1 Mile North
S73	TXOG40000576541	1/2 - 1 Mile East
T74	TXOG40000580879	1/2 - 1 Mile North
75	TXOG40000580551	1/2 - 1 Mile NNE
U76	TXOG40000575737	1/2 - 1 Mile East
V77	TXOG40000577358	1/2 - 1 Mile ENE
W78	TXOG40000578343	1/2 - 1 Mile ENE
W79	TXOG40000578722	1/2 - 1 Mile ENE
X80	TXOG40000579154	1/2 - 1 Mile NE
V81	TXOG40000577037	1/2 - 1 Mile East
X82	TXOG40000579540	1/2 - 1 Mile NE
W83	TXOG40000578006	1/2 - 1 Mile ENE
84	TXOG40000580273	1/2 - 1 Mile NW
U85	TXOG40000575755	1/2 - 1 Mile East
V86	TXOG40000577704	1/2 - 1 Mile ENE
87	TXOG40000581144	1/2 - 1 Mile North
88	TXOG40000579910	1/2 - 1 Mile NE
V89	TXOG40000577387	1/2 - 1 Mile ENE
Y90	TXOG40000581236	1/2 - 1 Mile NNE
Z91	TXOG40000577047	1/2 - 1 Mile East
92	TXOG40000581410	1/2 - 1 Mile North
Y93	TXOG40000581232	1/2 - 1 Mile NNE
Z94	TXOG40000576668	1/2 - 1 Mile East
95	TXOG40000578958	1/2 - 1 Mile ENE
96	TXOG40000578224	1/2 - 1 Mile ENE
97	TXOG40000573207	1/2 - 1 Mile SE
AA98	TXOG40000579816	1/2 - 1 Mile NE
AB99	TXOG40000581665	1/2 - 1 Mile North
100	TXOG40000577649	1/2 - 1 Mile ENE
AC101	TXOG40000576262	1/2 - 1 Mile East
102	TXOG40000581463	1/2 - 1 Mile NNE
103	TXOG40000575265	1/2 - 1 Mile East
AA104	TXOG40000580206	1/2 - 1 Mile NE
AB105	TXOG40000581860	1/2 - 1 Mile North
AC106	TXOG40000575953	1/2 - 1 Mile East
107	TXOG40000580478	1/2 - 1 Mile NE
108	TXOG40000576826	1/2 - 1 Mile East

PHYSICAL SETTING SOURCE MAP - 3025321.2s

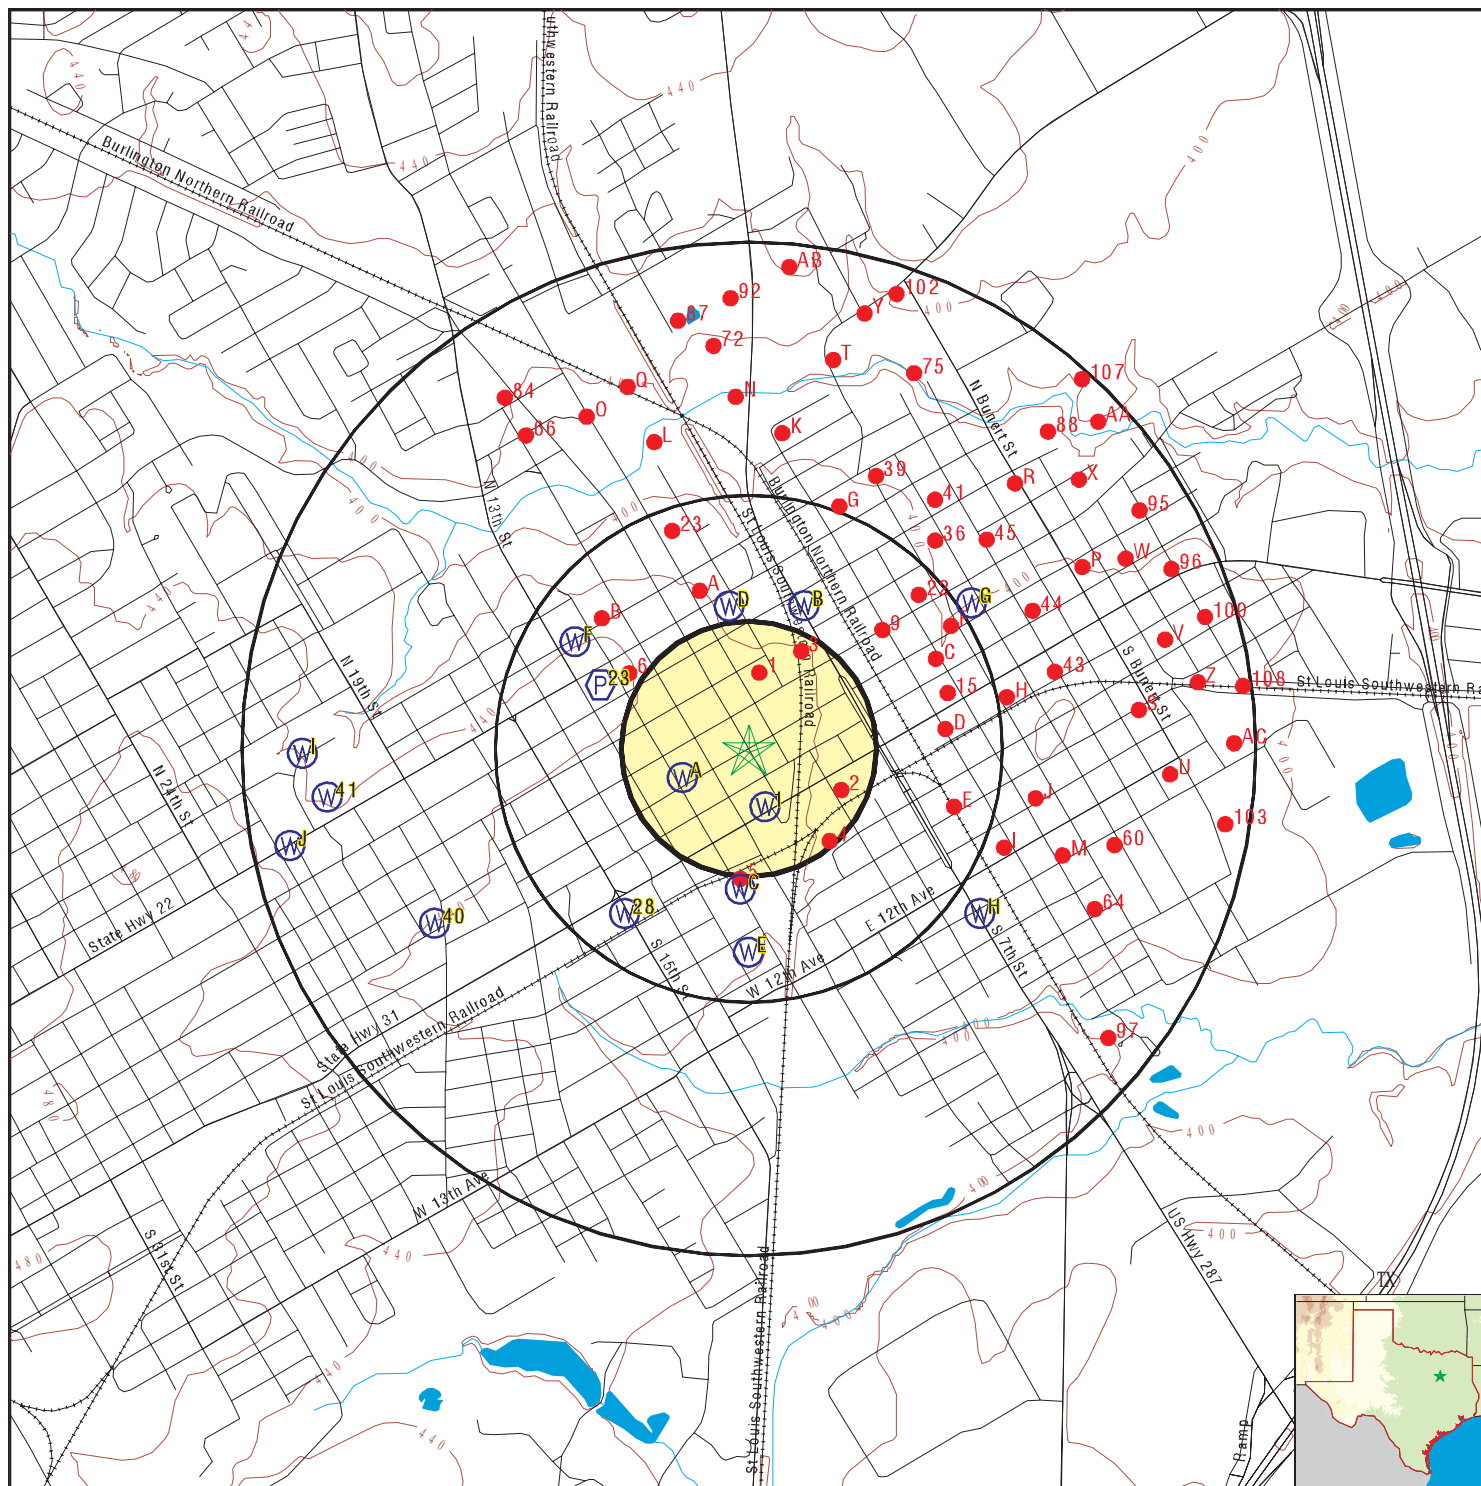

- County Boundary
- Major Roads
- Contour Lines
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons

- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Closest Hydrogeological Data
- Oil or gas wells

SITE NAME: 101 N. Beaton
 ADDRESS: 101 N. Beaton
 Corsicana TX 75110
 LAT/LONG: 32.0936 / 96.4636

CLIENT: G.E.C., Inc.
 CONTACT: Jennifer Lindquist
 INQUIRY #: 3025321.2s
 DATE: March 28, 2011 3:13 pm

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

1
SSE
0 - 1/8 Mile
Lower

TX WELLS TXPLU1000030534

Source Agency:	Texas Water Development Board		
Plugtrackn:	9136	Dateentere:	01/03/2003
Ownname:	Moore Tire & Wheel	Ownstreet:	219 S. Beaton
Owncity:	Coricana	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	same		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320531
Lat dec:	32.091944		
Longitude:	962747		
Long dec:	-96.463055		
Brmod:	GPS?	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW 1-5
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Keith Barge	Histdrilic:	4786
Histdatedr:	08/22/2001	Histtracki:	Not Reported
Histdiamin:	2	Histdepth:	20
Plugdate:	10/07/2002		
Plugmeth:	Entered by DG		
Plugopname:	Eddie Kenebrew	Plugoplic:	3022
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	4	Cfrom1:	0
Cto1:	0	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	20
Cbto1:	0	Cbsacks1:	3
Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	Universal Engineering	Compstreet:	3532 Maggie Blvd
Compcity:	Orlando	Compstate:	TX
Compzip:	32811	Nameassig:	Eddie Kenebrew
Traineenam:	Not Reported	Tnum:	Not Reported

A2
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXD1025474

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source Agency:	Department of Licensing and Regulation		
Rec id:	35917		
Owner:	Michael Kaster	Owner well #:	MW 9
Owner Address:	114 W. Collin	City state zip:	Corsicana ,TX75110
Grid:	33-61-1		
Well address:	301 W. Collin St.		
Well city state:	Corsicana ,TX75110	Latitude:	32° 05 34N
Well county:	Navarro	Longitude:	096° 27 57 W
Elevation:	No Data	Gps brand:	No Data
Type of work:	New Well	Use:	Monitor
Spud date:	5/11/2005	Completed date:	5/11/2005
Diameter:	8 in From Surface To	20 ft	
Drilling method:	Hollow Stem Auger		
Borehole Completed:	Not Reported		
Gravel Packed from:	20 ft to	1.5 ft	
Pack size:	Not Reported		
1st interval:	From 0 ft to .5 ft with	1 Cement	(#sacks and material)
2nd interval:	From .5 ft to 1.5 ft with	1.25 Bentonite	(#sacks and material)
3rd interval:	From 1.5 ft to 20 ft with	2 Sand	(#sacks and material)
Cement method:	Mixed by hand	Cemented by:	Keith Barge
Distance to septic:	No Data	Dist. to property line:	No Data
Verify method:	No Data	Variance:	No Data
Surface completion:	Surface Slab Installed	Static level:	No Data
Flow:	No Data		
Packers:	No Data		
Cement left in well:	No Data	Pump type:	No Data
Pumpbowl depth:	Not Reported	Well tests:	No Data
Yield:	Not Reported		
Water quality:	No Data		
Strata depth:	No Data		
Chem. analysis:	No Data	Undesirable:	No
Certification:	The driller certified that the driller drilled this well (or the well was drilled under the drillers direct supervision) and that each and all of the statements herein are true and correct. The driller understood that failure to complete the required		
Company name:	dba Universal Drilling Services		
Company address:	3532 Maggie Blvd		
City state:	Orlando , FL 32811	Driller license #:	4786
Driller Signature:	Keith Barge	Apprentice signature:	No Data
Apprentice Reg. #:	No Data		
Comments:	No Data		
Description:	0 to 5 Brown topsoil to grey sandy clay5 to 10 Orange/grey sandy clay10 to 15 Grey/green sandy clay15 to 20 Greenish silty brown clay		
Setting:	2 N PVC Riser	0/2.5 Sched. 402	N
	PVC Screen	2.5/20	0.010
Old id :	633		

A3
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXPLU1000030548

Source Agency:	Texas Water Development Board		
Plugtrackn:	31758	Dateentere:	06/03/2006
Ownname:	Michael Kaster	Ownstreet:	114 W. Collin St.
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	301 W. Collin St.		
Wellcity:	Corsicana	Wellzip:	75110
County:	Rains	Latitude:	320534
Lat dec:	32.092777		
Longitude:	962757		
Long dec:	-96.465833		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Brmod:	Garmin Etrix	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW-6
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Not Reported	Histdrllc:	Not Reported
Histdatedr:	10/25/1999	Histtracki:	Not Reported
Histdiamin:	4"	Histdepth:	15"
Plugdate:	06/01/2006		
Plugmeth:	No Data		
Plugopname:	Jackie Raines	Plugoplic:	54661
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	0	Cfrom1:	Not Reported
Cto1:	Not Reported	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	0
Cbto1:	15	Cbsacks1:	2.5 Bentonite
Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	Precision Probe and Drilling	Compstreet:	9416 Prestonwood Drive
Compcity:	Shreveport	Compstate:	LA
Compzip:	71111	Nameassig:	Jackie Raines
Traineenam:	Not Reported	Tnum:	Not Reported

A4 WSW 1/8 - 1/4 Mile Higher

TX WELLS TXPLU1000030547

Source Agency:	Texas Water Development Board		
Plugtrackn:	31757	Dateentere:	06/03/2006
Ownname:	Michale Kaster	Ownstreet:	114 W. Collin St.
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	301 W. Collin St.		
Wellcity:	Corsicana	Wellzip:	75110
County:	Rains	Latitude:	320534
Lat dec:	32.092777		
Longitude:	962757		
Long dec:	-96.465833		
Brmod:	Garmin Etrix	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW-3
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Not Reported	Histdrllc:	Not Reported
Histdatedr:	10/25/1999	Histtracki:	Not Reported
Histdiamin:	2"	Histdepth:	15
Plugdate:	06/01/2006		
Plugmeth:	No Data		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Plugupname:	Jackie Raines	Plugoplic:	54661
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	0	Cfrom1:	Not Reported
Cto1:	Not Reported	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	0
Cbto1:	15	Cbsacks1:	1 Bentonite
Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	Precision Probe and Drilling	Compstreet:	9416 Prestonwood Drive
Compcity:	Shreveport	Compstate:	LA
Compzip:	71115	Nameassig:	Jackie Raines
Traineenam:	Not Reported	Tnum:	Not Reported

**A5
WSW
1/8 - 1/4 Mile
Higher**

TX WELLS TXPLU1000030550

Source Agency:	Texas Water Development Board		
Plugtrackn:	31761	Dateentere:	06/03/2006
Ownnname:	Michael Kaster	Ownstreet:	114 W. Collin St.
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	301 W. Collin St.		
Wellcity:	Corsicana	Wellzip:	75110
County:	Rains	Latitude:	320534
Lat dec:	32.092777		
Longitude:	962757		
Long dec:	-96.465833		
Brmod:	Garmin Etrix	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW-9
Typewater:	0	Typemon:	1
Typeinjt:	0	Typedw:	0
Histdrille:	Not Reported	Histdrilic:	Not Reported
Histdatedr:	10/25/1999	Histtracki:	Not Reported
Histdiamin:	2"	Histdepth:	20'
Plugdate:	06/01/2006		
Plugmeth:	No Data		
Plugopname:	Jackie Raines	Plugoplic:	54661
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	0	Cfrom1:	Not Reported
Cto1:	Not Reported	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	0
Cbto1:	20	Cbsacks1:	1.5 Bentonite

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	Precision Probe and Drilling	Compstreet:	9416 Prestonwood Drive
Compcity:	Shreveport	Compstate:	LA
Compzip:	71115	Nameassig:	Jackie Raines
Traineenam:	Not Reported	Tnum:	Not Reported

A6
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXPLU1000030549

Source Agency:	Texas Water Development Board		
Plugtrackn:	31760	Dateentere:	06/03/2006
Ownname:	Michael Kaster	Ownstreet:	114 W. Collin St.
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	301 W. Collin St.		
Wellcity:	Corsicana	Wellzip:	75110
County:	Rains	Latitude:	320534
Lat dec:	32.092777		
Longitude:	962757		
Long dec:	-96.465833		
Brmod:	Garmin Etrix	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW-8
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Not Reported	Histdrllc:	Not Reported
Histdatedr:	10/25/1999	Histtracki:	Not Reported
Histdiamin:	4"	Histdepth:	15'
Plugdate:	06/01/2006		
Plugmeth:	No Data		
Plugopname:	Jackie Raines	Plugoplic:	54661
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	4"	Cfrom1:	1
Cto1:	15	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	0
Cbto1:	15	Cbsacks1:	2 Bentonite
Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	Precision Probe and Drilling	Compstreet:	9416 Prestonwood Drive
Compcity:	Shreveport	Compstate:	LA
Compzip:	71115	Nameassig:	Jackie Raines
Traineenam:	Not Reported	Tnum:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

A7
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXPLU1000030546

Source Agency:	Texas Water Development Board		
Plugtrackn:	31759	Dateentere:	06/03/2006
Ownname:	Michael Kaster	Ownstreet:	114 W. Collin St.
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	301 W. Collin St.		
Wellcity:	Corsicana	Wellzip:	75110
County:	Rains	Latitude:	320534
Lat dec:	32.092777		
Longitude:	962757		
Long dec:	-96.465833		
Brmod:	Garmin Etrix	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW-7
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Not Reported	Histdrilic:	Not Reported
Histdatedr:	04/04/2006	Histtracki:	Not Reported
Histdiamin:	4"	Histdepth:	15'
Plugdate:	06/01/2006		
Plugmeth:	No Data		
Plugopname:	Jackie Raines	Plugoplic:	54661
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	0	Cfrom1:	Not Reported
Cto1:	Not Reported	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	0
Cbto1:	15	Cbsacks1:	2.5 Bentonite
Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	Precision Probe and Drilling	Compstreet:	9416 Prestonwood Drive
Compcity:	Shreveport	Compstate:	LA
Compzip:	71115	Nameassig:	Jackie Raines
Traineenam:	Not Reported	Tnum:	Not Reported

A8
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXMON1000094703

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source Agency:	Texas Water Development Board		
Trackno:	59393	Dateentere:	05/23/2005
Ownname:	Michael Kaster		
Ownstreet:	114 W. Collin		
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110	County:	Navarro
Wellstreet:	301 W. Collin St.		
Wellcity:	Corsicana	Wellzip:	75110
Own:	MW 9	Latitude:	320534
Lat dec:	32.092777		
Longitude:	962757		
Long dec:	-96.465833		
Elev:	0	Brandmodel:	Not Reported
Gn:	33611	Gn1:	33
Gn75:	61	Gn25:	1
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	1
Ue:	0	Ud:	0
Uin:	0	Uir:	0
Ug:	0	Uij:	0
Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	05/11/2005	Datecomp:	05/11/2005
Dia1:	8	Dia1to:	20
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0 to 5 Brown topsoil to grey sandy clay 5 to 10 Orange/grey sandy clay 10 to 15 Grey/green sandy clay 15 to 20 Greenish silty brown clay		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	0	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	1
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	1
Bcgs:	Not Reported	Bcu:	0
Bcoc:	0	Bcot:	Not Reported
Gpf:	20	Gpt:	1.5
Case Screen:	2 N	PVC Riser	0/2.5 Sched. 40 2 N
	PVC Screen	2.5/20	0.010
Cemfrom1:	0	Cemto1:	.5
Nosacks1:	1 Cement	Cemfrom2:	.5
Cemto2:	1.5	Nosacks2:	1.25 Bentonite
Cemfrom3:	1.5	Cemto3:	20
Nosacks3:	2 Sand	Cementmeth:	Mixed by hand
Cementby:	Keith Barge	Ds:	Not Reported
Dpl:	Not Reported	Dsv:	Not Reported
Appvar:	Not Reported	Scs:	1
Scsv:	0	Scp:	0
Sca:	0	Watlev:	Not Reported
Watlevdate:	03/29/2005	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	Not Reported		
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	0	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowlde:	Not Reported	Wtpump:	0
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Welltestdr:	Not Reported	Welltesthr:	Not Reported
Watqualund:	0	Watqualu 1:	1
Watertype:	Not Reported	Stratdepth:	Not Reported
Chemanaly:	0	Chemanaln:	0
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	dba Universal Drilling Services
Drlicno:	4786	Compstreet:	3532 Maggie Blvd
Compcity:	Orlando	Compstate:	FL
Compzip:	32811	Drillernam:	Keith Barge
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

A9
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXPLU1000030544

Source Agency:	Texas Water Development Board		
Plugtrackn:	31755	Dateentere:	06/03/2006
Ownname:	Michael Kaster	Ownstreet:	114 W Collin St.
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	301 W. Collin St.		
Wellcity:	Corsicana	Wellzip:	75110
County:	Rains	Latitude:	320534
Lat dec:	32.092777		
Longitude:	962757		
Long dec:	-96.465833		
Brmod:	Gamin E Trix	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW-1
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Not Reported	Histdrlic:	Not Reported
Histdatedr:	04/04/2006	Histtracki:	Not Reported
Histdiamin:	4	Histdepth:	15
Plugdate:	06/01/2006		
Plugmeth:	No Data		
Plugopname:	Jackie Raines	Plugoplic:	54661
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	4	Cfrom1:	0
Cto1:	Not Reported	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	0
Cbto1:	15	Cbsacks1:	2.5 Bentonite
Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	Precision Probe and Drilling	Compstreet:	9416 Prestonwood Drive
Compcity:	Shreveport	Compstate:	LA
Compzip:	71115	Nameassig:	Jackie Raines
Traineenam:	Not Reported	Tnum:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

A10
WSW
1/8 - 1/4 Mile
Higher

TX WELLS TXPLU1000030545

Source Agency:	Texas Water Development Board		
Plugtrackn:	31756	Dateentere:	06/03/2006
Ownname:	Michael Kaster	Ownstreet:	114 W. Collin St.
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	301 W. Collin St.		
Wellcity:	Corsicana	Wellzip:	75110
County:	Rains	Latitude:	320534
Lat dec:	32.092777		
Longitude:	962757		
Long dec:	-96.465833		
Brmod:	Garmin E Trix	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW-2
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Not Reported	Histdrilic:	Not Reported
Histdatedr:	04/04/2006	Histtracki:	Not Reported
Histdiamin:	4"	Histdepth:	15'
Plugdate:	06/01/2006		
Plugmeth:	No Data		
Plugopname:	Jackie Raines	Plugoplic:	54661
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	4"	Cfrom1:	1
Cto1:	15	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	0
Cbto1:	15	Cbsacks1:	2 Bentonite
Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	Precision Probe and Drilling	Compstreet:	9416 Prestonwood Drive
Compcity:	hreveport	Compstate:	LA
Compzip:	71115	Nameassig:	Jackie Raines
Traineenam:	Not Reported	Tnum:	Not Reported

B11
NNE
1/4 - 1/2 Mile
Lower

TX WELLS TXPLU1000030567

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source Agency:	Texas Water Development Board		
Plugtrackn:	5515	Dateentere:	03/13/2002
Ownname:	MOORE & MOSES CO.	Ownstreet:	219 S. BEATON
Owncity:	CORICANA	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	SAME		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320550
Lat dec:	32.097221		
Longitude:	962744		
Long dec:	-96.462222		
Brmod:	Not Reported	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	Not Reported
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Not Reported	Histdrilic:	Not Reported
Histdatedr:	07/16/1998	Histtracki:	Not Reported
Histdiamin:	Not Reported	Histdepth:	Not Reported
Plugdate:	01/25/2002		
Plugmeth:	ENTERED BY WLS		
Plugopname:	JOHNNY BODY	Plugoplic:	3060
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	6	Cfrom1:	2
Cto1:	30	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	30
Cbto1:	2	Cbsacks1:	10 H.P.
Cbfrom2:	2	Cbto2:	0
Cbsacks2:	1 CEM	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	UNIVERSAL ENGINEERING SCIENCE	Compstreet:	3532 MAGGIE BLVD.
Compcity:	ORLANDO	Compstate:	FL
Compzip:	32811	Nameassig:	JOHNNY BODY
Traineenam:	Not Reported	Tnum:	Not Reported

C12
South
1/4 - 1/2 Mile
Lower

TX WELLS

TXWDB3000082383

Source Agency:	Texas Water Development Board		
State well:	3361101	County:	Navarro
Basin:	Trinity River	Gma:	8
Rwpa:	C	Districtid:	Not Reported
Previous w:	Not Reported	Latitude:	320523
Lat dec:	32.089721		
Longitude:	962751		
Long dec:	-96.464166		
Owner 1:	City of Corsicana	Owner 2:	Well 1
Driller 1:	--	Driller 2:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Coords Accuracy:	+/- second		
Aquifer code:	211NVTY		
Aquifer id #1:	Other	Aquifer id #2:	0
Aquifer id #3:	0	Elev of LSD:	422
Elev mmt method:	interpolated form topo map		
User code :	0		
Date drill:	1894	Well type:	Not Reported
Well depth:	1035	Source of1:	Not Reported
Type of li:	none	Type of po:	Not Reported
Horsepower:	Not Reported	Primary Use:	unused
Second Use:	Not Reported	Tertia Use:	Not Reported
Water leve:	M	Water qual:	N
Well logs :	Not Reported	Other data:	Not Reported
Date coll :	Not Reported	Reporting :	Not Reported
Well sched:	Y	Construct :	Not Reported
Completion:	Not Reported	Casing mat:	Not Reported
Screen mat:	Not Reported	Todays dat:	09/30/1997
User name:	Not Reported		
State well number:	3361101	Pn well visit mark:	N
Depth from lsd:	Not Reported	Mm date:	7
Dd date:	18	Yy date:	1968
Measurement number:	01	Measuring agency:	Not Reported
Method of meas:	Not Reported	Remark:	Not Reported
Date entered:	Not Reported	User name:	Not Reported

D13
NNW
1/4 - 1/2 Mile
Lower

TX WELLS TXPLU1000030568

Source Agency:	Texas Water Development Board		
Plugtrackn:	6941	Dateentere:	07/16/2002
Ownname:	Goodman Service Station	Ownstreet:	2nd Ave
Owncity:	Corsicanan	Ownstate:	Tx
Ownzip:	75110		
Wellstreet:	2nd Ave		
Wellcity:	Corsicana	Wellzip:	75110
County:	Navarro	Latitude:	320551
Lat dec:	32.097499		
Longitude:	962754		
Long dec:	-96.465		
Brmod:	Not Reported	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW1-5
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Not Reported	Histdrllc:	Not Reported
Histdatedr:	01/01/1955	Histtracki:	Not Reported
Histdiamin:	Not Reported	Histdepth:	30
Plugdate:	06/28/2002		
Plugmeth:	all pipe pulled from wells, wells ranged from 25' to 30'		
Plugopname:	Ricardo Garcia	Plugoplic:	54637
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	Not Reported	Cfrom1:	Not Reported
Cto1:	Not Reported	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	0
Cbto1:	2	Cbsacks1:	1

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Cbfrom2:	2	Cbto2:	30
Cbsacks2:	2 bent	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	W.E.S.T Drilling	Compstreet:	101 Industrial
Compcity:	Waxahachie	Compstate:	Tx
Compzip:	75165	Nameassig:	Ricardo Garcia
Traineenam:	Not Reported	Tnum:	Not Reported

C14
South
1/4 - 1/2 Mile
Lower

TX WELLS TXWDB3000082373

Source Agency:	Texas Water Development Board		
State well:	3361102	County:	Navarro
Basin:	Trinity River	Gma:	8
Rwpa:	C	Districtid:	Not Reported
Previous w:	Not Reported	Latitude:	320522
Lat dec:	32.089444		
Longitude:	962749		
Long dec:	-96.463611		
Owner 1:	City of Corsicana	Owner 2:	Well 5
Driller 1:	H. G. Johnson	Driller 2:	Not Reported
Coords Accuracy:	+/- second		
Aquifer code:	212WDBN		
Aquifer id #1:	Woodbine	Aquifer id #2:	0
Aquifer id #3:	0	Elev of LSD:	418
Elev mmt method:	interpolated form topo map		
User code :	0		
Date drill:	1895	Well type:	Not Reported
Well depth:	2515	Source of1:	Not Reported
Type of li:	none	Type of po:	Not Reported
Horsepower:	Not Reported	Primary Use:	unused
Second Use:	Not Reported	Tertia Use:	Not Reported
Water leve:	M	Water qual:	Y
Well logs :	Not Reported	Other data:	Not Reported
Date coll :	Not Reported	Reporting :	Not Reported
Well sched:	Y	Construct :	Not Reported
Completion:	Not Reported	Casing mat:	Not Reported
Screen mat:	Not Reported	Today's dat:	09/30/1997
User name:	Not Reported		
State well number:	3361102	Mm date:	5
Dd date:	1	Yy date:	1938
Sample number:	1	Storet code:	01045
Flag:	Not Reported	Const val:	120.
Plus minus:	Not Reported		
State well number:	3361102	Pn well visit mark:	P
Depth from lsd:	-82	Mm date:	5
Dd date:	19	Yy date:	1938
Measurement number:	01	Measuring agency:	Not Reported
Method of meas:	Not Reported	Remark:	Not Reported
Date entered:	Not Reported	User name:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

State well number:	3361102	Mm date:	5
Dd date:	1	Yydate:	1938
Sample number:	1	Sample time:	Not Reported
Temp centigrade:	Not Reported	Top s interval:	Not Reported
Bottom s interval:	Not Reported	Samp int aqcode:	Not Reported
Collection remarks:	Not Reported	Reliability rem:	03
Collecting agency:	03	Lab code:	02
Bu wqanalysis:	B	Q00955 flag:	Not Reported
Q00955 silica mgl:	Not Reported	Q00910 flag:	Not Reported
Q00910 calcium mgl:	15	Q00920 flag:	Not Reported
Q00920 magnes mgl:	5.4	Q00929 flag:	c
Q00929 sodium mgl:	1808	Q00937 flag:	Not Reported
Q00937 potass mgl:	Not Reported	Q01080 flag:	Not Reported
Q01080 strontium:	Not Reported	Q00445 carb mgl:	0
Q00440 bicarb mgl:	1580	Q00945 flag:	Not Reported
Q00945 sulfate mgl:	153	Q00940 flag:	Not Reported
Q00940 chloride mgl:	1790	Q00951 flag:	Not Reported
Q00951 fluoride mg:	2.5	Q71850 flag:	<
Q71850 nitrate mgl:	20	Q00403 flag:	Not Reported
Q00403 ph:	Not Reported	Q70300 tds:	4570
Q00415 flag:	Not Reported	Q00415 phen alk:	0
Q00410 flag:	Not Reported	Q00410 total alk:	1294.71
Q00900 tot hardnes:	59	Q00932 percent na:	98
Q00931 sar:	101.84	Q71860 rsc:	24.7
Q00095 flag:	Not Reported	Q00095 spec cond:	Not Reported
Date entered:	Not Reported	User name:	cmuller
Bu value:	Not Reported		

D15
North
1/4 - 1/2 Mile
Lower

TX WELLS TXMON1000094818

Source Agency:	Texas Water Development Board		
Trackno:	5291	Dateentere:	03/02/2002
Ownname:	Goodman Service Station		
Ownstreet:	417 N. Commerce		
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110	County:	Navarro
Wellstreet:	417 N. Commerce		
Wellcity:	Corsicana	Wellzip:	75110
Own:	B 7	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962750		
Long dec:	-96.463888		
Elev:	0	Brandmodel:	Not Reported
Gn:	33611	Gn1:	33
Gn75:	61	Gn25:	1
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	0
Ue:	1	Ud:	0
Uin:	0	Uir:	0
Ug:	0	Uij:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	02/14/2002	Datecomp:	02/14/2002
Dia1:	7.25	Dia1to:	25
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0 - 0.5' Concrete 0.5 - 5' Dark Gray Clay 5 - 15' Gray and Tan Calcareous Clay 15 - 20' Tan Clayey Sand 20 - 25' Tan and Gray Sandy Clay		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	0	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	1
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	0
Bcgs:	Not Reported	Bcu:	0
Bcoc:	0	Bcot:	Not Reported
Gpf:	Not Reported	Gpt:	Not Reported
Case Screen:	No Pipe Installed, Soil Boring Only.		
Cemfrom1:	Not Reported	Cemto1:	Not Reported
Nosacks1:	Not Reported	Cemfrom2:	Not Reported
Cemto2:	Not Reported	Nosacks2:	Not Reported
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	Not Reported
Cementby:	Not Reported	Ds:	Not Reported
Dpl:	Not Reported	Dsv:	Not Reported
Appvar:	Not Reported	Scs:	0
Scsv:	0	Scp:	0
Sca:	0	Watlev:	Not Reported
Watlevdate:	02/14/2002	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	1		
Wptext:	No Pipe Installed	0	2' Cem. 2
	2' 25' Bent.	8	
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	0	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowldc:	Not Reported	Wtpump:	0
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	Not Reported
Welltestdr:	Not Reported	Welltesthr:	Not Reported
Watqualund:	0	Watqualu 1:	0
Watertype:	Not Reported	Stratdepth:	Not Reported
Chemanaly:	0	Chemanaln:	0
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	W.E.S.T., Drilling
Drlicno:	54611	Compstreet:	101 Industrial Dr.
Compcity:	Waxahachie	Compstate:	TX
Compzip:	75165	Drillernam:	Brian Kern
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Environmental Soil Boring. E0202025		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

D16
North
1/4 - 1/2 Mile
Lower

TX WELLS TXD1025504

Source Agency:	Department of Licensing and Regulation		
Rec id:	35976		
Owner:	Goodman Service Station	Owner well #:	B 7
Owner Address:	417 N. Commerce	City state zip:	Corsicana ,TX75110
Grid:	33-61-1		
Well address:	417 N. Commerce		
Well city state:	Corsicana ,TX75110	Latitude:	32° 05 52N
Well county:	Navarro	Longitude:	096° 27 50 W
Elevation:	No Data	Gps brand:	No Data
Type of work:	New Well	Use:	Environmental Soil Boring
Spud date:	2/14/2002	Completed date:	2/14/2002
Diameter:	7.25 in From Surface To	25 ft	
Drilling method:	Hollow Stem Auger		
Borehole Completed:	No Data		
Gravel Packed from:	Not Reported		
Pack size:	Not Reported		
1st interval:	No Data		
2nd interval:	No Data		
3rd interval:	No Data		
Cement method:	Not Reported	Cemented by:	Not Reported
Distance to septic:	Not Reported	Dist. to property line:	Not Reported
Verify method:	Not Reported	Variance:	Not Reported
Surface completion:	No Data	Static level:	No Data
Flow:	No Data		
Packers:	No Data		
Cement left in well:	Not Reported	Pump type:	No Data
Pumpbowl depth:	Not Reported	Well tests:	No Data
Yield:	Not Reported		
Water quality:	No Data		
Strata depth:	No Data		
Chem. analysis:	No Data	Undesirable:	No Data
Certification:	The driller certified that the driller drilled this well (or the well was drilled under the drillers direct supervision) and that each and all of the statements herein are true and correct. The driller understood that failure to complete the required		
Company name:	W.E.S.T., Drilling		
Company address:	101 Industrial Dr.		
City state:	Waxahachie , TX 75165	Driller license #:	54611
Driller Signature:	Brian Kern	Apprentice signature:	No Data
Apprentice Reg. #:	No Data		
Comments:	Environmental Soil Boring. E0202025		
Description:	0 - 0.5 Concrete0.5 - 5 Dark Gray Clay5 - 15 Gray and Tan Calcareous Clay15 - 20 Tan Clayey Sand20 - 25 Tan and Gray Sandy Clay		
Setting:	No Pipe Installed, Soil Boring Only.		
Old id :	633		

B17
NNE
1/4 - 1/2 Mile
Lower

TX WELLS TXPLU1000030569

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source Agency:	Texas Water Development Board		
Plugtrackn:	41455	Dateentere:	09/12/2007
Ownname:	6020 Osborne Propoerties	Ownstreet:	305 North 7th Street
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	Same		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962742		
Long dec:	-96.461666		
Brmod:	Magellan	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW 3
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Michael Bridges	Histdrilic:	54834
Histdatedr:	09/18/2006	Histtracki:	93110
Histdiamin:	2	Histdepth:	45
Plugdate:	09/07/2007		
Plugmeth:	No Data		
Plugopname:	Michael Bridges	Plugoplic:	54834
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	Not Reported	Cfrom1:	Not Reported
Cto1:	Not Reported	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	45
Cbto1:	2	Cbsacks1:	3 Bentonite
Cbfrom2:	2	Cbto2:	0
Cbsacks2:	1 Cement	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	SCI	Compstreet:	5066 Brush Creek Road
Compcity:	Ft. Worth	Compstate:	TX
Compzip:	76119	Nameassig:	Michael Bridges
Traineenam:	Not Reported	Tnum:	Not Reported

B18
NNE
1/4 - 1/2 Mile
Lower

TX WELLS TXPLU1000030570

Source Agency:	Texas Water Development Board		
Plugtrackn:	41456	Dateentere:	09/12/2007
Ownname:	6020 Osborne Propoerties	Ownstreet:	305 North 7th Street
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	Same		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962742		
Long dec:	-96.461666		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Brmod:	Magellan	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW 2
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Michael Bridges	Histdrllc:	54834
Histdatedr:	09/18/2006	Histtracki:	93108
Histdiamin:	2	Histdepth:	25
Plugdate:	09/07/2007		
Plugmeth:	No Data		
Plugopname:	Michael Bridges	Plugoplic:	54834
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	Not Reported	Cfrom1:	Not Reported
Cto1:	Not Reported	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	25
Cbto1:	2	Cbsacks1:	2 Bentonite
Cbfrom2:	2	Cbto2:	0
Cbsacks2:	1 Cement	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	SCI	Compstreet:	5066 Brush Creek Road
Compcity:	Ft. Worth	Compstate:	TX
Compzip:	76119	Nameassig:	Michael Bridges
Traineenam:	Not Reported	Tnum:	Not Reported

B19
NNE
1/4 - 1/2 Mile
Lower

TX WELLS TXPLU1000030571

Source Agency:	Texas Water Development Board		
Plugtrackn:	41457	Dateentere:	09/12/2007
Ownname:	6020 Osborne Propoerties	Ownstreet:	305 North 7th Street
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110		
Wellstreet:	Same		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962742		
Long dec:	-96.461666		
Brmod:	Magellan	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	MW 1
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Michael Bridges	Histdrllc:	54834
Histdatedr:	09/18/2006	Histtracki:	93107
Histdiamin:	2	Histdepth:	30
Plugdate:	09/07/2007		
Plugmeth:	No Data		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Plugopname:	Michael Bridges	Plugoplic:	54834
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	Not Reported	Cfrom1:	Not Reported
Cto1:	Not Reported	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	30
Cbto1:	2	Cbsacks1:	2 Bentonite
Cbfrom2:	2	Cbto2:	0
Cbsacks2:	1 Cement	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	SCI	Compstreet:	5066 Brush Creek Road
Compcity:	Ft. Worth	Compstate:	TX
Compzip:	76119	Nameassig:	Michael Bridges
Traineenam:	Not Reported	Tnum:	Not Reported

B20
NNE
1/4 - 1/2 Mile
Lower

TX WELLS TXMON1000094819

Source Agency:	Texas Water Development Board	Dateentere:	09/19/2006
Trackno:	93107		
Ownname:	6020 Osborne Properties	Ownstate:	TX
Ownstreet:	305 N. 7th Street	County:	Navarro
Owncity:	Corsicana		
Ownzip:	75110	Wellzip:	Not Reported
Wellstreet:	Same	Latitude:	320552
Wellcity:	Not Reported		
Own:	MW 1	Brandmodel:	Magellan
Lat dec:	32.097777	Gn1:	33
Longitude:	962742	Gn25:	1
Long dec:	-96.461666	Tw2:	0
Elev:	0	Twrp:	0
Gn:	33611	Um:	1
Gn75:	61	Ud:	0
Twn:	1	Uir:	0
Tw2:	0	Uij:	0
Twrg:	0	Udw:	0
Ue:	0	Us:	0
Uin:	0	Pbn:	0
Ug:	0	Datecomp:	09/18/2006
Up:	0	Dia1to:	30
Ut:	0	Dia2from:	Not Reported
Pby:	0	Dia3:	Not Reported
Datestart:	09/18/2006	Dia3to:	Not Reported
Dia1:	8.25		
Dia2:	Not Reported	Dmairrotar:	0
Dia2to:	Not Reported		
Dia3from:	Not Reported		
Lith log:	0 to 30' Clay		
Dmdriven:	0		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Dmmudrotar:	0	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	1
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	0
Bcgs:	Not Reported	Bcu:	0
Bcoc:	1	Bcot:	20/40 Sand
Gpf:	Not Reported	Gpt:	Not Reported
Case Screen:	2" New PVC Screen 30' to 15' .010 2" New PVC Riser 15' to 0 s40		
Cemfrom1:	30	Cemto1:	13
Nosacks1:	11 Sand	Cemfrom2:	13
Cemto2:	2	Nosacks2:	3 Bentonite
Cemfrom3:	2	Cemto3:	0
Nosacks3:	2 Cement	Cementmeth:	Mix
Cementby:	SCI	Ds:	Not Reported
Dpl:	Not Reported	Dsv:	Not Reported
Appvar:	Not Reported	Scs:	1
Scsv:	0	Scp:	0
Sca:	0	Watlev:	Not Reported
Watlevdate:	08/23/2006	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	Not Reported		
Tpturbine:	0	Tpjct:	0
Tpsubmersi:	0	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowld:	Not Reported	Wtpump:	0
Wtbailer:	0	Wtjcted:	0
Wtestimate:	0	Welltestyi:	Not Reported
Welltestdr:	Not Reported	Welltesthr:	Not Reported
Watqualund:	0	Watqualu 1:	1
Watertype:	Not Reported	Stratdepth:	Not Reported
Chemanaly:	0	Chemanaln:	0
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	SCI
Drllcno:	54834	Compstreet:	5066 Brush Creek Road
Compcity:	Ft. Worth	Compstate:	TX
Compzip:	76119	Drillernam:	Michael Bridges
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

B21
NNE
1/4 - 1/2 Mile
Lower

TX WELLS TXMON1000094820

Source Agency:	Texas Water Development Board	Dateentere:	09/19/2006
Trackno:	93108		
Ownname:	6020 Osborne Properties	Ownstate:	TX
Ownstreet:	305 N. 7th Street	County:	Navarro
Owncity:	Corsicana		
Ownzip:	75110	Wellzip:	Not Reported
Wellstreet:	Same	Latitude:	320552
Wellcity:	Not Reported		
Own:	MW 2		
Lat dec:	32.097777		
Longitude:	962742		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Long dec:	-96.461666	Brandmodel:	Magellan
Elev:	0	Gn1:	33
Gn:	33611	Gn25:	1
Gn75:	61	Twd:	0
Twn:	1	Twrp:	0
Twr:	0	Um:	1
Twrg:	0	Ud:	0
Ue:	0	Uir:	0
Uin:	0	Uij:	0
Ug:	0	Udw:	0
Up:	0	Us:	0
Ut:	0	Pbn:	0
Pby:	0	Datecomp:	09/18/2006
Datestart:	09/18/2006	Dia1to:	25
Dia1:	8.25	Dia2from:	Not Reported
Dia2:	Not Reported	Dia3:	Not Reported
Dia2to:	Not Reported	Dia3to:	Not Reported
Dia3from:	Not Reported		
Lith log:	0 to 25' Clay	Dmairrotar:	0
Dmdriven:	0	Dmbored:	0
Dmmudrotar:	0	Dmcabletoo:	0
Dmairham:	0	Dmhollowst:	1
Dmjetted:	0	Dmotherck:	0
Dmrevcirc:	0	Bco:	0
Dmother:	Not Reported	Bcg:	0
Bcs:	0	Bcu:	0
Bcgs:	Not Reported	Bcot:	20/40 Sand
Bcoc:	1	Gpt:	Not Reported
Gpf:	Not Reported		
Case Screen:	2" New PVC Screen 25' to 10' .010 2" New PVC Riser 10' to 0 s40		
Cemfrom1:	25	Cemto1:	8
Nosacks1:	10 Sand	Cemfrom2:	8
Cemto2:	2	Nosacks2:	2 Bentonite
Cemfrom3:	2	Cemto3:	0
Nosacks3:	2 Cement	Cementmeth:	Mix
Cementby:	SCI	Ds:	Not Reported
Dpl:	Not Reported	Dsv:	Not Reported
Appvar:	Not Reported	Scs:	1
Scsv:	0	Scp:	0
Sca:	0	Watlev:	Not Reported
Watlevdate:	08/23/2006	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	Not Reported		
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	0	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowld:	Not Reported	Wtpump:	0
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	Not Reported
Welltestdr:	Not Reported	Welltesthr:	Not Reported
Watqualund:	0	Watqualu 1:	1
Watertype:	Not Reported	Stratdepth:	Not Reported
Chemanaly:	0	Chemanaln:	0
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	SCI
Drillico:	54834	Compstreet:	5066 Brush Creek Road

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Compcity:	Ft. Worth	Compstate:	TX
Compzip:	76119	Drillernam:	Michael Bridges
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

B22
NNE
1/4 - 1/2 Mile
Lower

TX WELLS TXMON1000094821

Source Agency:	Texas Water Development Board		
Trackno:	93110	Dateentere:	09/19/2006
Ownname:	6020 Osborne Properties		
Ownstreet:	305 N. 7th Street		
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110	County:	Navarro
Wellstreet:	Same		
Wellcity:	Not Reported	Wellzip:	Not Reported
Own:	MW 3	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962742		
Long dec:	-96.461666		
Elev:	0	Brandmodel:	Magellan
Gn:	33611	Gn1:	33
Gn75:	61	Gn25:	1
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	1
Ue:	0	Ud:	0
Uin:	0	Uir:	0
Ug:	0	Uij:	0
Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	09/18/2006	Datecomp:	09/18/2006
Dia1:	8.25	Dia1to:	45
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0 to 45' Clay		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	0	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	1
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	0
Bcgs:	Not Reported	Bcu:	0
Bcoc:	1	Bcot:	20/40 Sand
Gpf:	Not Reported	Gpt:	Not Reported
Case Screen:	2" New PVC Screen 45' to 20' .010 2" New PVC Riser 20' to 0 s40		
Cemfrom1:	45	Cemto1:	18
Nosacks1:	15 Sand	Cemfrom2:	18
Cemto2:	2	Nosacks2:	5 Bentonite
Cemfrom3:	2	Cemto3:	0
Nosacks3:	2 Cement	Cementmeth:	Mix
Cementby:	SCI	Ds:	Not Reported
Dpl:	Not Reported	Dsv:	Not Reported
Appvar:	Not Reported	Scs:	1
Scsv:	0	Scp:	0
Sca:	0	Watlev:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Watlevdate:	08/23/2006	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	Not Reported		
Tpturbine:	0	Tpjct:	0
Tpsubmersi:	0	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowlde:	Not Reported	Wtpump:	0
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	Not Reported
Welltestdr:	Not Reported	Welltesthr:	Not Reported
Watqualund:	0	Watqualu 1:	1
Watertype:	Not Reported	Stratdepth:	Not Reported
Chemanaly:	0	Chemanaln:	0
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	SCI
Drllcno:	54834	Compstreet:	5066 Brush Creek Road
Compcity:	Ft. Worth	Compstate:	TX
Compzip:	76119	Drillernam:	Michael Bridges
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

23
WNW
1/4 - 1/2 Mile
Higher

FRDS PWS TX0700071

Pwsid:	TX0700071	Epa region:	06
State:	TX	County:	Ellis
Pws name:	CHAMBERS MEADOW ESTATE WATER CO		
Population Served:	135	Pwssvconn:	45
PWS Source:	Groundwater		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	12743		
Facility name:	W SIDE OF I-35		
Facility type:	Well	Treatment process:	hypochlorination, pre
Treatment objective:	disinfection		
Contact name:	WHITSITT, KEN		
Original name:	WHITSITT, KEN		
Contact phone:	254-678-1129	Contact address1:	4793 FM 639
Contact address2:	Not Reported		
Contact city:	FROST		
Contact zip:	76641		
Pwsid:	TX0700071	Epa region:	06
State:	TX	County:	Ellis
Pws name:	CHAMBERS MEADOW ESTATE WATER CO		
Population Served:	135	Pwssvconn:	45
PWS Source:	Groundwater		
Pws type:	CWS		
Status:	Active	Owner type:	Private
Facility id:	39877		
Facility name:	DISTRIBUTION		
Facility type:	Distribution_system_zone	Treatment process:	hypochlorination, pre
Treatment objective:	disinfection		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Contact name: WHITSITT, KEN Original name: WHITSITT, KEN Contact phone: 254-678-1129 Contact address2: Not Reported Contact city: FROST Contact zip: 76641	Contact address1: 4793 FM 639
Pwsid: TX0700071 State: TX Pws name: CHAMBERS MEADOW ESTATE WATER CO Population Served: 135 PWS Source: Groundwater Pws type: CWS Status: Active Facility id: 50369 Facility name: WELL STATION / WOODBINE Facility type: Sampling_station Treatment objective: disinfection	Epa region: 06 County: Ellis Pwssvconn: 45 Owner type: Private Treatment process: hypochlorination, pre
Contact name: WHITSITT, KEN Original name: WHITSITT, KEN Contact phone: 254-678-1129 Contact address2: Not Reported Contact city: FROST Contact zip: 76641	Contact address1: 4793 FM 639
Pwsid: TX0700071 State: TX Pws name: CHAMBERS MEADOW ESTATE WATER CO Population Served: 135 PWS Source: Groundwater Pws type: CWS Status: Active Facility id: 8771 Facility name: PS 1 Facility type: Treatment_plant Treatment objective: disinfection	Epa region: 06 County: Ellis Pwssvconn: 45 Owner type: Private Treatment process: hypochlorination, pre
Contact name: WHITSITT, KEN Original name: WHITSITT, KEN Contact phone: 254-678-1129 Contact address2: Not Reported Contact city: FROST Contact zip: 76641	Contact address1: 4793 FM 639
PWS ID: TX0700071 Date Initiated: Not Reported Date Deactivated: Not Reported PWS Name: CHAMBERS MEADOW ESTATE C/O O B VELDMAN PO BOX 2297 CORSICANA, TX 75151	
Addressee / Facility: System Owner/Responsible Party O B VELDMAN	
Facility Latitude: 32 05 43 City Served: Not Reported Treatment Class: Treated	Facility Longitude: 096 28 06 Population: 00000026

Violations information not reported.

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

E24
South
1/4 - 1/2 Mile
Lower

TX WELLS TXD1025439

Source Agency:	Department of Licensing and Regulation		
Rec id:	35932		
Owner:	City of Corsicana	Owner well #:	MW-1
Owner Address:	620 12th Street	City state zip:	Corsicana ,tx
Grid:	33-61-1		
Well address:	620 12th Street		
Well city state:	Corsicana ,TX	Latitude:	32° 05 16N
Well county:	Navarro	Longitude:	096° 27 49 W
Elevation:	No Data	Gps brand:	Magellan 315
Type of work:	New Well	Use:	Monitor
Spud date:	10/15/2003	Completed date:	10/15/2003
Diameter:	7.5 in From Surface To	25 ft	
Drilling method:	Hollow Stem Auger		
Borehole Completed:	Not Reported		
Gravel Packed from:	Not Reported		
Pack size:	Not Reported		
1st interval:	From 3 ft to 25 ft with sand	(#sacks and material)	
2nd interval:	From 1 ft to 3 ft with bentonite	(#sacks and material)	
3rd interval:	From 0 ft to 1 ft with cement	(#sacks and material)	
Cement method:	hand placed	Cemented by:	Miguel Hernandez
Distance to septic:	No Data	Dist. to property line:	No Data
Verify method:	No Data	Variance:	No Data
Surface completion:	Surface Slab Installed	Static level:	No Data
Flow:	No Data		
Packers:	No Data		
Cement left in well:	No Data	Pump type:	No Data
Pumpbowl depth:	Not Reported	Well tests:	No Data
Yield:	Not Reported		
Water quality:	No Data		
Strata depth:	No Data		
Chem. analysis:	No Data	Undesirable:	No
Certification:	The driller certified that the driller drilled this well (or the well was drilled under the drillers direct supervision) and that each and all of the statements herein are true and correct. The driller understood that failure to complete the required		
Company name:	CM2, Inc		
Company address:	11836 Judd Court 304-C		
City state:	Dallas , TX 75243	Driller license #:	50297
Driller Signature:	Miguel Hernandez	Apprentice signature:	No Data
Apprentice Reg. #:	No Data		
Comments:	No Data		
Description:	0 to 5 feet dark grey clay5 to 24 feet Light brown silty clay24 to 25 feet dark grey shale		
Setting:	2 new sch 40 PVC from 5 to 25 feet .010 screen2 new sch 40 PVC from 0 to 5 feet riser		
Old id :	419		

E25
South
1/4 - 1/2 Mile
Lower

TX WELLS TXMON1000094609

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source Agency:	Texas Water Development Board		
Trackno:	26923	Dateentere:	10/17/2003
Ownname:	City of Corsicana		
Ownstreet:	620 12th Street		
Owncity:	Corsicana	Ownstate:	tx
Ownzip:	Not Reported	County:	Navarro
Wellstreet:	620 12th Street		
Wellcity:	Corsicana	Wellzip:	Not Reported
Own:	MW-1	Latitude:	320516
Lat dec:	32.087777		
Longitude:	962749		
Long dec:	-96.463611		
Elev:	0	Brandmodel:	Magellan 315
Gn:	33611	Gn1:	33
Gn75:	61	Gn25:	1
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	1
Ue:	0	Ud:	0
Uin:	0	Uir:	0
Ug:	0	Uij:	0
Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	10/15/2003	Datecomp:	10/15/2003
Dia1:	7.5	Dia1to:	25
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0 to 5 feet dark grey clay 5 to 24 feet Light brown silty clay 24 to 25 feet dark grey shale		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	0	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	1
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	0
Bcgs:	Not Reported	Bcu:	0
Bcoc:	1	Bcot:	sand pack
Gpf:	Not Reported	Gpt:	Not Reported
Case Screen:	2 new sch 40 PVC from 5 to 25 feet .010 screen 2 new sch 40 PVC from 0 to 5 feet riser		
Cemfrom1:	3	Cemto1:	25
Nosacks1:	sand	Cemfrom2:	1
Cemto2:	3	Nosacks2:	bentonite
Cemfrom3:	0	Cemto3:	1
Nosacks3:	cement	Cementmeth:	hand placed
Cementby:	Miguel Hernandez	Ds:	Not Reported
Dpl:	Not Reported	Dsv:	Not Reported
Appvar:	Not Reported	Scs:	1
Scsv:	0	Scp:	0
Sca:	0	Watlev:	Not Reported
Watlevdate:	08/22/2003	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	Not Reported		
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	0	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowlde:	Not Reported	Wtpump:	0
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Welltestdr: Not Reported
 Watqualund: 0
 Watertype: Not Reported
 Chemanaly: 0
 Undnatural: 0
 Undhydro: 0
 Undotherck: 0
 Undother: Not Reported
 Undcertify: 0
 Drllcno: 50297
 Compcity: Dallas
 Compzip: 75243
 Traineenam: Not Reported
 Comments 1: Not Reported

Welltesthr: Not Reported
 Watqualu 1: 1
 Stratdepth: Not Reported
 Chemanaln: 0
 Untype: Not Reported
 Undhaz: 0
 Compname: CM2, Inc
 Compstreet: 11836 Judd Court 304-C
 Compstate: TX
 Drillernam: Miguel Hernandez
 Tnum: Not Reported

**F26
 WNW
 1/4 - 1/2 Mile
 Higher**

TX WELLS TXMON1000094795

<p>Source Agency: Texas Water Development Board Trackno: 39656 Ownname: Navarro County Justice Center Ownstreet: 312 W. Second Avenue Owncity: Corsicana Ownzip: Not Reported Wellstreet: 312 W. Second Avenue Wellcity: Corsicana Own: B-1,2,3,4 Lat dec: 32.096666 Longitude: 962810 Long dec: -96.469443 Elev: 0 Gn: 33611 Gn75: 61 Twn: 1 Twr: 0 Twrg: 0 Ue: 1 Uin: 0 Ug: 0 Up: 0 Ut: 0 Pby: 0 Datestart: 06/10/2004 Dia1: 2 Dia2: Not Reported Dia2to: Not Reported Dia3from: Not Reported Lith log: 0 to 19 feet dark grey silty clay Dmdriven: 0 Dmmudrotar: 0 Dmairham: 0 Dmjetted: 0 Dmrevcirc: 0 Dmother: Direct Push Bcs: 0 Bcgs: Not Reported Bcoc: 1 Gpf: Not Reported Case Screen: Not Reported</p>	<p>Dateentere: 06/24/2004 Ownstate: TX County: Navarro Wellzip: Not Reported Latitude: 320548 Brandmodel: Magellan 315 Gn1: 33 Gn25: 1 Twd: 0 Twrp: 0 Um: 0 Ud: 0 Uir: 0 Uij: 0 Udw: 0 Us: 0 Pbn: 0 Datecomp: 06/10/2004 Dia1to: 19 Dia2from: Not Reported Dia3: Not Reported Dia3to: Not Reported Dmairrotar: 0 Dmbored: 0 Dmcabletoo: 0 Dmhollowst: 0 Dmotherck: 1 Bco: 0 Bcg: 0 Bcu: 0 Bcot: Plugged Gpt: Not Reported</p>
---	--

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Cemfrom1:	0	Cemto1:	19
Nosacks1:	1	Cemfrom2:	Not Reported
Cemto2:	Not Reported	Nosacks2:	Not Reported
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	Bentonite
Cementby:	Walter Crabb	Ds:	Not Reported
Dpl:	Not Reported	Dsv:	Not Reported
Appvar:	Not Reported	Scs:	0
Scsv:	0	Scp:	0
Sca:	0	Watlev:	Not Reported
Watlevdate:	08/04/2003	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	Not Reported		
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	0	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowld:	Not Reported	Wtpump:	0
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	Not Reported
Welltestdr:	Not Reported	Welltesthr:	Not Reported
Watqualund:	0	Watqualu 1:	1
Watertype:	Not Reported	Stratdepth:	Not Reported
Chemanaly:	0	Chemanaln:	0
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	CM2, Inc.
Drlicno:	50264	Compstreet:	11817 Judd Court 115
Compcity:	Dallas	Compstate:	TX
Compzip:	75243	Drillernam:	Walter Crabb
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

F27 WNW 1/4 - 1/2 Mile Higher

TX WELLS TXD1025496

Source Agency:	Department of Licensing and Regulation		
Rec id:	35926		
Owner:	Navarro County Justice Center	Owner well #:	B-1,2,3,4
Owner Address:	312 W. Second Avenue	City state zip:	Corsicana ,TX
Grid:	33-61-1		
Well address:	312 W. Second Avenue		
Well city state:	Corsicana ,TX	Latitude:	32° 05 48N
Well county:	Navarro	Longitude:	096° 28 10 W
Elevation:	No Data	Gps brand:	Magellan 315
Type of work:	New Well	Use:	Environmental Soil Boring
Spud date:	6/10/2004	Completed date:	6/10/2004
Diameter:	2 in From Surface To	19 ft	
Drilling method:	Not Reported		
Borehole Completed:	Not Reported		
Gravel Packed from:	Not Reported		
Pack size:	Not Reported		
1st interval:	From 0 ft to 19 ft with 1		(#sacks and material)

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

2nd interval:	No Data		
3rd interval:	No Data		
Cement method:	Bentonite	Cemented by:	Walter Crabb
Distance to septic:	No Data	Dist. to property line:	No Data
Verify method:	No Data	Variance:	No Data
Surface completion:	No Data	Static level:	No Data
Flow:	No Data		
Packers:	No Data		
Cement left in well:	No Data	Pump type:	No Data
Pumpbowl depth:	Not Reported	Well tests:	No Data
Yield:	Not Reported		
Water quality:	No Data		
Strata depth:	No Data		
Chem. analysis:	No Data	Undesirable:	No
Certification:	The driller certified that the driller drilled this well (or the well was drilled under the drillers direct supervision) and that each and all of the statements herein are true and correct. The driller understood that failure to complete the required		
Company name:	CM2, Inc.		
Company address:	11817 Judd Court 115		
City state:	Dallas , TX 75243	Driller license #:	50264
Driller Signature:	Walter Crabb	Apprentice signature:	No Data
Apprentice Reg. #:	No Data		
Comments:	No Data		
Description:	0 to 19 feet dark grey silty clay		
Old id :	419		

28
SW
1/4 - 1/2 Mile
Higher

TX WELLS TXPLU1000030524

Source Agency:	Texas Water Development Board		
Plugtrackn:	1893	Dateentere:	06/26/2001
Ownname:	Stalworth Corp.	Ownstreet:	Not Reported
Owncity:	Collage Station	Ownstate:	Not Reported
Ownzip:	Not Reported		
Wellstreet:	601 W. 7th Ave.		
Wellcity:	Corsicana	Wellzip:	Not Reported
County:	Navarro	Latitude:	320520
Lat dec:	32.088888		
Longitude:	962804		
Long dec:	-96.467777		
Brmod:	map program	Gn:	33611
Gn1:	33	Gn75:	61
Gn25:	1	Ownwellno:	1a-5a
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	Not Reported	Histdrllc:	Not Reported
Histdatedr:	08/29/1997	Histracki:	Not Reported
Histdiamin:	Not Reported	Histdepth:	20
Plugdate:	06/20/2001		
Plugmeth:	5 wells [mw1a, mw2a, mw3, mw4, and mw5a] 3 wells at 20' 1 well at 17.5 and one well at 12.5'. pulled all casing in 4 of the wells. mw 3, tried to pull by hand only got 2.5 of riser off.		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Plugopname:	Tom McCullough	Plugoplic:	4806
Plugmeth1:	0	Plugmeth2:	0
Plugmeth3:	1	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	2	Cfrom1:	2.5
Cto1:	12.5	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	0
Cbto1:	2	Cbsacks1:	1
Cbfrom2:	2	Cbto2:	20
Cbsacks2:	3 bento.	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	W.E.S.T. Drilling	Compstreet:	101 Industrial
Compcity:	Waxahachie	Compstate:	Tx
Compzip:	75165	Nameassig:	Tom McCullough
Traineenam:	Not Reported	Tnum:	Not Reported

G29
ENE
1/2 - 1 Mile
Lower

TX WELLS TXPLU1000030576

Source Agency:	Texas Water Development Board		
Plugtrackn:	11965	Dateentere:	05/13/2003
Ownname:	JACKIE THOMAS	Ownstreet:	628 S. 7TH ST
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75151		
Wellstreet:	SAME		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962722		
Long dec:	-96.456111		
Brmod:	MAP	Gn:	33612
Gn1:	33	Gn75:	61
Gn25:	2	Ownwellno:	MW 8
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	TERRY	Histdrlic:	Not Reported
Histdatedr:	12/04/1996	Histracki:	Not Reported
Histdiamin:	Not Reported	Histdepth:	12.5
Plugdate:	04/07/2003		
Plugmeth:	ENTERED BY DG		
Plugopname:	EDDIE	Plugoplic:	3100
Plugmeth1:	0	Plugmeth2:	1
Plugmeth3:	0	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	0	Cfrom1:	0
Cto1:	0	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	12.5
Cbto1:	.5	Cbsacks1:	1

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Cbfrom2:	.5	Cbto2:	0
Cbsacks2:	1	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	EDDIE JOWELL	Compstreet:	PO BOX 972
Compcity:	PALESTINE	Compstate:	TX
Compzip:	75802	Nameassig:	EDDIE
Traineenam:	Not Reported	Tnum:	Not Reported

G30
ENE
1/2 - 1 Mile
Lower

TX WELLS

TXPLU1000030577

Source Agency:	Texas Water Development Board		
Plugtrackn:	11966	Dateentere:	05/13/2003
Ownname:	JACKIE THOMAS	Ownstreet:	628 S. 7TH ST
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75151		
Wellstreet:	SAME		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962722		
Long dec:	-96.456111		
Brmod:	MAP	Gn:	33612
Gn1:	33	Gn75:	61
Gn25:	2	Ownwellno:	MW 9
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	TERRY	Histdrllc:	Not Reported
Histdatedr:	12/04/1996	Histtracki:	Not Reported
Histdiamin:	Not Reported	Histdepth:	16
Plugdate:	04/07/2003		
Plugmeth:	ENTERED BY DG		
Plugopname:	EDDIE	Plugoplic:	3100
Plugmeth1:	0	Plugmeth2:	1
Plugmeth3:	0	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	0	Cfrom1:	0
Cto1:	0	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	16
Cbto1:	1	Cbsacks1:	2 BEN
Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	EDDIE JOWELL	Compstreet:	PO BOX 972
Compcity:	PALESTINE	Compstate:	TX
Compzip:	75802	Nameassig:	EDDIE
Traineenam:	Not Reported	Tnum:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

G31
ENE
1/2 - 1 Mile
Lower

TX WELLS TXPLU1000030578

Source Agency:	Texas Water Development Board		
Plugtrackn:	11967	Dateentere:	05/13/2003
Ownname:	JACKIE THOMAS	Ownstreet:	628 S. 7TH ST
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75151		
Wellstreet:	SAME		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962722		
Long dec:	-96.456111		
Brmod:	MAP	Gn:	33612
Gn1:	33	Gn75:	61
Gn25:	2	Ownwellno:	MW 10
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	TERRY	Histdrilic:	Not Reported
Histdatedr:	12/04/1996	Histtracki:	Not Reported
Histdiamin:	Not Reported	Histdepth:	17.5
Plugdate:	04/07/2003		
Plugmeth:	ENTERED BY DG		
Plugopname:	EDDIE	Plugoplic:	3100
Plugmeth1:	0	Plugmeth2:	1
Plugmeth3:	0	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	0	Cfrom1:	0
Cto1:	0	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	17.5
Cbto1:	1	Cbsacks1:	2 BEN
Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	EDDIE JOWELL	Compstreet:	PO BOX 972
Compcity:	PALESTINE	Compstate:	TX
Compzip:	75802	Nameassig:	EDDIE
Traineenam:	Not Reported	Tnum:	Not Reported

G32
ENE
1/2 - 1 Mile
Lower

TX WELLS TXPLU1000030575

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Source Agency:	Texas Water Development Board		
Plugtrackn:	11964	Dateentere:	05/13/2003
Ownname:	JACKIE THOMAS	Ownstreet:	628 S. 7TH ST
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75151		
Wellstreet:	SAME		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962722		
Long dec:	-96.456111		
Brmod:	MAP	Gn:	33612
Gn1:	33	Gn75:	61
Gn25:	2	Ownwellno:	MW 4
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	BILLY CONNELLY	Histdrilic:	Not Reported
Histdatedr:	12/09/1996	Histtracki:	Not Reported
Histdiamin:	8	Histdepth:	13
Plugdate:	04/07/2003		
Plugmeth:	ENTERED BY DG		
Plugopname:	EDDIE	Plugoplic:	3100
Plugmeth1:	0	Plugmeth2:	1
Plugmeth3:	0	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	0	Cfrom1:	0
Cto1:	0	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	13
Cbto1:	1	Cbsacks1:	2 BEN
Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	EDDIE JOWELL	Compstreet:	PO BOX 972
Compcity:	PALESTINE	Compstate:	TX
Compzip:	75802	Nameassig:	EDDIE
Traineenam:	Not Reported	Tnum:	Not Reported

G33
ENE
1/2 - 1 Mile
Lower

TX WELLS

TXPLU1000030572

Source Agency:	Texas Water Development Board		
Plugtrackn:	11961	Dateentere:	05/13/2003
Ownname:	JACKIE THOMAS	Ownstreet:	628 S. 7TH ST
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75151		
Wellstreet:	SAME		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962722		
Long dec:	-96.456111		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Brmod:	MAP	Gn:	33612
Gn1:	33	Gn75:	61
Gn25:	2	Ownwellno:	MW 1
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	BILLY CONNELLY	Histdrilic:	Not Reported
Histdatedr:	12/09/1996	Histtracki:	Not Reported
Histdiamin:	8	Histdepth:	13
Plugdate:	04/07/2003		
Plugmeth:	ENTERED BY DG		
Plugopname:	EDDIE	Plugoplic:	3100
Plugmeth1:	0	Plugmeth2:	1
Plugmeth3:	0	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	0	Cfrom1:	0
Cto1:	0	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	13
Cbto1:	1	Cbsacks1:	2 BEN
Cbfrom2:	1	Cbto2:	0
Cbsacks2:	1	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	EDDIE JOWELL	Compstreet:	PO BOX 972
Compcity:	PALESTINE	Compstate:	TX
Compzip:	75802	Nameassig:	EDDIE
Traineenam:	Not Reported	Tnum:	Not Reported

G34
ENE
1/2 - 1 Mile
Lower

TX WELLS TXPLU1000030573

Source Agency:	Texas Water Development Board		
Plugtrackn:	11962	Dateentere:	05/13/2003
Ownname:	JACKIE THOMAS	Ownstreet:	628 S. 7TH ST
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75151		
Wellstreet:	SAME		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962722		
Long dec:	-96.456111		
Brmod:	MAP	Gn:	33612
Gn1:	33	Gn75:	61
Gn25:	2	Ownwellno:	MW 2
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	BILLY CONNELLY	Histdrilic:	Not Reported
Histdatedr:	12/09/1996	Histtracki:	Not Reported
Histdiamin:	8	Histdepth:	15
Plugdate:	04/07/2003		
Plugmeth:	ENTERED BY DG		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Plugopname:	EDDIE	Plugoplic:	3100
Plugmeth1:	0	Plugmeth2:	1
Plugmeth3:	0	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	0	Cfrom1:	0
Cto1:	0	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	15
Cbto1:	1	Cbsacks1:	2 BEN
Cbfrom2:	1	Cbto2:	0
Cbsacks2:	1	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	EDDIE JOWELL	Compstreet:	PO BOX 972
Compcity:	PALESTINE	Compstate:	TX
Compzip:	75802	Nameassig:	EDDIE
Traineenam:	Not Reported	Tnum:	Not Reported

G35
ENE
1/2 - 1 Mile
Lower

TX WELLS TXPLU1000030574

Source Agency:	Texas Water Development Board		
Plugtrackn:	11963	Dateentere:	05/13/2003
Ownname:	JACKIE THOMAS	Ownstreet:	628 S. 7TH ST
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75151		
Wellstreet:	SAME		
Wellcity:	Not Reported	Wellzip:	Not Reported
County:	Navarro	Latitude:	320552
Lat dec:	32.097777		
Longitude:	962722		
Long dec:	-96.456111		
Brmod:	MAP	Gn:	33612
Gn1:	33	Gn75:	61
Gn25:	2	Ownwellno:	MW 3
Typewater:	0	Typemon:	1
Typeinj:	0	Typedw:	0
Histdrille:	BILLY CONNELLY	Histdrilic:	Not Reported
Histdatedr:	12/09/1996	Histracki:	Not Reported
Histdiamin:	8	Histdepth:	12.5
Plugdate:	04/07/2003		
Plugmeth:	ENTERED BY DG		
Plugopname:	EDDIE	Plugoplic:	3100
Plugmeth1:	0	Plugmeth2:	1
Plugmeth3:	0	Plugmeth4:	0
Plugmethot:	0	Plugvar:	Not Reported
Cdiam1:	0	Cfrom1:	0
Cto1:	0	Cdiam2:	Not Reported
Cfrom2:	Not Reported	Cto2:	Not Reported
Cdiam3:	Not Reported	Cfrom3:	Not Reported
Cto3:	Not Reported	Cbfrom1:	12.5
Cbto1:	1	Cbsacks1:	2 BEN

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Cbfrom2:	Not Reported	Cbto2:	Not Reported
Cbsacks2:	Not Reported	Cbfrom3:	Not Reported
Cbto3:	Not Reported	Cbsacks3:	Not Reported
Cbfrom4:	Not Reported	Cbto4:	Not Reported
Cbsacks4:	Not Reported	Cbfrom5:	Not Reported
Cbto5:	Not Reported	Cbsacks5:	Not Reported
Compname:	EDDIE JOWELL	Compstreet:	PO BOX 972
Compcity:	PALESTINE	Compstate:	TX
Compzip:	75802	Nameassig:	EDDIE
Traineenam:	Not Reported	Tnum:	Not Reported

H36
SE
1/2 - 1 Mile
Lower

TX WELLS TXMON1000094625

Source Agency:	Texas Water Development Board		
Trackno:	153497	Dateentere:	09/16/2008
Ownname:	Mr. Robert Zazula American Bus. Lending		
Ownstreet:	1420 W. Mockingbird Lane S.380		
Owncity:	Dallas	Ownstate:	TX
Ownzip:	75247	County:	Navarro
Wellstreet:	801 S. 7th Street		
Wellcity:	Corsicana	Wellzip:	75110
Own:	MW-2	Latitude:	320520
Lat dec:	32.088888		
Longitude:	962721		
Long dec:	-96.455833		
Elev:	493	Brandmodel:	garmin
Gn:	33612	Gn1:	33
Gn75:	61	Gn25:	2
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	1
Ue:	0	Ud:	0
Uin:	0	Uir:	0
Ug:	0	Uij:	0
Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	09/16/2008	Datecomp:	09/16/2008
Dia1:	7.25	Dia1to:	35
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0-5 dr br clay 5-30 clay tan 30-35 shale grey		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	0	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	1
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	1
Bcgs:	16-30	Bcu:	0
Bcoc:	0	Bcot:	Not Reported
Gpf:	35	Gpt:	3
Case Screen:	2 new pvc riser	pvc screen 5-0 sch.40	35-5 .010 2 new

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Cemfrom1:	3	Cemto1:	1.5
Nosacks1:	1 bentonite	Cemfrom2:	1.5
Cemto2:	0	Nosacks2:	1 cement
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	gravity
Cementby:	W.E.S.T.	Ds:	Not Reported
Dpl:	Not Reported	Dsv:	Not Reported
Appvar:	Not Reported	Scs:	1
Scsv:	0	Scp:	0
Sca:	0	Watlev:	Not Reported
Watlevdate:	09/06/2005	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	perment well		
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	0	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowld:	Not Reported	Wtpump:	0
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	Not Reported
Welltestdr:	Not Reported	Welltesthr:	Not Reported
Watqualund:	0	Watqualu 1:	1
Watertype:	Not Reported	Stratdepth:	Not Reported
Chemanaly:	0	Chemanaln:	1
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	W.E.S.T. Drilling
Drillico:	54894	Compstreet:	101 Industrial Drive
Compcity:	Waxahachie	Compstate:	TX
Compzip:	75165	Drillernam:	James Spaniel
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

H37
SE
1/2 - 1 Mile
Lower

TX WELLS TXMON1000094624

Source Agency:	Texas Water Development Board		
Trackno:	153496	Dateentere:	09/16/2008
Ownname:	Mr. Robert Zazula American Bus. Lending		
Ownstreet:	1420 W. Mockingbird Lane S.380		
Owncity:	Dallas	Ownstate:	TX
Ownzip:	75247	County:	Navarro
Wellstreet:	801 S. 7th Street		
Wellcity:	Corsicana	Wellzip:	75110
Own:	MW-1	Latitude:	320520
Lat dec:	32.088888		
Longitude:	962721		
Long dec:	-96.455833		
Elev:	493	Brandmodel:	garmin
Gn:	33612	Gn1:	33
Gn75:	61	Gn25:	2
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	1
Ue:	0	Ud:	0
Uin:	0	Uir:	0
Ug:	0	Uij:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	09/16/2008	Datecomp:	09/16/2008
Dia1:	7.25	Dia1to:	40
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0-10 dr br clay 10-15 clay tan 15-32.5 Shalee clay tan 32.5-35 Shale claye grey 35-40 shale grey		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	0	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	1
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	1
Bcgs:	16-30	Bcu:	0
Bcoc:	0	Bcot:	Not Reported
Gpf:	40	Gpt:	3
Case Screen:	2 new	pvc screen	40-5 .010 2 new
	pvc riser	5-0	sch.40
Cemfrom1:	3	Cemto1:	1.5
Nosacks1:	1 bentonite	Cemfrom2:	1.5
Cemto2:	0	Nosacks2:	1 cement
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	gravity
Cementby:	W.E.S.T.	Ds:	Not Reported
Dpl:	Not Reported	Dsv:	Not Reported
Appvar:	Not Reported	Scs:	1
Scsv:	0	Scp:	0
Sca:	0	Watlev:	Not Reported
Watlevdate:	09/06/2005	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	perment well		
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	0	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowld:	Not Reported	Wtpump:	0
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	Not Reported
Welltestdr:	Not Reported	Welltesthr:	Not Reported
Watqualund:	0	Watqualu 1:	1
Watertype:	Not Reported	Stratdepth:	Not Reported
Chemanaly:	0	Chemanaln:	1
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	W.E.S.T. Drilling
Drllcno:	54894	Compstreet:	101 Industrial Drive
Compcity:	Waxahachie	Compstate:	TX
Compzip:	75165	Drillernam:	James Spaniel
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

H38
SE
1/2 - 1 Mile
Lower

TX WELLS TXMON1000094627

Source Agency:	Texas Water Development Board		
Trackno:	153499	Dateentere:	09/16/2008
Ownname:	Mr. Robert Zazula American Bus. Lending		
Ownstreet:	1420 W. Mockingbird Lane S.380		
Owncity:	Dallas	Ownstate:	TX
Ownzip:	75247	County:	Navarro
Wellstreet:	801 S. 7th Street		
Wellcity:	Corsicana	Wellzip:	75110
Own:	B-2	Latitude:	320520
Lat dec:	32.088888		
Longitude:	962721		
Long dec:	-96.455833		
Elev:	493	Brandmodel:	garmin
Gn:	33612	Gn1:	33
Gn75:	61	Gn25:	2
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	0
Ue:	1	Ud:	0
Uin:	0	Uir:	0
Ug:	0	Uij:	0
Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	09/16/2008	Datecomp:	09/16/2008
Dia1:	7.25	Dia1to:	20
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0-8 fill sand and gravel dr br 8-20 tan clay		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	0	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	1
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	0
Bcgs:	Not Reported	Bcu:	0
Bcoc:	1	Bcot:	3/8 bentonite chips
Gpf:	Not Reported	Gpt:	Not Reported
Case Screen:	boring		
Cemfrom1:	20	Cemto1:	2
Nosacks1:	7 bentonite	Cemfrom2:	2
Cemto2:	0	Nosacks2:	1 cement
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	gravity
Cementby:	W.E.S.T.	Ds:	Not Reported
Dpl:	Not Reported	Dsv:	Not Reported
Appvar:	Not Reported	Scs:	1
Scsv:	0	Scp:	0
Sca:	0	Watlev:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Watlevdate:	09/06/2005	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	boring 20-2 7 bentonite	2-0	1 cement
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	0	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowld:	Not Reported	Wtpump:	0
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	Not Reported
Welltestdr:	Not Reported	Welltesthr:	Not Reported
Watqualund:	0	Watqualu 1:	1
Watertype:	Not Reported	Stratdepth:	Not Reported
Chemanaly:	0	Chemanaln:	1
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	W.E.S.T. Drilling
Drlicno:	54894	Compstreet:	101 Industrial Drive
Compcity:	Waxahachie	Compstate:	TX
Compzip:	75165	Drillernam:	James Spaniel
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

H39
SE
1/2 - 1 Mile
Lower

TX WELLS TXMON1000094626

Source Agency:	Texas Water Development Board		
Trackno:	153498	Dateentere:	09/16/2008
Ownname:	Mr. Robert Zazula American Bus. Lending		
Ownstreet:	1420 W. Mockingbird Lane S.380		
Owncity:	Dallas	Ownstate:	TX
Ownzip:	75247	County:	Navarro
Wellstreet:	801 S. 7th Street		
Wellcity:	Corsicana	Wellzip:	75110
Own:	B-1	Latitude:	320520
Lat dec:	32.088888		
Longitude:	962721		
Long dec:	-96.455833		
Elev:	493	Brandmodel:	garmin
Gn:	33612	Gn1:	33
Gn75:	61	Gn25:	2
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	0
Ue:	1	Ud:	0
Uin:	0	Uir:	0
Ug:	0	Uij:	0
Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	09/16/2008	Datecomp:	09/16/2008
Dia1:	7.25	Dia1to:	20
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0-8 fill sand and gravel dr br 8-20 tan clay		
Dmdriven:	0	Dmairrotar:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Dmmudrotar:	0	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	1
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	0
Bcgs:	Not Reported	Bcu:	0
Bcoc:	1	Bcot:	3/8 bentonite chips
Gpf:	Not Reported	Gpt:	Not Reported
Case Screen:	boring		
Cemfrom1:	20	Cemto1:	2
Nosacks1:	7 bentonite	Cemfrom2:	2
Cemto2:	0	Nosacks2:	1 cement
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	gravity
Cementby:	W.E.S.T.	Ds:	Not Reported
Dpl:	Not Reported	Dsv:	Not Reported
Appvar:	Not Reported	Scs:	1
Scsv:	0	Scp:	0
Sca:	0	Watlev:	Not Reported
Watlevdate:	09/06/2005	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	boring	20-2	7 bentonite
Tpturbine:	0	2-0	1 cement
Tpsubmersi:	0	Tpjct:	0
Tpothcrk:	0	Tpcylinder:	0
Pumpbowld:	Not Reported	Tpothcr:	Not Reported
Wtbailer:	0	Wtpump:	0
Wtestimate:	0	Wtjcted:	0
Welltestdr:	Not Reported	Welltestyi:	Not Reported
Watqualund:	0	Welltesthr:	Not Reported
Watertype:	Not Reported	Watqualu 1:	1
Chemanaly:	0	Stratdepth:	Not Reported
Undnatural:	0	Chemanaln:	1
Undhydro:	0	Untype:	Not Reported
Undotherck:	0	Undhaz:	0
Undother:	Not Reported		
Undcertify:	0	Compname:	W.E.S.T. Drilling
Drlicno:	54894	Compstreet:	101 Industrial Drive
Compcity:	Waxahachie	Compstate:	TX
Compzip:	75165	Drillernam:	James Spaniel
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

40
WSW
1/2 - 1 Mile
Higher

TX WELLS TXMON1000094622

Source Agency:	Texas Water Development Board		
Trackno:	92321	Dateentere:	09/11/2006
Ownname:	Katherine Zack		
Ownstreet:	602 Mills Place		
Owncity:	Corsicana	Ownstate:	TX
Ownzip:	75110	County:	Navarro
Wellstreet:	602 Mills Place		
Wellcity:	Corsicana	Wellzip:	75110
Own:	1	Latitude:	320519
Lat dec:	32.08861		
Longitude:	962827		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Long dec:	-96.474166	Brandmodel:	Magellan
Elev:	493	Gn1:	33
Gn:	33611	Gn25:	1
Gn75:	61	Twd:	0
Twn:	1	Twrp:	0
Twr:	0	Um:	0
Twrg:	0	Ud:	1
Ue:	0	Uir:	0
Uin:	0	Uij:	0
Ug:	0	Udw:	0
Up:	0	Us:	0
Ut:	0	Pbn:	0
Pby:	0	Datecomp:	08/20/2006
Datestart:	07/29/2006	Dia1to:	70
Dia1:	10 5/8	Dia2from:	Not Reported
Dia2:	Not Reported	Dia3:	Not Reported
Dia2to:	Not Reported	Dia3to:	Not Reported
Dia3from:	Not Reported		
Lith log:	0 to 3' topsoil 3' to 25' yellow clay 25' to 26' yellow sand 26' to 66' blue sand 66' to 70' blue shale		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	1	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	0
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	1
Bcgs:	12/20	Bcu:	0
Bcoc:	0	Bcot:	Not Reported
Gpf:	10	Gpt:	70
Case Screen:	4" N SDR 17 BLANK	0 TO 20' 4" N	SDR 17
	SLOTTED 20' TO 70' .0020		
Cemfrom1:	0	Cemto1:	10
Nosacks1:	15 SACK CRETE	Cemfrom2:	Not Reported
Cemto2:	Not Reported	Nosacks2:	Not Reported
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	POURED
Cementby:	CURTIS MCNEESE	Ds:	CITY SEWER
Dpl:	60	Dsv:	MEASURED
Appvar:	Not Reported	Scs:	0
Scsv:	1	Scp:	0
Sca:	0	Watlev:	20
Watlevdate:	08/11/2006	Artflow:	Not Reported
Packers:	NA		
Wellplug48:	0		
Wptext:	NA		
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	1	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowldc:	65	Wtpump:	1
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	10
Welltestdr:	20	Welltestthr:	24
Watqualund:	0	Watqualu 1:	1
Watertype:	FRESH	Stratdepth:	50
Chemanaly:	0	Chemanaln:	1
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	MCNEESE DRILLING CO
Drlicno:	52692	Compstreet:	14241 NE CR 3170A

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Compcity:	KERENS	Compstate:	TX
Compzip:	75144	Drillernam:	CURTIS MCNEESE
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

41
West
1/2 - 1 Mile
Higher

TX WELLS TXMON1000094694

Source Agency:	Texas Water Development Board		
Trackno:	105555	Dateentere:	03/01/2007
Ownname:	Don Dunbar .jr		
Ownstreet:	605MILLS PLACE		
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75110	County:	Navarro
Wellstreet:	605 MILLS PLACE		
Wellcity:	CORSICANA	Wellzip:	75110
Own:	1	Latitude:	320532
Lat dec:	32.092221		
Longitude:	962840		
Long dec:	-96.477777		
Elev:	447	Brandmodel:	GARMIN
Gn:	33611	Gn1:	33
Gn75:	61	Gn25:	1
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	0
Ue:	0	Ud:	0
Uin:	0	Uir:	1
Ug:	0	Uij:	0
Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	02/06/2007	Datecomp:	02/18/2007
Dia1:	11 1/4	Dia1to:	60
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0 TO 10 CLAY 10 TO 20 YELLOW SAND 20 TO30 SAME 30 TO 40 BLUE SAND 40 TO 50 BLUE SAND SAND STONE 50 TO 56 SAND STONE GRAVEL 56 TO 58 BLUE SAND 58 TO 60 BLUE CLAY/ BLUE SHALE		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	1	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	0
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	1
Bcgs:	12/20	Bcu:	0
Bcoc:	0	Bcot:	Not Reported
Gpf:	10	Gpt:	60
Case Screen:	4" N SDR 17 BLANK 0/10 4" N SDR 17 SLOTTED		
	10/50 .002 4" N SDR 17 BLANK		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Cemfrom1:	0	Cemto1:	10
Nosacks1:	15 SACK CRETE	Cemfrom2:	Not Reported
Cemto2:	Not Reported	Nosacks2:	Not Reported
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	POURED
Cementby:	CURTIS MCNEESE	Ds:	N/A
Dpl:	20	Dsv:	MEASURED
Appvar:	Not Reported	Scs:	0
Scsv:	1	Scp:	0
Sca:	0	Watlev:	25
Watlevdate:	02/18/2007	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	Not Reported		
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	1	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowld:	57	Wtpump:	1
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	10
Welltestdr:	10	Welltesthr:	24
Watqualund:	0	Watqualu 1:	1
Watertype:	FRESH	Stratdepth:	50
Chemanaly:	0	Chemanaln:	1
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	MCNEESE DRILLING CO.
Drillico:	52692	Compstreet:	14241 NE CR 3170A
Compcity:	KERENS	Compstate:	TX
Compzip:	75144	Drillernam:	CURTIS MCNEESE
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

I42
West
1/2 - 1 Mile
Higher

TX WELLS TXMON1000094721

Source Agency:	Texas Water Development Board		
Trackno:	105557	Dateentere:	03/01/2007
Ownname:	WAYNE NELSON		
Ownstreet:	1115 MILLS PLACE		
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75110	County:	Navarro
Wellstreet:	1115 MILLS PLACE		
Wellcity:	CORSICANA	Wellzip:	75110
Own:	1	Latitude:	320537
Lat dec:	32.09361		
Longitude:	962841		
Long dec:	-96.478054		
Elev:	454	Brandmodel:	GARMIN
Gn:	33611	Gn1:	33
Gn75:	61	Gn25:	1
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	0
Ue:	0	Ud:	0
Uin:	0	Uir:	1
Ug:	0	Uij:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	01/05/2007	Datecomp:	02/04/2007
Dia1:	11 1/4	Dia1to:	70
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0 TO 3 TOP SOIL 3 TO 10 YELLOW CLAY 10 TO 20 YELLOW CLAY/ YELLOW SAND 20 TO 68 BLUE SAND 68 TO 70 BLUE CLAY/BLUE SHALE		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	1	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	0
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	1
Bcgs:	12/20	Bcu:	0
Bcoc:	0	Bcot:	Not Reported
Gpf:	10	Gpt:	70
Case Screen:	4" N SDR 17 BLANK	0 TO 10 4" N	SDR 17 SLOTTED
	10 TO 70		
Cemfrom1:	0	Cemto1:	20
Nosacks1:	20 SACK CRETE	Cemfrom2:	Not Reported
Cemto2:	Not Reported	Nosacks2:	Not Reported
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	POURED
Cementby:	CURTIS MCNEESE	Ds:	Not Reported
Dpl:	10	Dsv:	MEASURED
Appvar:	Not Reported	Scs:	0
Scsv:	1	Scp:	0
Sca:	0	Watlev:	25
Watlevdate:	02/04/2007	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	Not Reported		
Tpturbine:	0	Tpjett:	0
Tpsubmersi:	1	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowldc:	67	Wtpump:	1
Wtbailer:	0	Wtjettcd:	0
Wtestimate:	0	Welltestyi:	3
Welltestdr:	65	Welltesthr:	1
Watqualund:	0	Watqualu 1:	1
Watertype:	FRESH	Stratdepth:	50
Chemanaly:	0	Chemanaln:	1
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	MCNEESE DRILLING CO.
Drlicno:	52692	Compstreet:	14241 NE CR 3170A
Compcity:	KERENS	Compstate:	TX
Compzip:	75144	Drillernam:	CURTIS MCNEESE
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

J43
West
1/2 - 1 Mile
Higher

TX WELLS TXMON1000094670

Source Agency:	Texas Water Development Board		
Trackno:	103172	Dateentere:	01/28/2007
Ownname:	MARIAN WHEELLOCK		
Ownstreet:	516 MILLS PLACE		
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75110	County:	Navarro
Wellstreet:	516 MILLS PLACE		
Wellcity:	CORSICANA	Wellzip:	75110
Own:	1	Latitude:	320529
Lat dec:	32.091388		
Longitude:	962844		
Long dec:	-96.478888		
Elev:	474	Brandmodel:	GARMIN
Gn:	33611	Gn1:	33
Gn75:	61	Gn25:	1
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	0
Ue:	0	Ud:	1
Uin:	0	Uir:	0
Ug:	0	Uij:	0
Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	12/30/2006	Datecomp:	01/12/2007
Dia1:	12 1/4	Dia1to:	70
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0 TO 3' TOPSOIL 3' TO 25' YELLOW CLAY 25' TO 26' YELLOW SAND 26' TO 66' BLUE SAND 66' TO 70 BLUE SHALE		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	1	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	0
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	1
Bcgs:	12/20	Bcu:	0
Bcoc:	0	Bcot:	Not Reported
Gpf:	10	Gpt:	70
Case Screen:	4" N SDR 17 BLANK 0 TO 10' 4" N SDR 17 SCREENED 10' TO 70' .0020		
Cemfrom1:	0	Cemto1:	10
Nosacks1:	15 SACK CRETE	Cemfrom2:	Not Reported
Cemto2:	Not Reported	Nosacks2:	Not Reported
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	POURED
Cementby:	CURTIS MCNEESE	Ds:	CITY SEWER
Dpl:	60	Dsv:	MEASURED
Appvar:	Not Reported	Scs:	0
Scsv:	1	Scp:	0
Sca:	0	Watlev:	25

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Watlevdate:	01/12/2007	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	Not Reported		
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	1	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowldc:	65	Wtpump:	1
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	8
Welltestdr:	40	Welltesthr:	24
Watqualund:	0	Watqualu 1:	1
Watertype:	FRESH	Stratdepth:	45
Chemanaly:	0	Chemanaln:	1
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	MCNEESE DRILLING CO.
Drllcno:	52692	Compstreet:	14241 NE CR 3170A
Compcity:	KERENS	Compstate:	TX
Compzip:	75144	Drillernam:	CURTIS MCNEESE
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

I44
West
1/2 - 1 Mile
Higher

TX WELLS TXMON1000094714

Source Agency:	Texas Water Development Board		
Trackno:	106891	Dateentere:	03/19/2007
Ownname:	ED ERWN		
Ownstreet:	1250 MILLS PLACE		
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75110	County:	Navarro
Wellstreet:	1250 MILLS PLACE		
Wellcity:	CORISCANS	Wellzip:	75110
Own:	1	Latitude:	320536
Lat dec:	32.093333		
Longitude:	962845		
Long dec:	-96.479166		
Elev:	381	Brandmodel:	GARMIN
Gn:	33611	Gn1:	33
Gn75:	61	Gn25:	1
Twn:	1	Twd:	0
Twr:	0	Twrp:	0
Twrg:	0	Um:	0
Ue:	0	Ud:	0
Uin:	0	Uir:	1
Ug:	0	Uij:	0
Up:	0	Udw:	0
Ut:	0	Us:	0
Pby:	0	Pbn:	0
Datestart:	02/16/2007	Datecomp:	03/04/2007
Dia1:	11 1/4	Dia1to:	60
Dia2:	Not Reported	Dia2from:	Not Reported
Dia2to:	Not Reported	Dia3:	Not Reported
Dia3from:	Not Reported	Dia3to:	Not Reported
Lith log:	0 TO 10 TOP SOIL 10 TO 18 YELLOW CLAY SAND 18 TO 56 BLUE WHITE SAND 56 TO 60 ROCK		
Dmdriven:	0	Dmairrotar:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Dmmudrotar:	1	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	0
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	1
Bcgs:	12/20	Bcu:	0
Bcoc:	0	Bcot:	Not Reported
Gpf:	60	Gpt:	16
Case Screen:	4 . N BLANK PIPE SDR 17 0 TO 18 4	N SDR .17	
	screen .18 to60		
Cemfrom1:	0	Cemto1:	18
Nosacks1:	15	Cemfrom2:	0
Cemto2:	18	Nosacks2:	Not Reported
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	poured
Cementby:	curtis mcneese	Ds:	none
Dpl:	10	Dsv:	measure
Appvar:	Not Reported	Scs:	0
Scsv:	1	Scp:	0
Sca:	0	Watlev:	20
Watlevdate:	03/07/2007	Artflow:	Not Reported
Packers:	N/A		
Wellplug48:	0		
Wptext:	Not Reported		
Tpturbine:	0	Tpjett:	0
Tpsubmersi:	1	Tpcylinder:	0
Tpothetck:	0	Tpothet:	Not Reported
Pumpbowld:	56	Wtpump:	1
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	8
Welltestdr:	20	Welltestthr:	1
Watqualund:	0	Watqualu 1:	1
Watertype:	FRESH	Stratdepth:	18 TO 60
Chemanaly:	0	Chemanaln:	1
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	MCNEESE DRILLING CO.
Drlicno:	52692	Compstreet:	14241 NE CR 3170A
Compcity:	KERENS	Compstate:	TX
Compzip:	75144	Drillernam:	CURTIS MCNEESE
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

J45
WSW
1/2 - 1 Mile
Higher

TX WELLS TXMON1000094655

Source Agency:	Texas Water Development Board		
Trackno:	121490	Dateentere:	09/04/2007
Ownname:	RON SHAW		
Ownstreet:	1300 W 3RD AVENUE		
Owncity:	CORSICANA	Ownstate:	TX
Ownzip:	75110	County:	Navarro
Wellstreet:	1300 w 3RD AVENUE		
Wellcity:	CORSICANA	Wellzip:	75110
Own:	1	Latitude:	320525
Lat dec:	32.090277		
Longitude:	962845		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Long dec:	-96.479166	Brandmodel:	garmin
Elev:	636	Gn1:	33
Gn:	33611	Gn25:	1
Gn75:	61	Twd:	0
Twn:	1	Twrp:	0
Twr:	0	Um:	0
Twrg:	0	Ud:	1
Ue:	0	Uir:	0
Uin:	0	Uij:	0
Ug:	0	Udw:	0
Up:	0	Us:	0
Ut:	0	Pbn:	0
Pby:	0	Datecomp:	07/30/2007
Datestart:	06/28/2007	Dia1to:	60
Dia1:	10 1/4	Dia2from:	Not Reported
Dia2:	Not Reported	Dia3:	Not Reported
Dia2to:	Not Reported	Dia3to:	Not Reported
Dia3from:	Not Reported		
Lith log:	0 T 5 TOP SOIL 5 TO 20 YELLOW CLAY 20 TO 28 SAND AND YELLOW CLAY 28 TO 35 SAND 35 TO 44 CLAY AND SAND 44 TO 56 SAND AND GRAVEL MIX 56 TO 60 BLUE SHALE		
Dmdriven:	0	Dmairrotar:	0
Dmmudrotar:	1	Dmbored:	0
Dmairham:	0	Dmcabletoo:	0
Dmjetted:	0	Dmhollowst:	0
Dmrevcirc:	0	Dmotherck:	0
Dmother:	Not Reported	Bco:	0
Bcs:	0	Bcg:	1
Bcgs:	12/20	Bcu:	0
Bcoc:	0	Bcot:	Not Reported
Gpf:	20	Gpt:	60
Case Screen:	4 N SDR 17 CERTLOCK BLANK	0/20 4 N SDR 17 CERTLOCK SCREEN	020/60 .0020
Cemfrom1:	0	Cemto1:	20
Nosacks1:	20 SACK CRETE	Cemfrom2:	Not Reported
Cemto2:	Not Reported	Nosacks2:	Not Reported
Cemfrom3:	Not Reported	Cemto3:	Not Reported
Nosacks3:	Not Reported	Cementmeth:	poured
Cementby:	curtis mcneese	Ds:	CITY SEWER
Dpl:	30	Dsv:	ESTIMATED
Appvar:	Not Reported	Scs:	1
Scsv:	0	Scp:	0
Sca:	0	Watlev:	25
Watlevdate:	07/30/2007	Artflow:	Not Reported
Packers:	Not Reported		
Wellplug48:	0		
Wptext:	Not Reported		
Tpturbine:	0	Tpjet:	0
Tpsubmersi:	1	Tpcylinder:	0
Tpothcrk:	0	Tpothcr:	Not Reported
Pumpbowld:	52	Wtpump:	1
Wtbailer:	0	Wtjetted:	0
Wtestimate:	0	Welltestyi:	10
Welltestdr:	20	Welltesthr:	24
Watqualund:	0	Watqualu 1:	1
Watertype:	FRESH	Stratdepth:	37
Chemanaly:	0	Chemanaln:	1
Undnatural:	0	Untype:	Not Reported
Undhydro:	0	Undhaz:	0
Undotherck:	0		
Undother:	Not Reported		
Undcertify:	0	Compname:	MCNEESE DRILLING CO.
Drlicno:	52692	Compstreet:	14241 NE CR 3170A

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Compcity:	KERENS	Compstate:	TX
Compzip:	75144	Drillernam:	CURTIS MCNEESE
Traineenam:	Not Reported	Tnum:	Not Reported
Comments 1:	Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

1

North

1/8 - 1/4 Mile

OIL_GAS

TXOG40000576995

Surface id: 1051192
Well Type: Canceled Location
Reliab: Mainframe WELLBORE Distances
Longn: -96.46298891
Latn: 32.09562782
Site id: TXOG40000576995

Api:

34932377

Surface id: 1051192
Well Type: Canceled Location
Out fips: N
Cwellnum: 03
Longn: -96.46298891
Latn: 32.09562782

Apinum:

4234932377

Reliab:

Mainframe WELLBORE Distances

Radioact:

Not Reported

2

ESE

1/8 - 1/4 Mile

OIL_GAS

TXOG40000575575

Surface id: 639074
Well Type: Dry Hole
Reliab: Field Inspection by RRC personnel (distances and/or plat).
Longn: -96.46022869
Latn: 32.09227061
Site id: TXOG40000575575

Api:

34983617

Surface id: 639074
Well Type: Dry Hole
Out fips: N
Cwellnum: ?
Longn: -96.4602287
Latn: 32.0922706

Apinum:

4234983617

Reliab:

Field Inspection by RRC personnel (distances and/or plat).

Radioact:

Not Reported

3

NNE

1/8 - 1/4 Mile

OIL_GAS

TXOG40000577220

Surface id: 1076045
Well Type: Plugged Oil Well
Reliab: Spotted from RRC Hardcopy Map
Longn: -96.461576
Latn: 32.09624155
Site id: TXOG40000577220

Api:

34983664

Surface id: 1076045
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: A
Longn: -96.461576
Latn: 32.09624155

Apinum:

4234983664

Reliab:

Spotted from RRC Hardcopy Map

Radioact:

Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

4

SE

1/8 - 1/4 Mile

OIL_GAS

TXOG40000575081

Surface id: 639093
Well Type: Plugged Oil Well Api: 34983620
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.46061912
Latn: 32.09080908
Site id: TXOG40000575081

Surface id: 639093
Well Type: Plugged Oil Well Apinum: 4234983620
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4606191
Latn: 32.0908091

5

South

1/4 - 1/2 Mile

OIL_GAS

TXOG40000574701

Surface id: 638385
Well Type: Oil Well Api: 34980206
Reliab: RRC Hardcopy Map
Longn: -96.4636206
Latn: 32.08972862
Site id: TXOG40000574701

Surface id: 638385
Well Type: Oil Well Apinum: 4234980206
Out fips: N Reliab: RRC Hardcopy Map
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4636206
Latn: 32.0897286

6

WNW

1/4 - 1/2 Mile

OIL_GAS

TXOG40000576989

Surface id: 1078529
Well Type: Plugged Oil Well Api: 34902226
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.46736189
Latn: 32.09561198
Site id: TXOG40000576989

Surface id: 1078529
Well Type: Plugged Oil Well Apinum: 4234902226
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.46736189
Latn: 32.09561198

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

A7
NNW
1/4 - 1/2 Mile

OIL_GAS TXOG40000577844

Surface id: 1102379
Well Type: Plugged Oil Well
Reliab: Coordinate (operator reported).
Longn: -96.46453338
Latn: 32.09771663
Site id: TXOG40000577844

Api: 34983128

Surface id: 1102379
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.46453338
Latn: 32.09771663

Apinum: 4234983128
Reliab: Coordinate (operator reported).
Radioact: Not Reported

A8
NNW
1/4 - 1/2 Mile

OIL_GAS TXOG40000578071

Surface id: 1115981
Well Type: Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.46544291
Latn: 32.09822817
Site id: TXOG40000578071

Api: 34983714

Surface id: 1115981
Well Type: Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.46544291
Latn: 32.09822817

Apinum: 4234983714
Reliab: RRC Hardcopy Map
Radioact: Not Reported

9
NE
1/4 - 1/2 Mile

OIL_GAS TXOG40000577501

Surface id: 1083724
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45885107
Latn: 32.09685102
Site id: TXOG40000577501

Api: 34902251

Surface id: 1083724
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.45885107
Latn: 32.09685102

Apinum: 4234902251
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

**B10
NW**

1/4 - 1/2 Mile

OIL_GAS

TXOG40000577445

Surface id: 1078530
Well Type: Oil Well Api: 34902224
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.46803986
Latn: 32.09673867
Site id: TXOG40000577445

Surface id: 1078530
Well Type: Oil Well Apinum: 4234902224
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.46803986
Latn: 32.09673867

**C11
ENE**

1/4 - 1/2 Mile

OIL_GAS

TXOG40000577061

Surface id: 639097
Well Type: Plugged Oil Well Api: 34983659
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45784339
Latn: 32.09583426
Site id: TXOG40000577061

Surface id: 639097
Well Type: Plugged Oil Well Apinum: 4234983659
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.45784339
Latn: 32.09583426

**D12
East**

1/4 - 1/2 Mile

OIL_GAS

TXOG40000576240

Surface id: 639078
Well Type: Plugged Oil Well Api: 34983581
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45711623
Latn: 32.09392899
Site id: TXOG40000576240

Surface id: 639078
Well Type: Plugged Oil Well Apinum: 4234983581
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4571162
Latn: 32.093929

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

D13
ENE

1/4 - 1/2 Mile

OIL_GAS

TXOG40000576606

Surface id: 639098
Well Type: Plugged Oil Well Api: 34983575
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45714277
Latn: 32.09474807
Site id: TXOG40000576606

Surface id: 639098
Well Type: Plugged Oil Well Apinum: 4234983575
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4571428
Latn: 32.0947481

E14
ESE

1/4 - 1/2 Mile

OIL_GAS

TXOG40000575353

Surface id: 639077
Well Type: Plugged Oil Well Api: 34983517
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45690474
Latn: 32.0916059
Site id: TXOG40000575353

Surface id: 639077
Well Type: Plugged Oil Well Apinum: 4234983517
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4569047
Latn: 32.0916059

15
ENE

1/4 - 1/2 Mile

OIL_GAS

TXOG40000576734

Surface id: 1148555
Well Type: Dry Hole Api: 34983727
Reliab: Coordinates - (RRC personnel reported)
Longn: -96.45665558
Latn: 32.09504726
Site id: TXOG40000576734

Surface id: 1148555
Well Type: Dry Hole Apinum: 4234983727
Out fips: N Reliab: Coordinates - (RRC personnel reported)
Cwellnum: A Radioact: Not Reported
Longn: -96.45665558
Latn: 32.09504726

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

B16

NW

1/4 - 1/2 Mile

OIL_GAS

TXOG40000577815

Surface id: 1078531
Well Type: Oil Well Api: 34902225
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.46852427
Latn: 32.097629
Site id: TXOG40000577815

Surface id: 1078531
Well Type: Oil Well Apinum: 4234902225
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.46852427
Latn: 32.097629

C17

ENE

1/4 - 1/2 Mile

OIL_GAS

TXOG40000577154

Surface id: 639082
Well Type: Dry Hole Api: 34983568
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45672275
Latn: 32.09607949
Site id: TXOG40000577154

Surface id: 639082
Well Type: Dry Hole Apinum: 4234983568
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4567227
Latn: 32.0960795

D18

East

1/4 - 1/2 Mile

OIL_GAS

TXOG40000576022

Surface id: 1097164
Well Type: Dry Hole Api: 34983696
Reliab: Coordinates - (RRC personnel reported)
Longn: -96.45593338
Latn: 32.09336663
Site id: TXOG40000576022

Surface id: 1097164
Well Type: Dry Hole Apinum: 4234983696
Out fips: N Reliab: Coordinates - (RRC personnel reported)
Cwellnum: 1 Radioact: Not Reported
Longn: -96.45593338
Latn: 32.09336663

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

C19

ENE

1/4 - 1/2 Mile

OIL_GAS

TXOG40000577187

Surface id: 639083
Well Type: Dry Hole Api: 34983573
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45658488
Latn: 32.09615655
Site id: TXOG40000577187

Surface id: 639083
Well Type: Dry Hole Apinum: 4234983573
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4565849
Latn: 32.0961565

E20

ESE

1/4 - 1/2 Mile

OIL_GAS

TXOG40000575479

Surface id: 1076046
Well Type: Plugged Oil Well Api: 34983663
Reliab: Spotted from RRC Hardcopy Map
Longn: -96.45597976
Latn: 32.09197855
Site id: TXOG40000575479

Surface id: 1076046
Well Type: Plugged Oil Well Apinum: 4234983663
Out fips: N Reliab: Spotted from RRC Hardcopy Map
Cwellnum: 1 Radioact: Not Reported
Longn: -96.45597976
Latn: 32.09197855

F21

ENE

1/4 - 1/2 Mile

OIL_GAS

TXOG40000577505

Surface id: 639081
Well Type: Plugged Oil Well Api: 34902130
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.456902
Latn: 32.09686022
Site id: TXOG40000577505

Surface id: 639081
Well Type: Plugged Oil Well Apinum: 4234902130
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.456902
Latn: 32.0968602

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

22
NE
1/4 - 1/2 Mile

OIL_GAS TXOG40000577901

Surface id: 639027
Well Type: Plugged Oil Well
Reliab: Field Inspection by RRC personnel (distances and/or plat).
Longn: -96.45762923
Latn: 32.09785507
Site id: TXOG40000577901

Api: 34983647

Surface id: 639027
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: ?
Longn: -96.4576292
Latn: 32.0978551

Apinum: 4234983647
Reliab: Field Inspection by RRC personnel (distances and/or plat).
Radioact: Not Reported

23
NNW
1/4 - 1/2 Mile

OIL_GAS TXOG40000578692

Surface id: 1078533
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.46591795
Latn: 32.09968703
Site id: TXOG40000578692

Api: 34983253

Surface id: 1078533
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.46591795
Latn: 32.09968703

Apinum: 4234983253
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

F24
ENE
1/4 - 1/2 Mile

OIL_GAS TXOG40000577382

Surface id: 1076032
Well Type: Plugged Oil Well
Reliab: Spotted from RRC Hardcopy Map
Longn: -96.45644011
Latn: 32.09659669
Site id: TXOG40000577382

Api: 34983662

Surface id: 1076032
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: B
Longn: -96.45644011
Latn: 32.09659669

Apinum: 4234983662
Reliab: Spotted from RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

F25

NE

1/4 - 1/2 Mile

OIL_GAS

TXOG40000577866

Surface id: 639084
Well Type: Dry Hole Api: 34983570
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45732282
Latn: 32.09776828
Site id: TXOG40000577866

Surface id: 639084
Well Type: Dry Hole Apinum: 4234983570
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4573228
Latn: 32.0977683

F26

ENE

1/4 - 1/2 Mile

OIL_GAS

TXOG40000577396

Surface id: 1076031
Well Type: Plugged Oil Well Api: 34983661
Reliab: Spotted from RRC Hardcopy Map
Longn: -96.4563917
Latn: 32.09662424
Site id: TXOG40000577396

Surface id: 1076031
Well Type: Plugged Oil Well Apinum: 4234983661
Out fips: N Reliab: Spotted from RRC Hardcopy Map
Cwellnum: A Radioact: Not Reported
Longn: -96.4563917
Latn: 32.09662424

G27

NNE

1/4 - 1/2 Mile

OIL_GAS

TXOG40000578956

Surface id: 1115821
Well Type: Oil Well Api: 34983712
Reliab: Operator reported location (distances and plat).
Longn: -96.46095016
Latn: 32.10027086
Site id: TXOG40000578956

Surface id: 1115821
Well Type: Oil Well Apinum: 4234983712
Out fips: N Reliab: Operator reported location (distances and plat).
Cwellnum: 1 Radioact: Not Reported
Longn: -96.46095016
Latn: 32.10027086

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

H28
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000576735

Surface id: 639096
Well Type: Plugged Oil Well Api: 34983572
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45490295
Latn: 32.09505254
Site id: TXOG40000576735

Surface id: 639096
Well Type: Plugged Oil Well Apinum: 4234983572
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4549029
Latn: 32.0950525

F29
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000577553

Surface id: 1124760
Well Type: Plugged Oil Well Api: 34983721
Reliab: Coordinates - (RRC personnel reported)
Longn: -96.45563894
Latn: 32.09698066
Site id: TXOG40000577553

Surface id: 1124760
Well Type: Plugged Oil Well Apinum: 4234983721
Out fips: N Reliab: Coordinates - (RRC personnel reported)
Cwellnum: A Radioact: Not Reported
Longn: -96.45563894
Latn: 32.09698066

I30
ESE
1/2 - 1 Mile

OIL_GAS TXOG40000575024

Surface id: 639079
Well Type: Plugged Oil Well Api: 34983626
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.4551864
Latn: 32.09066373
Site id: TXOG40000575024

Surface id: 639079
Well Type: Plugged Oil Well Apinum: 4234983626
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4551864
Latn: 32.0906637

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

H31
East
1/2 - 1 Mile

OIL_GAS TXOG40000576566

Surface id: 1115816
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45462653
Latn: 32.09464832
Site id: TXOG40000576566

Api: 34983711

Surface id: 1115816
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.45462653
Latn: 32.09464832

Apinum: 4234983711
Reliab: RRC Hardcopy Map
Radioact: Not Reported

I32
ESE
1/2 - 1 Mile

OIL_GAS TXOG40000575108

Surface id: 639080
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.454927
Latn: 32.09088654
Site id: TXOG40000575108

Api: 34983625

Surface id: 639080
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.454927
Latn: 32.0908865

Apinum: 4234983625
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

G33
NNE
1/2 - 1 Mile

OIL_GAS TXOG40000579072

Surface id: 639099
Well Type: Dry Hole
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45964373
Latn: 32.10050597
Site id: TXOG40000579072

Api: 34983557

Surface id: 639099
Well Type: Dry Hole
Out fips: N
Cwellnum: 1
Longn: -96.4596437
Latn: 32.100506

Apinum: 4234983557
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

H34
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000576749

Surface id: 1058270
Well Type: Plugged Oil Well Api: 34983658
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.4544633
Latn: 32.09507968
Site id: TXOG40000576749

Surface id: 1058270
Well Type: Plugged Oil Well Apinum: 4234983658
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: A Radioact: Not Reported
Longn: -96.4544633
Latn: 32.09507968

J35
East
1/2 - 1 Mile

OIL_GAS TXOG40000575616

Surface id: 639085
Well Type: Plugged Oil Well Api: 34983598
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45404221
Latn: 32.09239292
Site id: TXOG40000575616

Surface id: 639085
Well Type: Plugged Oil Well Apinum: 4234983598
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4540422
Latn: 32.0923929

36
NE
1/2 - 1 Mile

OIL_GAS TXOG40000578573

Surface id: 634896
Well Type: Oil Well Api: 34983376
Reliab: RRC Hardcopy Map
Longn: -96.45707512
Latn: 32.09940811
Site id: TXOG40000578573

Surface id: 634896
Well Type: Oil Well Apinum: 4234983376
Out fips: N Reliab: RRC Hardcopy Map
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4570751
Latn: 32.0994081

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

I37
ESE
1/2 - 1 Mile

OIL_GAS TXOG40000574915

Surface id: 1115922
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45416239
Latn: 32.09030439
Site id: TXOG40000574915

Api: 34983713

Surface id: 1115922
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.45416239
Latn: 32.09030439

Apinum: 4234983713
Reliab: RRC Hardcopy Map
Radioact: Not Reported

K38
North
1/2 - 1 Mile

OIL_GAS TXOG40000579662

Surface id: 634717
Well Type: Permitted Location
Reliab: RRC Hardcopy Map
Longn: -96.46246631
Latn: 32.10193261
Site id: TXOG40000579662

Api: 34981943

Surface id: 634717
Well Type: Permitted Location
Out fips: N
Cwellnum: 1A
Longn: -96.4624663
Latn: 32.1019326

Apinum: 4234981943
Reliab: RRC Hardcopy Map
Radioact: Not Reported

39
NNE
1/2 - 1 Mile

OIL_GAS TXOG40000579403

Surface id: 1058269
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45905862
Latn: 32.1012573
Site id: TXOG40000579403

Api: 34983660

Surface id: 1058269
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: A
Longn: -96.45905862
Latn: 32.1012573

Apinum: 4234983660
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

J40
ESE
1/2 - 1 Mile

OIL_GAS TXOG40000575378

Surface id: 639086
Well Type: Dry Hole Api: 34983574
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45335052
Latn: 32.09167267
Site id: TXOG40000575378

Surface id: 639086
Well Type: Dry Hole Apinum: 4234983574
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4533505
Latn: 32.0916727

41
NE
1/2 - 1 Mile

OIL_GAS TXOG40000579100

Surface id: 639092
Well Type: Dry Hole Api: 34983627
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45707777
Latn: 32.10057785
Site id: TXOG40000579100

Surface id: 639092
Well Type: Dry Hole Apinum: 4234983627
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: ? Radioact: Not Reported
Longn: -96.4570778
Latn: 32.1005779

L42
NNW
1/2 - 1 Mile

OIL_GAS TXOG40000579651

Surface id: 638386
Well Type: Oil Well Api: 34980233
Reliab: RRC Hardcopy Map
Longn: -96.46670166
Latn: 32.10191528
Site id: TXOG40000579651

Surface id: 638386
Well Type: Oil Well Apinum: 4234980233
Out fips: N Reliab: RRC Hardcopy Map
Cwellnum: 3 Radioact: Not Reported
Longn: -96.4667017
Latn: 32.1019153

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

43
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000577002

Surface id: 1081686
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances and plat).
Longn: -96.45305038
Latn: 32.09565276
Site id: TXOG40000577002

Api: 34983516

Surface id: 1081686
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.45305038
Latn: 32.09565276

Apinum: 4234983516
Reliab: Operator reported location (distances and plat).
Radioact: Not Reported

44
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000577718

Surface id: 1076047
Well Type: Plugged Oil Well
Reliab: Spotted from RRC Hardcopy Map
Longn: -96.45379757
Latn: 32.09739909
Site id: TXOG40000577718

Api: 34983665

Surface id: 1076047
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: A
Longn: -96.45379757
Latn: 32.09739909

Apinum: 4234983665
Reliab: Spotted from RRC Hardcopy Map
Radioact: Not Reported

45
NE
1/2 - 1 Mile

OIL_GAS TXOG40000578583

Surface id: 639089
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45533806
Latn: 32.09943658
Site id: TXOG40000578583

Api: 34983374

Surface id: 639089
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.4553381
Latn: 32.0994366

Apinum: 4234983374
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

K46
North
1/2 - 1 Mile

OIL_GAS TXOG40000579897

Surface id: 638728
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.46192975
Latn: 32.10249195
Site id: TXOG40000579897

Api: 34981944

Surface id: 638728
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 2
Longn: -96.4619297
Latn: 32.102492

Apinum: 4234981944
Reliab: RRC Hardcopy Map
Radioact: Not Reported

M47
ESE
1/2 - 1 Mile

OIL_GAS TXOG40000575082

Surface id: 634893
Well Type: Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45302872
Latn: 32.09080911
Site id: TXOG40000575082

Api: 34932376

Surface id: 634893
Well Type: Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.4530287
Latn: 32.0908091

Apinum: 4234932376
Reliab: RRC Hardcopy Map
Radioact: Not Reported

L48
NNW
1/2 - 1 Mile

OIL_GAS TXOG40000579919

Surface id: 634674
Well Type: Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.46633379
Latn: 32.10254279
Site id: TXOG40000579919

Api: 34932523

Surface id: 634674
Well Type: Oil Well
Out fips: N
Cwellnum: 2R
Longn: -96.4663338
Latn: 32.1025428

Apinum: 4234932523
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

K49
North
1/2 - 1 Mile

OIL_GAS TXOG40000580097

Surface id: 634716
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.46224433
Latn: 32.10302505
Site id: TXOG40000580097

Api: 349

Surface id: 634716
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.4622443
Latn: 32.1030251

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

N50
North
1/2 - 1 Mile

OIL_GAS TXOG40000580158

Surface id: 634715
Well Type: Dry Hole
Reliab: RRC Hardcopy Map
Longn: -96.46330056
Latn: 32.10316475
Site id: TXOG40000580158

Api: 34933746

Surface id: 634715
Well Type: Dry Hole
Out fips: N
Cwellnum: 1
Longn: -96.4633006
Latn: 32.1031647

Apinum: 4234933746
Reliab: RRC Hardcopy Map
Radioact: Not Reported

M51
ESE
1/2 - 1 Mile

OIL_GAS TXOG40000574809

Surface id: 634895
Well Type: Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45254921
Latn: 32.0899829
Site id: TXOG40000574809

Api: 34932607

Surface id: 634895
Well Type: Oil Well
Out fips: N
Cwellnum: 2
Longn: -96.4525492
Latn: 32.0899829

Apinum: 4234932607
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

N52
North
1/2 - 1 Mile

OIL_GAS TXOG40000580247

Surface id: 638729
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.46444128
Latn: 32.10344731
Site id: TXOG40000580247

Api: 34902346

Surface id: 638729
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.4644413
Latn: 32.1034473

Apinum: 4234902346
Reliab: RRC Hardcopy Map
Radioact: Not Reported

O53
NNW
1/2 - 1 Mile

OIL_GAS TXOG40000579886

Surface id: 1053736
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.46887886
Latn: 32.10246775
Site id: TXOG40000579886

Api: 349

Surface id: 1053736
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.46887886
Latn: 32.10246775

Apinum: 42349
Reliab: Operator reported location (distances without plat or plat without distances).
Radioact: Not Reported

P54
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000578178

Surface id: 639104
Well Type: Dry Hole
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45274915
Latn: 32.09850008
Site id: TXOG40000578178

Api: 34983650

Surface id: 639104
Well Type: Dry Hole
Out fips: N
Cwellnum: 1
Longn: -96.4527491
Latn: 32.0985001

Apinum: 4234983650
Reliab: Operator reported location (distances without plat or plat without distances).
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

O55
NNW
1/2 - 1 Mile

OIL_GAS TXOG40000580075

Surface id: 639073
Well Type: Dry Hole Api: 34980232
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.46818922
Latn: 32.10296571
Site id: TXOG40000580075

Surface id: 639073
Well Type: Dry Hole Apinum: 4234980232
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1U Radioact: Not Reported
Longn: -96.4681892
Latn: 32.1029657

Q56
NNW
1/2 - 1 Mile

OIL_GAS TXOG40000580187

Surface id: 634675
Well Type: Oil Well Api: 34980231
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.46739638
Latn: 32.10326013
Site id: TXOG40000580187

Surface id: 634675
Well Type: Oil Well Apinum: 4234980231
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4673964
Latn: 32.1032601

R57
NE
1/2 - 1 Mile

OIL_GAS TXOG40000579074

Surface id: 634897
Well Type: Dry Hole Api: 34983569
Reliab: RRC Hardcopy Map
Longn: -96.45425632
Latn: 32.1005103
Site id: TXOG40000579074

Surface id: 634897
Well Type: Dry Hole Apinum: 4234983569
Out fips: N Reliab: RRC Hardcopy Map
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4542563
Latn: 32.1005103

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

N58
North
1/2 - 1 Mile

OIL_GAS TXOG40000580450

Surface id: 1080721
Well Type: Plugged Oil Well
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Longn: -96.46359994
Latn: 32.10396143
Site id: TXOG40000580450

Api: 349

Surface id: 1080721
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.46359994
Latn: 32.10396143

Apinum: 42349
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Radioact: Not Reported

R59
NE
1/2 - 1 Mile

OIL_GAS TXOG40000579493

Surface id: 639087
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45488615
Latn: 32.1014797
Site id: TXOG40000579493

Api: 34983245

Surface id: 639087
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.4548862
Latn: 32.1014797

Apinum: 4234983245
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

60
ESE
1/2 - 1 Mile

OIL_GAS TXOG40000575031

Surface id: 634894
Well Type: Permitted Location
Reliab: RRC Hardcopy Map
Longn: -96.45104371
Latn: 32.09069229
Site id: TXOG40000575031

Api: 349

Surface id: 634894
Well Type: Permitted Location
Out fips: N
Cwellnum: Not Reported
Longn: -96.4510437
Latn: 32.0906923

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

S61
East
1/2 - 1 Mile

OIL_GAS TXOG40000576748

Surface id: 639088
Well Type: Plugged Oil Well Api: 34983168
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45076565
Latn: 32.09507888
Site id: TXOG40000576748

Surface id: 639088
Well Type: Plugged Oil Well Apinum: 4234983168
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4507657
Latn: 32.0950789

P62
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000578239

Surface id: 639095
Well Type: Plugged Oil Well Api: 34983571
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45217106
Latn: 32.09862906
Site id: TXOG40000578239

Surface id: 639095
Well Type: Plugged Oil Well Apinum: 4234983571
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4521711
Latn: 32.0986291

R63
NE
1/2 - 1 Mile

OIL_GAS TXOG40000579230

Surface id: 639076
Well Type: Plugged Oil Well Api: 34902158
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45399308
Latn: 32.10088039
Site id: TXOG40000579230

Surface id: 639076
Well Type: Plugged Oil Well Apinum: 4234902158
Out fips: N Reliab: Operator reported location (distances without plat or plat with
Cwellnum: 1 Radioact: Not Reported
Longn: -96.4539931
Latn: 32.1008804

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

64
ESE
1/2 - 1 Mile

OIL_GAS TXOG40000574412

Surface id: 634892
Well Type: Permitted Location
Reliab: RRC Hardcopy Map
Longn: -96.45170677
Latn: 32.08886109
Site id: TXOG40000574412

Api: 349

Surface id: 634892
Well Type: Permitted Location
Out fips: N
Cwellnum: 3
Longn: -96.4517068
Latn: 32.0888611

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

R65
NE
1/2 - 1 Mile

OIL_GAS TXOG40000579419

Surface id: 1115810
Well Type: Dry Hole
Reliab: RRC Hardcopy Map
Longn: -96.45442346
Latn: 32.10130607
Site id: TXOG40000579419

Api: 34980316

Surface id: 1115810
Well Type: Dry Hole
Out fips: N
Cwellnum: 1
Longn: -96.45442346
Latn: 32.10130607

Apinum: 4234980316
Reliab: RRC Hardcopy Map
Radioact: Not Reported

66
NW
1/2 - 1 Mile

OIL_GAS TXOG40000579872

Surface id: 634671
Well Type: Dry Hole
Reliab: RRC Hardcopy Map
Longn: -96.47083233
Latn: 32.10241827
Site id: TXOG40000579872

Api: 349

Surface id: 634671
Well Type: Dry Hole
Out fips: N
Cwellnum: 1
Longn: -96.4708323
Latn: 32.1024183

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

T67
NNE
1/2 - 1 Mile

OIL_GAS TXOG40000580538

Surface id: 634718
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.46003349
Latn: 32.10417596
Site id: TXOG40000580538

Api: 349

Surface id: 634718
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 3
Longn: -96.4600335
Latn: 32.104176

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

O68
NNW
1/2 - 1 Mile

OIL_GAS TXOG40000580241

Surface id: 1053737
Well Type: Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.46930817
Latn: 32.10343206
Site id: TXOG40000580241

Api: 34983181

Surface id: 1053737
Well Type: Oil Well
Out fips: N
Cwellnum: 2
Longn: -96.46930817
Latn: 32.10343206

Apinum: 4234983181
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

S69
East
1/2 - 1 Mile

OIL_GAS TXOG40000576283

Surface id: 1051356
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45017774
Latn: 32.09403975
Site id: TXOG40000576283

Api: 34983377

Surface id: 1051356
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.45017774
Latn: 32.09403975

Apinum: 4234983377
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

Q70
NNW
1/2 - 1 Mile

OIL_GAS TXOG40000580609

Surface id: 634672
Well Type: Permitted Location
Reliab: RRC Hardcopy Map
Longn: -96.46744004
Latn: 32.10435624
Site id: TXOG40000580609

Api: 349

Surface id: 634672
Well Type: Permitted Location
Out fips: N
Cwellnum: 1
Longn: -96.46744
Latn: 32.1043562

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

P71
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000578337

Surface id: 639094
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.45144622
Latn: 32.09882979
Site id: TXOG40000578337

Api: 34983567

Surface id: 639094
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.4514462
Latn: 32.0988298

Apinum: 4234983567
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

72
North
1/2 - 1 Mile

OIL_GAS TXOG40000580882

Surface id: 638730
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.46452538
Latn: 32.10498239
Site id: TXOG40000580882

Api: 34902347

Surface id: 638730
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 2
Longn: -96.4645254
Latn: 32.1049824

Apinum: 4234902347
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

S73
East
1/2 - 1 Mile

OIL_GAS TXOG40000576541

Surface id: 1115992
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.44973423
Latn: 32.0945539
Site id: TXOG40000576541

Api: 34983715

Surface id: 1115992
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.44973423
Latn: 32.0945539

Apinum: 4234983715
Reliab: RRC Hardcopy Map
Radioact: Not Reported

T74
North
1/2 - 1 Mile

OIL_GAS TXOG40000580879

Surface id: 1080725
Well Type: Dry Hole
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Longn: -96.46096706
Latn: 32.10497797
Site id: TXOG40000580879

Api: 34983700

Surface id: 1080725
Well Type: Dry Hole
Out fips: N
Cwellnum: 2I
Longn: -96.46096706
Latn: 32.10497797

Apinum: 4234983700
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Radioact: Not Reported

75
NNE
1/2 - 1 Mile

OIL_GAS TXOG40000580551

Surface id: 635109
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45778285
Latn: 32.10419957
Site id: TXOG40000580551

Api: 349

Surface id: 635109
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 2
Longn: -96.4577828
Latn: 32.1041996

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

U76
East
1/2 - 1 Mile

OIL_GAS TXOG40000575737

Surface id: 1051355
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.44950528
Latn: 32.09269615
Site id: TXOG40000575737

Api: 34983189

Surface id: 1051355
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.44950528
Latn: 32.09269615

Apinum: 4234983189
Reliab: RRC Hardcopy Map
Radioact: Not Reported

V77
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000577358

Surface id: 639090
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.44972581
Latn: 32.096536
Site id: TXOG40000577358

Api: 34983580

Surface id: 639090
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.4497258
Latn: 32.096536

Apinum: 4234983580
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

W78
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000578343

Surface id: 634817
Well Type: Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.4506959
Latn: 32.09884461
Site id: TXOG40000578343

Api: 34981526

Surface id: 634817
Well Type: Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.4506959
Latn: 32.0988446

Apinum: 4234981526
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

W79
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000578722

Surface id: 634816
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45125377
Latn: 32.0997432
Site id: TXOG40000578722

Api: 349

Surface id: 634816
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.4512538
Latn: 32.0997432

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

X80
NE
1/2 - 1 Mile

OIL_GAS TXOG40000579154

Surface id: 634815
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45183893
Latn: 32.10070821
Site id: TXOG40000579154

Api: 349

Surface id: 634815
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.4518389
Latn: 32.1007082

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

V81
East
1/2 - 1 Mile

OIL_GAS TXOG40000577037

Surface id: 639091
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.44927976
Latn: 32.09577221
Site id: TXOG40000577037

Api: 34983619

Surface id: 639091
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: ?
Longn: -96.4492798
Latn: 32.0957722

Apinum: 4234983619
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

X82

NE

1/2 - 1 Mile

OIL_GAS

TXOG40000579540

Surface id: 634814
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45263929
Latn: 32.10159538
Site id: TXOG40000579540

Api: 349

Surface id: 634814
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.4526393
Latn: 32.1015954

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

W83

ENE

1/2 - 1 Mile

OIL_GAS

TXOG40000578006

Surface id: 634818
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45005684
Latn: 32.09809214
Site id: TXOG40000578006

Api: 349

Surface id: 634818
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.4500568
Latn: 32.0980921

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

84

NW

1/2 - 1 Mile

OIL_GAS

TXOG40000580273

Surface id: 634670
Well Type: Permitted Location
Reliab: RRC Hardcopy Map
Longn: -96.4715435
Latn: 32.10349757
Site id: TXOG40000580273

Api: 349

Surface id: 634670
Well Type: Permitted Location
Out fips: N
Cwellnum: 2
Longn: -96.4715435
Latn: 32.10349757

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

U85
East
1/2 - 1 Mile

OIL_GAS TXOG40000575755

Surface id:	1078532		
Well Type:	Oil Well	Api:	349
Reliab:	Hearing file (plat and/or documentation).		
Longn:	-96.44884629		
Latn:	32.09274364		
Site id:	TXOG40000575755		

Surface id:	1078532		
Well Type:	Oil Well	Apinum:	42349
Out fips:	N	Reliab:	Hearing file (plat and/or documentation).
Cwellnum:	1	Radioact:	Not Reported
Longn:	-96.44884629		
Latn:	32.09274364		

V86
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000577704

Surface id:	634819		
Well Type:	Plugged Oil Well	Api:	349
Reliab:	RRC Hardcopy Map		
Longn:	-96.4495234		
Latn:	32.09737483		
Site id:	TXOG40000577704		

Surface id:	634819		
Well Type:	Plugged Oil Well	Apinum:	42349
Out fips:	N	Reliab:	RRC Hardcopy Map
Cwellnum:	Not Reported	Radioact:	Not Reported
Longn:	-96.4495234		
Latn:	32.0973748		

87
North
1/2 - 1 Mile

OIL_GAS TXOG40000581144

Surface id:	634676		
Well Type:	Oil Well	Api:	349
Reliab:	RRC Hardcopy Map		
Longn:	-96.46571925		
Latn:	32.10570267		
Site id:	TXOG40000581144		

Surface id:	634676		
Well Type:	Oil Well	Apinum:	42349
Out fips:	N	Reliab:	RRC Hardcopy Map
Cwellnum:	6	Radioact:	Not Reported
Longn:	-96.4657193		
Latn:	32.1057027		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

88
NE
1/2 - 1 Mile

OIL_GAS TXOG40000579910

Surface id: 634813
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45328327
Latn: 32.10252859
Site id: TXOG40000579910

Api: 349

Surface id: 634813
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.4532833
Latn: 32.1025286

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

V89
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000577387

Surface id: 634820
Well Type: Plugged Oil Well
Reliab: Operator reported location (distances without plat or plat without distances).
Longn: -96.44885068
Latn: 32.0966045
Site id: TXOG40000577387

Api: 34983618

Surface id: 634820
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 5
Longn: -96.4488507
Latn: 32.0966045

Apinum: 4234983618
Reliab: Operator reported location (distances without plat or plat with
Radioact: Not Reported

Y90
NNE
1/2 - 1 Mile

OIL_GAS TXOG40000581236

Surface id: 1080723
Well Type: Dry Hole
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Longn: -96.46003212
Latn: 32.10591596
Site id: TXOG40000581236

Api: 34980380

Surface id: 1080723
Well Type: Dry Hole
Out fips: N
Cwellnum: 3I
Longn: -96.46003212
Latn: 32.10591596

Apinum: 4234980380
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

Z91
East
1/2 - 1 Mile

OIL_GAS TXOG40000577047

Surface id: 634821
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.44843119
Latn: 32.09579981
Site id: TXOG40000577047

Api: 349

Surface id: 634821
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.4484312
Latn: 32.0957998

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

92
North
1/2 - 1 Mile

OIL_GAS TXOG40000581410

Surface id: 1051191
Well Type: Injection/Disposal From Oil
Reliab: RRC Hardcopy Map
Longn: -96.46395304
Latn: 32.10634649
Site id: TXOG40000581410

Api: 34982548

Surface id: 1051191
Well Type: Injection/Disposal From Oil
Out fips: N
Cwellnum: 1W
Longn: -96.46395304
Latn: 32.10634649

Apinum: 4234982548
Reliab: RRC Hardcopy Map
Radioact: Not Reported

Y93
NNE
1/2 - 1 Mile

OIL_GAS TXOG40000581232

Surface id: 638332
Well Type: Canceled Location
Reliab: RRC Hardcopy Map
Longn: -96.45885846
Latn: 32.10589975
Site id: TXOG40000581232

Api: 34933745

Surface id: 638332
Well Type: Canceled Location
Out fips: N
Cwellnum: 1A
Longn: -96.4588585
Latn: 32.1058997

Apinum: 4234933745
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

Z94
East
1/2 - 1 Mile

OIL_GAS TXOG40000576668

Surface id: 634822
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.44804784
Latn: 32.09490474
Site id: TXOG40000576668

Api: 349

Surface id: 634822
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.4480478
Latn: 32.0949047

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

95
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000578958

Surface id: 634833
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45020321
Latn: 32.1002727
Site id: TXOG40000578958

Api: 349

Surface id: 634833
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.4502032
Latn: 32.1002727

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

96
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000578224

Surface id: 634832
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.44913299
Latn: 32.09859951
Site id: TXOG40000578224

Api: 34983378

Surface id: 634832
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.449133
Latn: 32.0985995

Apinum: 4234983378
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

97
SE
1/2 - 1 Mile

OIL_GAS TXOG40000573207

Surface id: 634891
Well Type: Permitted Location
Reliab: RRC Hardcopy Map
Longn: -96.45125284
Latn: 32.08516986
Site id: TXOG40000573207

Api: 349

Surface id: 634891
Well Type: Permitted Location
Out fips: N
Cwellnum: 1
Longn: -96.4512528
Latn: 32.0851699

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

AA98
NE
1/2 - 1 Mile

OIL_GAS TXOG40000579816

Surface id: 634916
Well Type: Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45149723
Latn: 32.1022873
Site id: TXOG40000579816

Api: 34981380

Surface id: 634916
Well Type: Oil Well
Out fips: N
Cwellnum: 1
Longn: -96.4514972
Latn: 32.1022873

Apinum: 4234981380
Reliab: RRC Hardcopy Map
Radioact: Not Reported

AB99
North
1/2 - 1 Mile

OIL_GAS TXOG40000581665

Surface id: 1080726
Well Type: Dry Hole
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Longn: -96.46251324
Latn: 32.10695007
Site id: TXOG40000581665

Api: 349

Surface id: 1080726
Well Type: Dry Hole
Out fips: N
Cwellnum: 5W
Longn: -96.46251324
Latn: 32.10695007

Apinum: 42349
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

100
ENE
1/2 - 1 Mile

OIL_GAS TXOG40000577649

Surface id: 634831
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.44799699
Latn: 32.09722073
Site id: TXOG40000577649

Api: 349

Surface id: 634831
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.447997
Latn: 32.0972207

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

AC101
East
1/2 - 1 Mile

OIL_GAS TXOG40000576262

Surface id: 634823
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.44736418
Latn: 32.09400341
Site id: TXOG40000576262

Api: 349

Surface id: 634823
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.4473642
Latn: 32.0940034

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

102
NNE
1/2 - 1 Mile

OIL_GAS TXOG40000581463

Surface id: 1080724
Well Type: Dry Hole
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Longn: -96.45837313
Latn: 32.10646784
Site id: TXOG40000581463

Api: 34980382

Surface id: 1080724
Well Type: Dry Hole
Out fips: N
Cwellnum: 4I
Longn: -96.45837313
Latn: 32.10646784

Apinum: 4234980382
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

103
East
1/2 - 1 Mile

OIL_GAS TXOG40000575265

Surface id: 634870
Well Type: Dry Hole
Reliab: RRC Hardcopy Map
Longn: -96.44731889
Latn: 32.09129093
Site id: TXOG40000575265

Api: 34933219

Surface id: 634870
Well Type: Dry Hole
Out fips: N
Cwellnum: 1
Longn: -96.4473189
Latn: 32.0912909

Apinum: 4234933219
Reliab: RRC Hardcopy Map
Radioact: Not Reported

AA104
NE
1/2 - 1 Mile

OIL_GAS TXOG40000580206

Surface id: 634915
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.45168291
Latn: 32.10333455
Site id: TXOG40000580206

Api: 34981329

Surface id: 634915
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: 3
Longn: -96.4516829
Latn: 32.1033346

Apinum: 4234981329
Reliab: RRC Hardcopy Map
Radioact: Not Reported

AB105
North
1/2 - 1 Mile

OIL_GAS TXOG40000581860

Surface id: 1080727
Well Type: Dry Hole
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Longn: -96.46144029
Latn: 32.10752393
Site id: TXOG40000581860

Api: 349

Surface id: 1080727
Well Type: Dry Hole
Out fips: N
Cwellnum: 6W
Longn: -96.46144029
Latn: 32.10752393

Apinum: 42349
Reliab: Spotted from USGS 7.5min quad or aerial photo.
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance

Database EDR ID Number

AC106
East
1/2 - 1 Mile

OIL_GAS TXOG40000575953

Surface id: 634824
Well Type: Plugged Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.44667799
Latn: 32.09320904
Site id: TXOG40000575953

Api: 349

Surface id: 634824
Well Type: Plugged Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.446678
Latn: 32.093209

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

107
NE
1/2 - 1 Mile

OIL_GAS TXOG40000580478

Surface id: 638401
Well Type: Injection/Disposal From Oil
Reliab: RRC Hardcopy Map
Longn: -96.45214
Latn: 32.10402757
Site id: TXOG40000580478

Api: 34981099

Surface id: 638401
Well Type: Injection/Disposal From Oil
Out fips: N
Cwellnum: 47RI
Longn: -96.45214
Latn: 32.1040276

Apinum: 4234981099
Reliab: RRC Hardcopy Map
Radioact: Not Reported

108
East
1/2 - 1 Mile

OIL_GAS TXOG40000576826

Surface id: 634865
Well Type: Oil Well
Reliab: RRC Hardcopy Map
Longn: -96.44672144
Latn: 32.09524763
Site id: TXOG40000576826

Api: 349

Surface id: 634865
Well Type: Oil Well
Out fips: N
Cwellnum: Not Reported
Longn: -96.4467214
Latn: 32.0952476

Apinum: 42349
Reliab: RRC Hardcopy Map
Radioact: Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

RADON

AREA RADON INFORMATION

State Database: TX Radon

Radon Test Results

County	Mean	Total Sites	%>4 pCi/L	%>20 pCi/L	Min pCi/L	Max pCi/L
NAVARRO	<.5	3	.0	.0	<.5	.5

Federal EPA Radon Zone for NAVARRO County: 3

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for Zip Code: 75110

Number of sites tested: 2

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area - 1st Floor	-0.150 pCi/L	100%	0%	0%
Living Area - 2nd Floor	Not Reported	Not Reported	Not Reported	Not Reported
Basement	Not Reported	Not Reported	Not Reported	Not Reported

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Scanned Digital USGS 7.5' Topographic Map (DRG)

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

HYDROLOGIC INFORMATION

Flood Zone Data: This data, available in select counties across the country, was obtained by EDR in 2003 & 2009 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

Public Water Supply Sources Databases

Source: Texas Commission on Environmental Quality

Telephone: 512-239-6199

Locations of public drinking water sources maintained by the TCEQ

Groundwater Database

Source: Texas Water Development Board

Telephone: 512-936-0837

Well Report Database

Source: Department of Licensing and Regulation

Telephone: 512-936-0833

Water Well Database

Source: Harris-Galveston Coastal Subsidence District

Telephone: 281-486-1105

Submitted Driller's Reports Database

Source: Texas Water Development Board

Telephone: 512-936-0833

The Submitted Driller's Reports Database is populated from the online Texas Well Report Submission and Retrieval System which is a cooperative Texas Department of Licensing and Regulation (TDLR) and Texas Water Development Board (TWDB) application that registered water-well drillers use to submit their required reports.

OTHER STATE DATABASE INFORMATION

Texas Oil and Gas Wells:

Source: Texas Railroad Commission

Telephone: 512-463-6882

Oil and gas well locations

RADON

State Database: TX Radon

Source: Department of Health

Telephone: 512-834-6688

Rinal Report of the Texas Indoor Radon Survey

PHYSICAL SETTING SOURCE RECORDS SEARCHED

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones

Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRRA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

STREET AND ADDRESS INFORMATION

© 2010 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

Appendix E

HISTORICAL TENANT SEARCH

101 N. Beaton

101 N. Beaton
Corsicana, TX 75110

Inquiry Number: 3025321.6
April 04, 2011

The EDR-City Directory Abstract

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

Thank you for your business.

Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2009 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Abstract is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Abstract includes a search and abstract of available city directory data. For each address, the directory lists the name of the corresponding occupant at five year intervals.

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. An "X" indicates where information was identified in the source and provided in this report.

<u>Year</u>	<u>Source</u>	<u>TP</u>	<u>Adjoining</u>	<u>Text Abstract</u>	<u>Source Image</u>
2001	Polk City Directory	X	X	X	-
1993	Polk City Directory	X	X	X	-
1988	Polk City Directory	X	X	X	-
1983	Polk City Directory	X	X	X	-
1978	Polk City Directory	X	X	X	-
1973	Polk City Directory	X	X	X	-
1969	Polk City Directory	X	X	X	-
1965	Polk City Directory	X	X	X	-
1960	Polk City Directory	X	X	X	-
1951	Polk City Directory	X	X	X	-
1947	Polk City Directory	X	X	X	-
1941	Worley's City Directory	X	X	X	-
1936	Polk City Directory	X	X	X	-
1926	Polk City Directory	X	X	X	-
1922	Polk City Directory	X	X	X	-
1902	Morrison-Fourmy City Directory	-	-	-	-
1895	Morrison-Fourmy City Directory	-	-	-	-

FINDINGS

TARGET PROPERTY INFORMATION

ADDRESS

101 N. Beaton
Corsicana, TX 75110

FINDINGS DETAIL

Target Property research detail.

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2001	Banc One Mortgage	Polk City Directory
	Bank One Texas National Association (bank)	Polk City Directory
	Care Company Health Services	Polk City Directory
	Corsicana PAGING Services (tel answering serv)	Polk City Directory
	Eagel Farms Property Management (real estate mgmr)	Polk City Directory
	Hughey & Campbell (attys)	Polk City Directory
	Strategies Learning Center	Polk City Directory
	Trinity Physical Medicine (phys)	Polk City Directory
1993	Afton Burke Offices	Polk City Directory
	Bank One	Polk City Directory
	Blue Bonnet Answering Service	Polk City Directory
	Cerf James H (ofc)	Polk City Directory
	Corsicana Paging (radio paging)	Polk City Directory
	Liberty Mutual (addl sp)	Polk City Directory
	Liberty Mutual Insurance Companies	Polk City Directory
	Property Management Co.	Polk City Directory
1988	Liberty Mutual Insurance Companies	Polk City Directory
	M Bank Corsicana	Polk City Directory
	Star Service & Petroleum	Polk City Directory
1983	Burke J Afton Estates	Polk City Directory
	Cayuga Oil & Gas Co. Inc. (exploration & products)	Polk City Directory
	Cerf James (ofc)	Polk City Directory
	Holman W L Realtor	Polk City Directory
	Jetco Chemical (Annex)	Polk City Directory
	Jetco Chemical Inc. (ofcs)	Polk City Directory
	Jetco Shemoical Inc. (oil treating compounds)	Polk City Directory
	Liberty Mutual Insurance Co.	Polk City Directory
	Liberty Mutual Ons Co. (ofcs)	Polk City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1983	State National Bank	Polk City Directory
	State National Bank (Bank Ofcs)	Polk City Directory
	State National Bank Building	Polk City Directory
1978	Burke Brahmans (cattle)	Polk City Directory
	Burke J Afton Estates	Polk City Directory
	Cerf James (ofc)	Polk City Directory
	Holman W L Realtor	Polk City Directory
	Jetco Chemical (Annex)	Polk City Directory
	Liberty Mutual Ins Co. (ofcs)	Polk City Directory
	Liberty Mutual Insurance Co.	Polk City Directory
	Mc Gary Lester E Jr. (phys)	Polk City Directory
	State National Bank	Polk City Directory
	State National Bank (Bkpg Dept)	Polk City Directory
	State National Bank Building	Polk City Directory
1973	Burke Brahmans (cattle)	Polk City Directory
	Burke Bros (cattle breeders)	Polk City Directory
	Cayuga Oil & Gas Co.	Polk City Directory
	Cooper-Eady & Judson (ins co)	Polk City Directory
	Dawson Dawson & Smith (lwyr)	Polk City Directory
	Holman W L Realtor	Polk City Directory
	Liberty Mutual Ins Co. (ofcs)	Polk City Directory
	Liberty Mutual Insurance Co.	Polk City Directory
	Mc Gary Lester E Jr. (phys)	Polk City Directory
	State National Bank	Polk City Directory
	State National Bank (Bkpg Dept)	Polk City Directory
	State National Bank Building	Polk City Directory
1969	Office Building (47 occupants)	Polk City Directory
1965	State National Bank Building (49 occupants)	Polk City Directory
1960	State National Bank Building (64 occupants)	Polk City Directory
1951	State National Bank Building (67 occupants)	Polk City Directory
1947	State National Bank Building (59 occupants)	Polk City Directory
1941	State National Bank Building (66 occupants)	Worley's City Directory
1936	State National Bank Building (59 occupants)	Polk City Directory
1926	State National Bank Building (40 occupants)	Polk City Directory
1922	Louis Hashop (confr)	Polk City Directory
	Fleming Cotton Co.	Polk City Directory
	M H Thomas (cotton buyer)	Polk City Directory

FINDINGS

ADJOINING PROPERTY DETAIL

The following Adjoining Property addresses were researched for this report. Detailed findings are provided for each address.

N. Beaton

100 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2001	Beaton Pharmacy	Polk City Directory
1993	Beaton Pharmacy	Polk City Directory
1988	Beaton Pharmacy	Polk City Directory
1983	Beaton Pharmacy	Polk City Directory
1978	Vacant	Polk City Directory
1973	Ladybug Gift Shop The	Polk City Directory
1969	Mode O' Day (ladies ready-to-wear clo)	Polk City Directory
1965	Vacant	Polk City Directory
1960	McAdams Pharmacy	Polk City Directory
1951	McAdams Pharmacy	Polk City Directory
1947	McDonald's Pharm	Polk City Directory
1941	McDonald's Pharm	Worley's City Directory
1936	Corsicana Natl Bank Bldg	Polk City Directory
	Dickson Sisters Palmer Post-Graduate Chiropractors	Polk City Directory
	Mays Richd and A P (lawyers)	Polk City Directory
	McDonald's Pharm	Polk City Directory
	Milburn C L (lawyer)	Polk City Directory
	Navarro Camp No. 5 W O W	Polk City Directory
	Smith O L (dentist)	Polk City Directory
1926	Albritton Bros Norwood	Polk City Directory
	Corsicana Natl Bank Bldg	Polk City Directory
	Corsicana Natl Bk	Polk City Directory
	Dr Fred B OWens	Polk City Directory
	Dr Richard C Curtis	Polk City Directory
	Lawrence Treadwell Atty	Polk City Directory
	Mays & Mays Attys	Polk City Directory
1922	Albritton & Cox (real est)	Polk City Directory
	Corsicana Natl Bank Bldg	Polk City Directory
	Corsicana Natl Bk	Polk City Directory
	Farmers Natl Farm Loan Assn	Polk City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1922	Fort Worth Life Ins Co.	Polk City Directory
	J A Thompson Estate	Polk City Directory
	J S Eubank (real est)	Polk City Directory
	Lawrence Treadwell (lawyer)	Polk City Directory
	O L Smith (dentist)	Polk City Directory
	Richard Mays (lawyer)	Polk City Directory

102 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1993	Tejas Fabrics (retail)	Polk City Directory
1988	Tejas Fabrics (retail)	Polk City Directory
1983	Tejas Fabrics (retail)	Polk City Directory
1978	Tejas Fabrics (retail)	Polk City Directory
1973	Sew'n Fabric	Polk City Directory
1969	Sew'n Fabric	Polk City Directory
1965	Sew'N Fabric Singer Co.	Polk City Directory
1960	Sew N Sew (dry gds)	Polk City Directory
1951	Franklin's (women's clo)	Polk City Directory
1947	Franklin's (women's clo)	Polk City Directory
1941	Franklin's (women's clo)	Worley's City Directory
1936	Woolworth F W Co. (dept store)	Polk City Directory
1926	F W Wollworth Co.	Polk City Directory
1922	F W Wollworth Co. (notions)	Polk City Directory

102 1/2 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1926	J Y Stewart Ins	Polk City Directory
1922	F R Lindley (dentist)	Polk City Directory
	Leon Clark (real est)	Polk City Directory
	Swisher Optical Co.	Polk City Directory

103 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1922	Brown & Johnson (barbers)	Polk City Directory

104 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2001	B & G Auto Parts (auto sup parts)	Polk City Directory
1993	B & G Auto Parts (repair)	Polk City Directory
1988	B & G Auto Parts (retail)	Polk City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1983	B & G Auto Parts (retail)	Polk City Directory
1978	Corsicana Sales (genl mdse)	Polk City Directory
1973	Mc Lellan Stores (variety stores)	Polk City Directory
1969	Mc Lellan Stores (variety stores)	Polk City Directory
1965	Mc Lellan Stores (variety stores)	Polk City Directory
1960	Mc Lellan Stores (variety stores)	Polk City Directory
1951	Mc Lellan StoresVariety Stores	Polk City Directory
1947	Mc Lellan Stores (dept stores)	Polk City Directory
1941	Mc Lellan Stores Co. (dept stores)	Worley's City Directory
1936	Mc Lellan Stores Co. (dept stores)	Polk City Directory
1926	Crouch Tailor Shop	Polk City Directory
	Dorseys Barber Shop	Polk City Directory
	Sanitary Cafe	Polk City Directory
1922	Army Equipment Co. (clothing)	Polk City Directory
	W B Dorsey (barbers)	Polk City Directory

105 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1965	Vacant	Polk City Directory
1960	Mitcham Appl Co.	Polk City Directory
1951	Johnapelus Candy Kitchen	Polk City Directory
1947	Johnapelus Candy Kitchen	Polk City Directory
1941	Johnapelus Candy Kitchen	Worley's City Directory
1936	Johnapelus Candy Kitchen	Polk City Directory
1926	Jas Johnapelus Conf	Polk City Directory
1922	James Johnapelus (confr)	Polk City Directory
	John Pitluk (notions)	Polk City Directory

105 1/2 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1965	Vacant	Polk City Directory
1951	Vacant	Polk City Directory
1947	Residential	Polk City Directory
1941	Vacant	Worley's City Directory
1936	Muphy Audrey (furn rms)	Polk City Directory
1926	Vacant	Polk City Directory

FINDINGS

106 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1926	C R Terry & Son	Polk City Directory
	Dr. Oscar L Smith	Polk City Directory
	Farmers Natl Farm Loan Assn	Polk City Directory
	J S Eubank	Polk City Directory
	Labban Conf-R Invest	Polk City Directory
1922	George Labban (confr)	Polk City Directory

107 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1983	State National Bank (Drive In)	Polk City Directory
1978	State National Bank (Drive In)	Polk City Directory
1973	State National Bank (Drive In)	Polk City Directory
1969	State National Bank (Drive In)	Polk City Directory
1965	Vacant	Polk City Directory
1960	Levy's (men's clo)	Polk City Directory
1951	Levy's (clo)	Polk City Directory
1947	Levy's (clo)	Polk City Directory
1941	Levy's (clo)	Worley's City Directory
1936	Kaufman Harry (clo)	Polk City Directory
1926	Residential	Polk City Directory
1922	Harry Kaufman (clothing)	Polk City Directory
	Samuel Fleishman (shoes)	Polk City Directory

107 1/2 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1965	Vacant	Polk City Directory
1960	Vacant	Polk City Directory
1951	Vacant	Polk City Directory
1947	Vacant	Polk City Directory
1941	Vacant	Worley's City Directory
1936	Vacant	Polk City Directory
1926	Residential	Polk City Directory
1922	W B Evans (cotton buys)	Polk City Directory

108 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2001	Tacketts Appliance (elec hsehd appl)	Polk City Directory
1993	Studio West (art galleriesdlrs conslts)	Polk City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1988	Custom Frames (picture frames)	Polk City Directory
1983	Chimney Sweep Fireplace & Etc The	Polk City Directory
1978	Charlotte's Hallmark Shop	Polk City Directory
	Home furniture Co. (Whse)	Polk City Directory
1973	Austin Shoe Store	Polk City Directory
1969	Austin Shoe Store	Polk City Directory
1965	Austin Shoe Store	Polk City Directory
1960	Austin Shoe Store	Polk City Directory
1951	Austin Shoe Store	Polk City Directory
1947	Austin Shoe Store	Polk City Directory
1941	Austin Shoe Store	Worley's City Directory
1936	Austin Shoe Store	Polk City Directory
1926	Johnson's Clothing Co.	Polk City Directory
1922	Johnson's Clothing Co.	Polk City Directory

109 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1965	Two Bros Barber Shop	Polk City Directory
1960	Northcutt Ins Agcy	Polk City Directory
	Two Bros Barber Shop	Polk City Directory
1951	Louise's Beauty Shop	Polk City Directory
	Two Bros Barber Shop	Polk City Directory
1947	Radio Electic	Polk City Directory
1941	Milton Jas J (barber)	Worley's City Directory
1936	Douglas J W (restr)	Polk City Directory
	Green W A (barber)	Polk City Directory
1926	Residential	Polk City Directory
1922	Cerf & Raphael (loans)	Polk City Directory
	Jewish Cemetery Society Office	Polk City Directory

109 1/2 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1947	Blue Bird Shine Parlor	Polk City Directory
1941	Vacant	Worley's City Directory

109 A N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1965	M & M Finance Co. (loans)	Polk City Directory

FINDINGS

110 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1993	Hometown Antique Mall	Polk City Directory
1988	Home Furniture Co.	Polk City Directory
1983	Home Furniture Co.	Polk City Directory
1978	Home Furniture Co.	Polk City Directory
1973	Home Furniture Co.	Polk City Directory
1969	Home Furniture Co.	Polk City Directory
1965	Woolworth F W Co. (variety stores)	Polk City Directory
1960	Woolworth F W Co. (variety stores)	Polk City Directory
1951	Woolworth F W Co. (variety stores)	Polk City Directory
1947	Woolworth F W Co. (variety stores)	Polk City Directory
1941	Woolworth F W Co. (dept store)	Worley's City Directory
1936	Underwood Style Shop (women's clo)	Polk City Directory
1926	Coulson Drug Co,	Polk City Directory
1922	Coulson Drug Co,	Polk City Directory
	Eastman Kodak Agy	Polk City Directory
	Rexall Drug Store	Polk City Directory

110 1/2 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1936	Vacant	Polk City Directory
1926	Vacant	Polk City Directory
1922	O C Bowmer (phys)	Polk City Directory
	S H Burnett (phys)	Polk City Directory

111 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1960	White's Auto Store	Polk City Directory
1951	Green's Shoe Shop (reprs)	Polk City Directory
1947	DeLuxe Shoe Shop	Polk City Directory
1941	Fleishman Saml (shoe repr)	Worley's City Directory
1936	Fleishman Saml (shoe repr)	Polk City Directory
1926	Residential	Polk City Directory
1922	Jonas Jacobs (clothing)	Polk City Directory

111 1/2 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1947	Vacant	Polk City Directory
1941	Vacant	Worley's City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1936	Navarro Club (billiards)	Polk City Directory
1926	Central Hotel	Polk City Directory
1922	P F Ward (furn rm)	Polk City Directory

112 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1936	Goldberg's Brownbilt Shoe Store	Polk City Directory
1926	Clarence A Tripp Hwd	Polk City Directory
1922	Kerr Bros (hdw)	Polk City Directory

113 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	Evans M Jeweler	Polk City Directory
1965	Evans M Jeweler	Polk City Directory
1960	Evans M Jeweler	Polk City Directory
1951	Evans Morris (jwlr)	Polk City Directory
1947	Evans Morris (jwlr)	Polk City Directory
	Workmen's Loan & Finance Co.	Polk City Directory
1941	Evans Morris (pwn broker)	Worley's City Directory
	Workmen's Loan & Finance Co. (finance)	Worley's City Directory
1936	Rothkopf Saml (dry gds)	Polk City Directory
1926	Residential	Polk City Directory

114 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1993	Vacant	Polk City Directory
1988	En touche (beauty shop)	Polk City Directory
1983	En touche Cosmetics	Polk City Directory
1978	Shapiro Elliott L (podiatrist)	Polk City Directory
1973	Lee Optical Co.	Polk City Directory
	Shryock Maurice (optom)	Polk City Directory
1969	Lee Optical Co.	Polk City Directory
1965	Lee Optical Co.	Polk City Directory
1960	Lee Optical Co.	Polk City Directory
1951	Smart Shop The (women's clo)	Polk City Directory
1947	Smart Shop The (women's clo)	Polk City Directory
1941	Smart Shop The (clo)	Worley's City Directory
1936	Ladie' Shoppe	Polk City Directory
1926	Weaver & Reese Shoe Store	Polk City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1922	Gardner-Smith Shoe Co.	Polk City Directory

115 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1969	White's Auto Store	Polk City Directory
1965	York's Joe Furniture & Appliance	Polk City Directory
1960	York's Joe Furniture & Appliance Store	Polk City Directory
1951	York Joe Home & Auto Store	Polk City Directory
1947	York Joe Home & Auto Store	Polk City Directory
1941	Corsicana Tire & Auto Supply Co. (tire dlr)	Worley's City Directory
1936	Adams R K (wtchmkr)	Polk City Directory
	Evans Morris (pawnbrokers)	Polk City Directory
	Workmens Loan & Finance Co.	Polk City Directory
1926	M Evan Dry Goods	Polk City Directory
1922	Hyman Grossman (dry goods)	Polk City Directory

115 1/2 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1926	C E Hoover Atty	Polk City Directory
	D E Stander Tailor	Polk City Directory

116 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1993	Evans M (corp ofc)	Polk City Directory
1988	City Air Systems (heater-air conditn)	Polk City Directory
1983	Ceiling Fan Shop (retail fans)	Polk City Directory
1978	Clint's Jewelry	Polk City Directory
1965	Jones Finance Co.	Polk City Directory
1960	House W M Jewelers	Polk City Directory
1951	Lane Sho Store	Polk City Directory
1947	Two Brothers Barber Shop	Polk City Directory
1941	Two Brothers Barber Shop	Worley's City Directory
1936	Two Brothers Barber Shop	Polk City Directory
1926	Two Brothers Barber Shop	Polk City Directory
1922	A S Vandiver (barber)	Polk City Directory

117 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1960	Babcock Bros Auto Supply	Polk City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1951	Babcock Bros Auto Supply	Polk City Directory
1947	Babcock Bros Auto Supply	Polk City Directory
1941	Electric Studio (photog)	Worley's City Directory
1936	Vacant	Polk City Directory
1926	Residential	Polk City Directory
1922	S L Wadley (restr)	Polk City Directory

117 1/2 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1951	UptownClub (dominoes)	Polk City Directory
1947	UptownClub (dominoes)	Polk City Directory
1941	Vacant	Worley's City Directory
1936	Vacant	Polk City Directory
1926	Vacant	Polk City Directory
1922	S L Wadley (furn rms)	Polk City Directory

118 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
2001	World Finance Corporation Of Georgia (personal credit instit)	Polk City Directory
1993	World Finance Corp.	Polk City Directory
1988	World Finance	Polk City Directory
1983	Kitchens Etc.	Polk City Directory
1978	Linens & Fabric Outlet (clo)	Polk City Directory
1973	Pauline's Sports Wear (clo)	Polk City Directory
1969	Winnie Lee Shop (womens clo)	Polk City Directory
1965	Winnie Lee Shop (womens clo)	Polk City Directory
1960	Winnie Lee Shop (womens clo)	Polk City Directory
1951	Winnie Lee Shop (womens clo)	Polk City Directory
1947	Winnie Lee Shop (womens clo)	Polk City Directory
1941	Vacant	Worley's City Directory
1936	Rhoads G D (jwlry)	Polk City Directory
1926	R L F Dickeson Studio	Polk City Directory
1922	R L Reese & Son (jewelers)	Polk City Directory

118 1/2 N. Beaton

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1941	Vacant	Worley's City Directory
1936	Great Sou Life Ins Co.	Polk City Directory
	Love H B (dentist)	Polk City Directory

FINDINGS

<u>Year</u>	<u>Uses</u>	<u>Source</u>
1926	Tessie F Dickeson Studio	Polk City Directory
1922	H B Love (dentist)	Polk City Directory
	Laura Baugh (photogr)	Polk City Directory

FINDINGS

TARGET PROPERTY: ADDRESS NOT IDENTIFIED IN RESEARCH SOURCE

The following Target Property addresses were researched for this report, and the addresses were not identified in the research source.

Address Researched

101 N. Beaton

Address Not Identified in Research Source

1902, 1895

ADJOINING PROPERTY: ADDRESSES NOT IDENTIFIED IN RESEARCH SOURCE

The following Adjoining Property addresses were researched for this report, and the addresses were not identified in research source.

Address Researched

100 N. Beaton

102 1/2 N. Beaton

102 N. Beaton

103 N. Beaton

104 N. Beaton

105 1/2 N. Beaton

105 N. Beaton

106 N. Beaton

107 1/2 N. Beaton

107 N. Beaton

108 N. Beaton

109 1/2 N. Beaton

109 A N. Beaton

109 N. Beaton

110 1/2 N. Beaton

110 N. Beaton

111 1/2 N. Beaton

111 N. Beaton

112 N. Beaton

113 N. Beaton

114 N. Beaton

115 1/2 N. Beaton

Address Not Identified in Research Source

1902, 1895

1902, 1895

1902, 1895

1902, 1895

1902, 1895

1960, 1922, 1902, 1895

1902, 1895

1902, 1895

1902, 1895

1902, 1895

1902, 1895

1936, 1926, 1922, 1902, 1895

1960, 1951, 1947, 1941, 1936, 1926, 1922, 1902, 1895

1902, 1895

1902, 1895

1902, 1895

1902, 1895

1902, 1895

1902, 1895

1922, 1902, 1895

1902, 1895

1922, 1902, 1895

FINDINGS

Address Researched

115 N. Beaton

116 N. Beaton

117 1/2 N. Beaton

117 N. Beaton

118 1/2 N. Beaton

118 N. Beaton

Address Not Identified in Research Source

1902, 1895

1973, 1969, 1902, 1895

1902, 1895

1902, 1895

1902, 1895

1902, 1895

Appendix F

SANBORN MAPS



101 N. Beaton

101 N. Beaton

Corsicana, TX 75110

Inquiry Number: 3025321.3

March 29, 2011

Certified Sanborn® Map Report

Certified Sanborn® Map Report

3/29/11

Site Name:

101 N. Beaton
101 N. Beaton
Corsicana, TX 75110

Client Name:

G.E.C., Inc.
9357 Interline Avenue
Baton Rouge, LA 70809

EDR Inquiry # 3025321.3

Contact: Jennifer Lindquist



The complete Sanborn Library collection has been searched by EDR, and fire insurance maps covering the target property location provided by G.E.C., Inc. were identified for the years listed below. The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by Sanborn Library LLC, the copyright holder for the collection.

Certified Sanborn Results:

Site Name: 101 N. Beaton
Address: 101 N. Beaton
City, State, Zip: Corsicana, TX 75110
Cross Street:
P.O. # NA
Project: 9827.3160109.000
Certification # 7551-4E85-9F59



Sanborn® Library search results
Certification # 7551-4E85-9F59

Maps Provided:

1965	1900
1949	1894
1931	1889
1921	1885
1910	
1905	

The Sanborn Library includes more than 1.2 million Sanborn fire insurance maps, which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ☒ Library of Congress
- ☒ University Publications of America
- ☒ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

G.E.C., Inc. (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Thumbnails

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1965 Source Sheets



Volume 1, Sheet 4



Volume 1, Sheet 5



Volume 1, Sheet 8

1949 Source Sheets



Volume 1, Sheet 4



Volume 1, Sheet 5



Volume 1, Sheet 8

1931 Source Sheets



Volume 1, Sheet 4




Volume 1, Sheet 5



Volume 1, Sheet 8

1921 Source Sheets

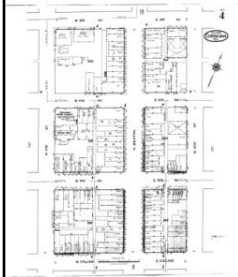

Volume 1, Sheet 4



Volume 1, Sheet 5



Volume 1, Sheet 8

1910 Source Sheets



Volume 1, Sheet 2



Volume 1, Sheet 3



Volume 1, Sheet 4


1905 Source Sheets



Volume 1, Sheet 8



Volume 1, Sheet 9

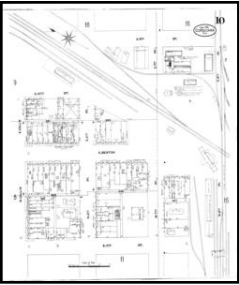

Volume 1, Sheet 10

1900 Source Sheets



Volume 1, Sheet 8



Volume 1, Sheet 9



Volume 1, Sheet 10

1894 Source Sheets



Volume 1, Sheet 7



Volume 1, Sheet 8



Volume 1, Sheet 5

1889 Source Sheets



Volume 1, Sheet 3




Volume 1, Sheet 4




Volume 1, Sheet 2

1885 Source Sheets

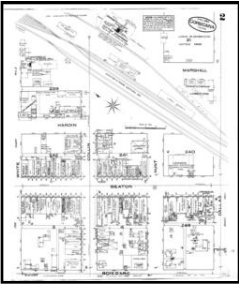

Volume 1, Sheet 2


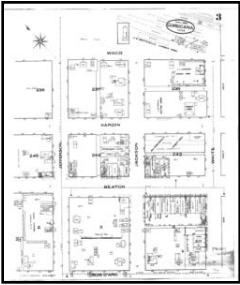


Volume 1, Sheet 3

1965 Certified Sanborn Map



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

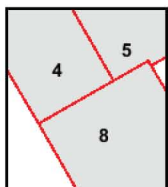

Volume 1, Sheet 4
 Volume 1, Sheet 5
 Volume 1, Sheet 8



1949 Certified Sanborn Map

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.


Certification # 7551-4E85-9F59

Site Name: 101 N. Beaton
Address: 101 N. Beaton
City, ST, ZIP: Corsicana TX 75110
Client: G.E.C., Inc.
EDR Inquiry: 3025321.3
Order Date: 3/29/2011 10:20:00 AM
Certification #: 7551-4E85-9F59

Copyright: 1949



This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

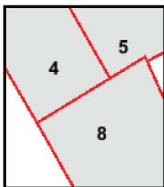

Volume 1, Sheet 4
Volume 1, Sheet 5
Volume 1, Sheet 8

0 Feet 150 300 600



1931 Certified Sanborn Map

The certified Sanborn Map search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.


Certification # 7551-4E85-9F59

Site Name: 101 N. Beaton
Address: 101 N. Beaton
City, ST, ZIP: Corsicana TX 75110
Client: G.E.C., Inc.
EDR Inquiry: 3025321.3
Order Date: 3/29/2011 10:20:00 AM
Certification #: 7551-4E85-9F59

Copyright: 1931



This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

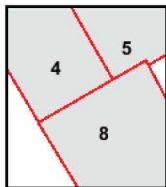

Volume 1, Sheet 4
Volume 1, Sheet 5
Volume 1, Sheet 8

0 Feet 150 300 600




1921 Certified Sanborn Map



This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 150 300 600

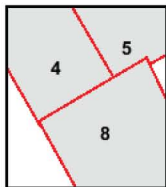

Volume 1, Sheet 4
Volume 1, Sheet 5
Volume 1, Sheet 8





1910 Certified Sanborn Map



1905 Certified Sanborn Map



This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

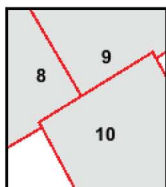


Volume 1, Sheet 8
Volume 1, Sheet 9
Volume 1, Sheet 10



1900 Certified Sanborn Map




This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

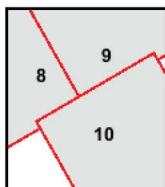


Volume 1, Sheet 8
Volume 1, Sheet 9
Volume 1, Sheet 10

1894 Certified Sanborn Map

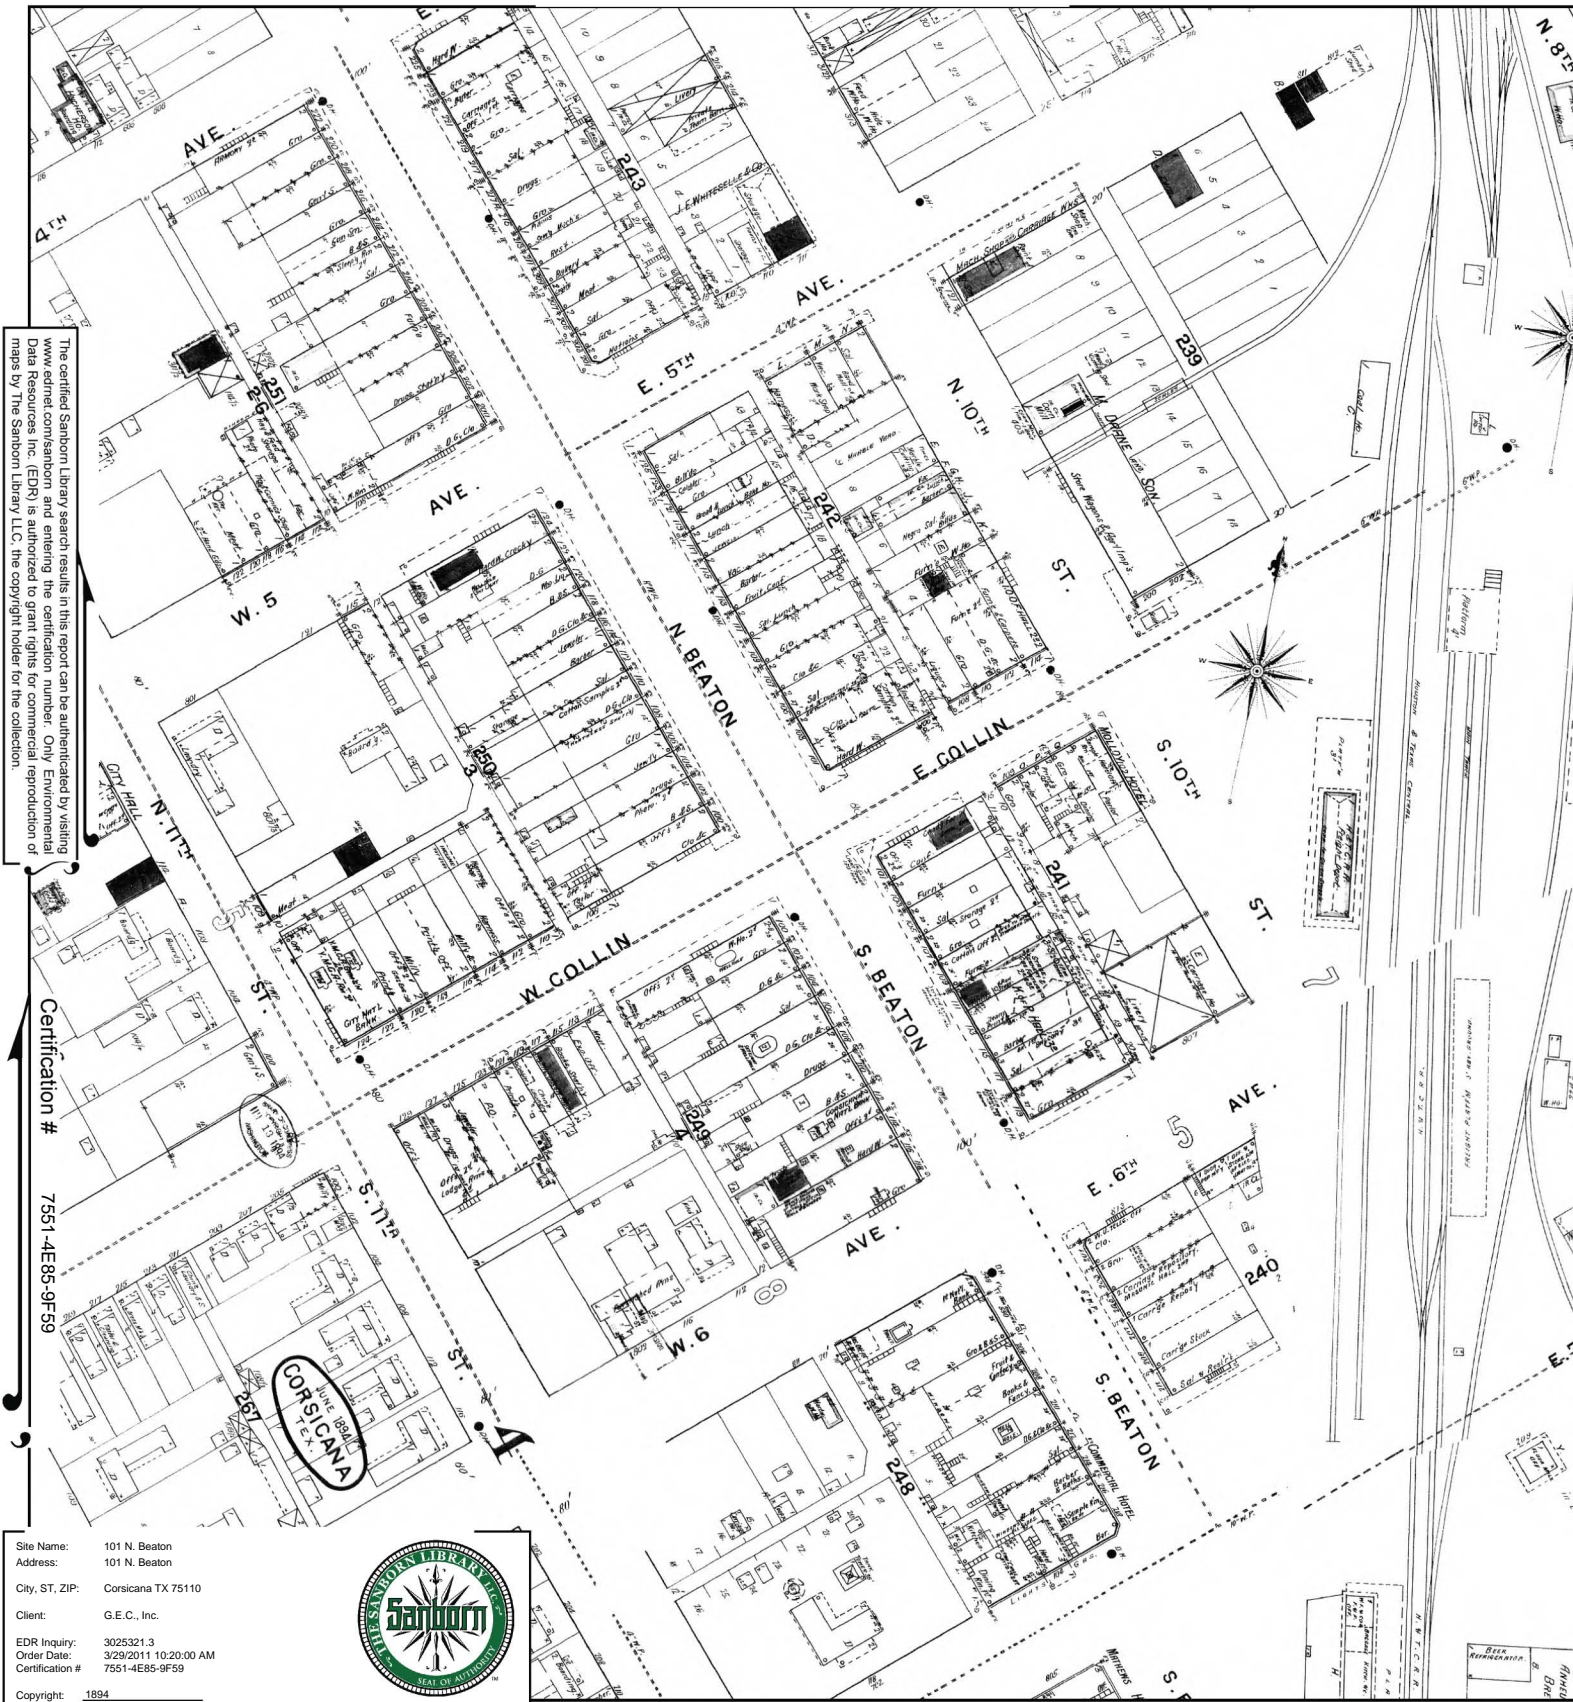

This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

0 Feet 150 300 600

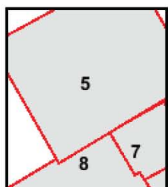



Volume 1, Sheet 7
Volume 1, Sheet 8
Volume 1, Sheet 5



1889 Certified Sanborn Map



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

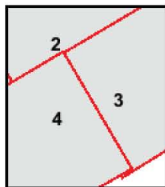



Volume 1, Sheet 3
Volume 1, Sheet 4
Volume 1, Sheet 2



1885 Certified Sanborn Map



This Certified Sanborn Map combines the following sheets.
Outlined areas indicate map sheets within the collection.

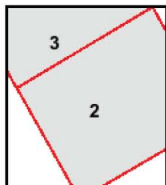

Volume 1, Sheet 2

Volume 1, Sheet 3



Appendix G

HISTORICAL TOPOGRAPHIC MAPS

Appendix H

HISTORICAL AERIAL MAPS



101 N. Beaton

101 N. Beaton

Corsicana, TX 75110

Inquiry Number: 3025321.5

March 30, 2011

The EDR Aerial Photo Decade Package

EDR Aerial Photo Decade Package

Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2011 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Date EDR Searched Historical Sources:

Aerial Photography March 30, 2011

Target Property:

101 N. Beaton

Corsicana, TX 75110

<u><i>Year</i></u>	<u><i>Scale</i></u>	<u><i>Details</i></u>	<u><i>Source</i></u>
1940	Aerial Photograph. Scale: 1"=500'	Flight Year: 1940	ASCS
1953	Aerial Photograph. Scale: 1"=1500'	Flight Year: 1953 Best Copy Available from original source	AMS
1964	Aerial Photograph. Scale: 1"=500'	Flight Year: 1964	USGS
1976	Aerial Photograph. Scale: 1"=750'	Flight Year: 1976	TXDOT
1981	Aerial Photograph. Scale: 1"=500'	Flight Year: 1981	TXDOT
1995	Aerial Photograph. Scale: 1"=500'	Flight Year: 1995	USGS-CIR
2004	Aerial Photograph. Scale: 1"=500'	Flight Year: 2004	USDA-CIR
2005	Aerial Photograph. Scale: 1"=604'	Flight Year: 2005	EDR
2006	Aerial Photograph. Scale: 1"=604'	Flight Year: 2006	EDR



INQUIRY #: 3025321.5

YEAR: 1940

| = 500'





INQUIRY #: 3025321.5

YEAR: 1953

| = 1500'





INQUIRY #: 3025321.5

YEAR: 1964

| = 500'





INQUIRY #: 3025321.5

YEAR: 1976

| = 750'





INQUIRY #: 3025321.5

YEAR: 1981

| = 500'





INQUIRY #: 3025321.5

YEAR: 1995

| = 500'





INQUIRY #: 3025321.5

YEAR: 2004

| = 500'





INQUIRY #: 3025321.5

YEAR: 2005

| = 604'





INQUIRY #: 3025321.5

YEAR: 2006

| = 604'



Appendix I

PHOTOGRAPHS



Photograph 1. Building exterior



Photograph 2. Addition exterior



Photograph 3. Chase Bank crown molding and ceiling tiles, mezzanine level




Photograph 4. Wrapped pipes and concrete ceiling under drop ceiling




Photograph 5. Piping in bathroom closet



Photograph 6. Peeling paint

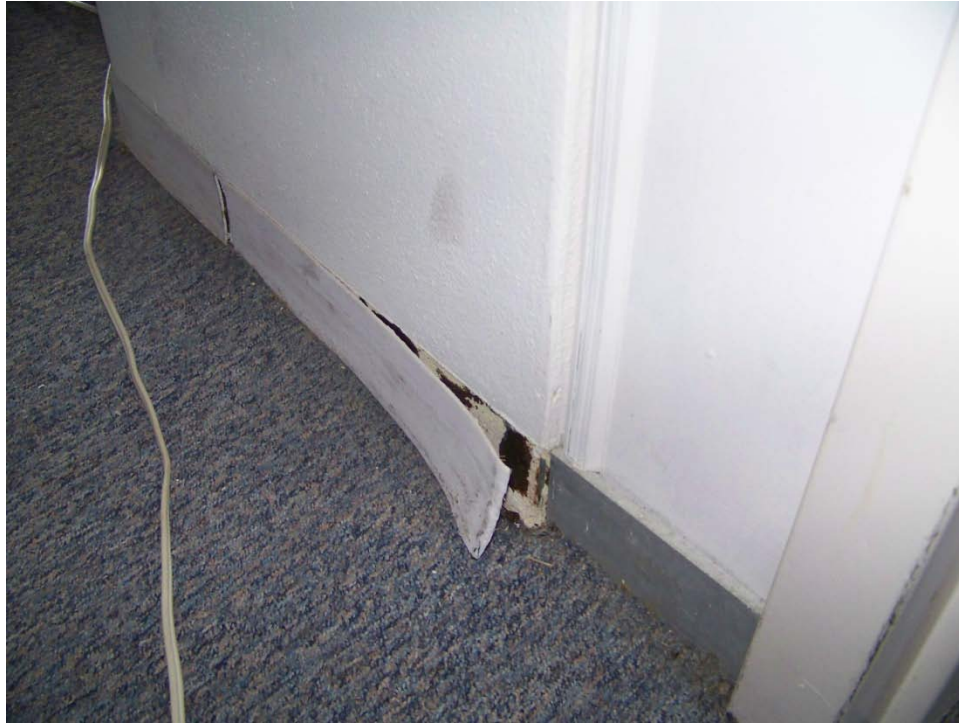

Photograph 7. Rubber baseboards

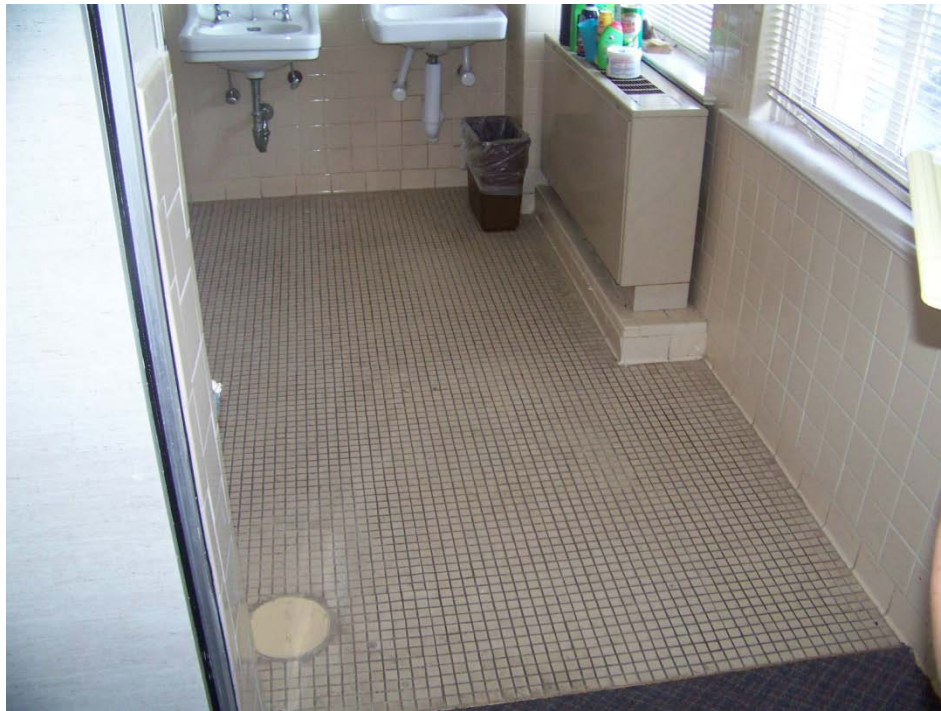

Photograph 8. Typical bathroom



Photograph 9. Vinyl flooring under carpet



Photograph 10. Wooden window



Photograph 11. Fiberglass insulation above drop ceiling



Photograph 12. Elevator winches on roof



Photograph 13. Cistern on roof




Photograph 14. Exterior roof, shed at left



Photograph 15. Insulated piping in basement



Photograph 16. Insulated tank in basement

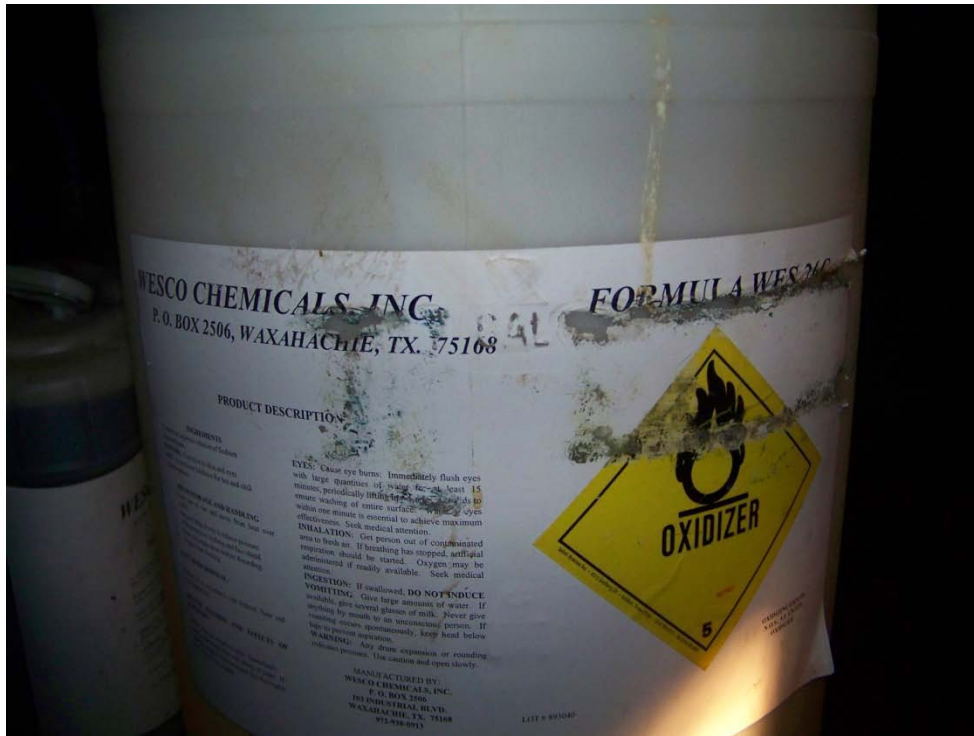

Photograph 17. Boiler chemicals in basement



Photograph 18. Boiler chemicals in basement



Photograph 17. Insulated boiler in basement



Photograph 18. Depression and manhole cover in basement



Photograph 19. Commercial businesses to the west across N. Beaton Street



Photograph 20. Commercial businesses to the south across East Collin



Photograph 21. Commercial businesses to the north along N. Beaton Street



Photograph 22. Brick exterior on northern building face